Former Veteran's Memorial Medical Center

1 King Place Meriden, Connecticut 06451

Prepared for: City of Meriden

do Juliet Burdelski

Director of Economic Development

142 East Main Street

Meriden, Connecticut 06451

Prepared by: VHB/ Vanasse Hangen Brustlin, Inc.

100 Great Meadow Road, Suite 200

Wethersfield, CT 06109

Former Veteran's Memorial Medical Center

1 King Place Meriden, Connecticut 06451

Prepared for:

City of Meriden

c/o Juliet Burdelski

Director of Economic Development

142 East Main Street

Meriden, Connecticut 06451

Prepared by:

VHB/Vanasse Hangen Brustlin, Inc.

Project Engineer:

Shelby A. Miller

Project Manager:

Peter J. Chiarizio, LEP

May 2014

Table of Contents

Execu	itive Sun	nmary	1
1.0	Intro	duction	8
	1.1 1.2 1.3 1.4 1.5 1.6	Purpose. Scope of Services	
2.0	Site D	Description	11
	2.1 2.2 2.3 2.4	Location and Legal Description	11 11 12 12
3.0	User	Provided Information	14
	3.1 3.2 3.3 3.4 3.5 3.6 3.7 3.8	Title Records Environmental Liens or Activity and Use Limitations	14 14 15 15 15
4.0	Recor	ds Review	17
	4.1	Standard Environmental Records	17 18 18 Radii 19
	4.2	4.2.1 Assessor's Office and City Clerk's Office	19 20 20 20

	4.3	Physica	al Setting Source(s)	21
		4.3.1	Topography	21
		4.3.2	Soils/Surficial Geology	22
		4.3.3	Bedrock Geology	22
		4.3.4	Groundwater	22
		4.3.5	Wetlands	23
		4.3.6	Surface Water	23
		4.3.7	Flood Plains	23
		4.3.8	Threatened and Endangered Species	
	4.4	Historic	al Use Information on the Property	
		4.4.1	Sanborn Maps	
		4.4.2	City Directories	
	4.5	4.4.3	Aerial Photographs	
	4.5		al Use Information on Adjoining Properties	
5.0	Site R	econnais	ssance	27
	5.1		dology and Limiting Conditions	
	5.2		spection	
		5.2.1	Interior Observations	
	5.3	5.2.2 Summ	Exterior Observationsary of Environmental Site Features	
	5.5	5.3.1	Hazardous Substances and Petroleum Products (Drums and Other	33
		0.0.1	Containers)	33
		5.3.2	Underground and Aboveground Storage Tanks	
		5.3.3	Wells, Drywells (Underground Injection Control), Floor Drains, Sumps,	00
		0.0.0	Manholes and Catch Basins	34
		5.3.4	Odors	
		5.3.5	Pools of Liquid	
		5.3.6	Polychlorinated Biphenyls (PCBs)	
		5.3.7	Pits, Ponds and Lagoons	
		5.3.8	Staining – Exterior Soil and Pavement, Interior Floors	
		5.3.9	Stressed Vegetation	
		5.3.10	Solid Waste, Debris and Disposal	
6.0	Non-S	Scope Co	nsiderations	38
	6.1	Lead-B	ased Paint (LBP)	38
	6.2		os-Containing Materials	
7.0	Interv	iews		39
	7.1	Intervie	w with Owner	39
	7.2		w with Site Manager/Occupants	
	7.3	Intervie	ws with Local Government Officials	39
8.0	Findi	ngs		40
9.0	Opini	on		43
10.0	Cond	usions		44
11 0	Data	Canc/Da	viations	15

VIIB Vanasse Hangen Brustlin, Inc.

12.0	Signature of Environmental Professionals	46
13.0	References	47

Figures

Figure No.	Title		
1	Site Locus Map		
2	Site Plan		
3	Areas of Concern Map		

Appendices

Appendix	Description
A	Limitations
В	2013 Data Package
С	Environmental Data Resources, Inc. (EDR) FirstSearch Report
D CTDEEP List of Contaminated or Potentially Contaminated Sites	
E	List of Significant Environmental Hazards Reported to the CTDEEP
F City of Meriden File Review Information	
G CTDEEP Natural Diversity Data Base Map - City of Meriden, CT	
Н	EDR Certified Sanborn® Map Report
I	EDR City Directory Image Report
J	Site Photographs

Executive Summary

The City of Meriden (the Client) engaged Vanasse Hangen Brustlin, Inc. (VHB) to conduct a Phase I Environmental Site Assessment (ESA) of the former Veteran's Memorial Medical Center identified by the City of Meriden Tax Assessor's Office as Parcel ID 0112-0054-0001-0019 (the Site). Work was conducted in accordance with VHB's Proposal for services between VHB and the Client dated March 21, 2014. This report contains all of the limitations inherent in these methodologies in addition to those limitations presented in **Appendix A** of this report.

The Site is zoned as Transit-Oriented Development – Hanover (TOD – Hanover). The Site is approximately 5.64 acres in size. There is one large abandoned building and a former parking garage structure on the Site. The Site is bounded on the north by Orange Street beyond which is a cemetery, on the south by Bronson Avenue beyond which is residential homes, on the east by Cook Avenue and beyond by residential homes and small commercial businesses, and to the west by Queen Street and residential homes. Prior to the property being abandoned, it was serviced by underground utilities including public water and sewer.

An environmental database search conducted by Environmental Data Resources, Inc. (EDR) revealed that the Site was listed on the following databases:

- ➤ A erometric Information Retrieval System Facility Subsystem (USAIRS) database with an EPA Plant ID of 110001730039 under the name of Veterans Memorial Medical Center. The Site is also listed on the USAIRS database with an EPA Plant ID of 110002351749 under the name of J.E.M., Inc.
- ➤ Spills database with a Case Number 9701017.
- ➤ Underground Storage Tank (UST) database as Facility ID No. 80-7086 under the name Veterans Memorial Medical Center. Six USTs are listed in the database search, four of which are identified as "temporarily closed" and two of which are identified as "permanently closed."
- ➤ Brownfields database listed in EPA Region 1 under the name Veterans Memorial Medical Center. Past Site use is listed as a hospital.

A file review conducted at the Connecticut Department of Energy and Environmental Protection (CTDEEP) revealed the following pertaining to the Site:

- ➤ A UST compliance evaluation was conducted for the Site in June of 2007. A UST compliance inspection was completed for the Site in April of 2013. The two compliance forms indicate the following information about the Site:
 - ➤ 20,000-gallon heating oil UST installed on 1/1/1954. Tank status is "permanently out of use."
 - ➤ 15,000-gallon heating oil UST installed on 10/1/1990. Tank status is "temporarily closed."
 - Two 2,000-gallon gasoline USTs installed on 2/1/1982. Tank status for both is "temporarily closed."
 - > 5,000-gallon heating oil UST installed on 2/ 1/ 1982. Tank status is "temporarily closed."
 - > 10,000-gallon heating oil UST installed on 3/ 1/ 1984. Tank status is "currently in use."
- ➤ A 'Notification of UST Removal/ Replacement' dated February 22, 1999 indicates the intention to remove a 5,000-gallon diesel UST. The tank will be replaced with a 2,000-gallon UST.
- ➤ A letter dated October 19, 1988 indicates the intention to remove a 20,000-gallon oil UST from the Site.

VHB inspected the majority of the interior portions of the Site on April 17, 2014 and April 24, 2014. Several areas of the Site were inaccessible during the Site reconnaissance. Two of the sub-basements encountered on April 17, 2014 could not be inspected due to major flooding (between eight and ten inches in one area and frozen ice chunks up to four feet in the other area). Several hallways could not be inspected due to bolted doors or doors that appeared to be unstable and therefore not safe to enter.

In several areas of the basement, VHB observed the storage of paint and other materials. Most of the paint was stored in shelving units. A variety of other buckets and containers, including 1-liter, 1-gallon, 2-gallon, 5-gallon, 10-gallon, 55-gallon and other sizes of various products were observed. Some of the products within these containers including rubber & vinyl cove base adhesive, gasoline, clear adhesive, refrigerant oil, and plaster. In general, VHB did not observe any evidence of a release of material from these containers. There were several exceptions, which are further discussed in **Section 5.3.8**.

VHB observed a large quantity of fluorescent light bulbs in one of the storage rooms in the basement. At least 20 boxes of bulbs, in varying lengths, were observed on a shelving unit. In an adjoining room labeled 'Crib,' VHB observed dozens of boxes of incandescent and other small light bulbs. Also in the Crib, VHB observed approximately eleven fire extinguishers. It appeared that the fire extinguishers were still live, with the pins still in place and the gauges reading full.

VHB encountered an abundance of pipes in the basement. The majority of the pipes appeared to be wrapped. Upon closer inspection, VHB believes that the wrapping contains asbestos. While a large portion of the wrapping is intact, VHB observed several areas where the wrapping had been disturbed, exposing fibers that may contain asbestos.

A large freight elevator was present proximate to the autopsy room/ small morgue. It appears that this elevator was operated with cables. No signs of hydraulic oil were present.

VHB observed several crawl areas throughout the basement that appeared to contain the connections and controls for the piping in the building. The crawl spaces were labeled with either or both of the signs 'RESTRICTED AREA. A SBESTOS. When Entering Area Use Proper Procedures.' and 'DANGER. Confined Space Authorized Personnel Only.'

Several small storage rooms throughout the basement contained trash bags filled with insulation. The loading dock of the building is filled with trash. It appeared that this was used as a small dumping area for a time. The trash includes metal, pipes, insulation, containers, etc. An oil slick was available between the mound of trash and several 5-gallon buckets located near the trash. Due to poor lighting, it was not determined if the oil came from the buckets or from something within the trash pile. Tires were also observed in the loading dock and throughout the basement.

The atrium on the first floor appeared to be the location of many trespassers over the years of the building abandonment. Evidence of trespassers included debris, graffiti, other vandalism, and scorch marks where fires had been started. A maintenance room was observed adjacent to the atrium. Several containers of cleaning products were observed in this room along with cleaning supplies such as paper towels, gloves, etc. All of the containers of products were small in size and appeared to be in good condition. There were no signs of a release in this room.

The kitchen was located on the first floor. Several large walk-in refrigerator and freezer units were observed. Mold was observed inside these units, as well as outside the units. Large cooktop and stove units were also observed in the kitchen area. These units all appeared to be rusty and in poor condition. A reas of grease staining were observed throughout the floor in the kitchen. Several floor drains were noted in the floor in the kitchen area. The destination of these floor drains was not determined. Pools of water and plaster debris were observed in the general vicinity of some of the floor drains.

In a hallway located off the kitchen area, VHB observed a room filled with solid waste debris. Notable debris included a mattress, a couch, bags of garbage, and other household items. Some minor staining was noted on the floor. Due to limited lighting, VHB was unable to determine if the staining was likely from water or from oil/ hazardous materials.

Throughout the building, VHB observed peeling paint in hallways and in various rooms. Other building debris, such as fallen ceiling tiles, dangling lights, chunks of plaster and rotting wood were also abundantly present in the building. Pools of water were also common.

Rooms on several floors were observed to contain debris, especially insulation and pipe wrapping. Based on other observations and markings within the building, it is possible that this insulation and/or pipe wrapping material may contain asbestos. Black plastic bags were also located in these rooms. While the contents of each bag could not be confirmed, openings or rips in several of the bags indicated that insulation was also contained inside.

Laboratory spaces were encountered on the third floor of the main hospital area. Vents were abundant in the ceiling spaces of each laboratory room. The floors were generally tiled. Cabinets, sinks, chemical storage areas, and Bunsen burner connections were observed. VHB inspected a majority of the cabinets and did not find any containers of chemicals. Several areas of minor staining were observed on some of the shelves. A walk-in refrigerator/ freezer was also located near the laboratory spaces. VHB was unable to inspect the interior of this unit.

Animal droppings were observed on the upper levels (Floors, 5, 6, and 7) of the main hospital area. Animal droppings were also observed in the stairwells to these floors. Several live birds were observed nesting in former patient rooms.

VHB also inspected the basement of the nurse's building. Several of the rooms in the basement had small pits that appeared to be for sump pumps. Staining was observed along the edges of the pits. A small elevator was observed in this portion of the building. The mechanical aspects appeared to consist of a motorized pulley system rather than a hydraulic cylinder. Some staining was observed around the mechanical equipment.

VHB inspected the exterior portions of the Site on April 24, 2014. A majority of the exterior portions of the Site were accessible during the Site inspection. Several courtyard areas have been boarded up to inhibit trespassing at the Site. VHB was unable to gain access to these cordoned off areas.

Solid waste debris has begun to pile in the northwest corner of the Site. Based on the location, it is possible that the debris is coming from adjoining residential properties. A loading dock is located on the south side of the property and is accessible from Bronson Avenue. The pavement in the loading dock area was in poor condition, with cracks and staining observed throughout. The loading dock entrances on the face of the building appeared to be in poor condition. VHB observed several patches in the pavement that indicated prior drilling work at the Site. A smoke stack was located proximate to the loading dock. The stack appeared to be in good condition. There was a small paved area around the smoke stack. VHB observed several castings in

the paved area which indicated the presence of underground storage tanks below. Based on the number of castings, VHB estimates two or three USTs may be present. Additional drilling patches and several monitoring wells were observed in this area. VHB also observed a storm water catch basin in this area.

VHB observed a monitoring well in the sidewalk on the east side of the property.

VHB did no observe any bedrock outcrops during the Site reconnaissance.

The results of this assessment have revealed the following known or suspect recognized environmental conditions (RECs) associated with the subject property:

- Due to the age of the building, it is likely that lead-based paint was used at some point in time. The disposal of lead paint waste resulting from renovation or demolition activities may be subject to federal and State regulations.
- ➤ There is currently one known underground storage tank (UST) located in the courtyard area of the former nurses building. The current contents and condition of the tank is unknown and presents a threat of release to the Site and surrounding area.
- > Staining was observed around the mechanical equipment associated with the freight elevator in the basement of the main building and the service elevator in the former nurses building.
- > Several transformers and other PCB containing equipment were observed in the basement of the former nurses building.
- VHB observed an abundance of containers, of various sizes, conditions, and contents that appeared to be leaking or have had a release at some point in time. The majority of these containers were observed in the basement and the release was on the floor. The floors of the basement are made of concrete, which is porous. Any chemicals that released to the concrete floor may have permeated to the soil and/ or groundwater beneath the building. The following rooms were noted for the presence of leaking containers:
 - Mechanical room
 - Crib room
 - Several basement boiler rooms
- ➤ VHB observed numerous signs stating the presence of asbestos in the basement of the building. The pipes in the basement all appeared to be wrapped with asbestos. Many of the wrappings were disturbed, exposing fibers. The management and disposal of asbestos-containing building materials resulting from renovation or demolition activities may be subject to federal and State regulations.

- ➤ The discharge location of the various floor drains observed on Site is unknown; however, it is likely to be Harbor Brook which is located approximately 250 feet southwest of the Site.
- ➤ An x-ray processing area was observed in the basement of the main building.
- ➤ Site wide groundwater has been impacted at the Site as a result of releases of oil to the Site in 1974 and 1999.
- A storm water catch basin was identified near the underground storage tank area next to the smoke stack on the south side of the building. The discharge point of the outfall is unknown at this time, but it is likely to be Harbor Brook which is located approximately 250 feet southwest of the Site.
- ➤ There are currently two known underground storage tanks located near the smoke stack on the southern side of the Site. The last known paperwork reviewed by VHB in relation to the storage tanks was in 1991. The current contents and conditions of these tanks are unknown and present a threat of release to the Site and surrounding area.
- > Solid waste and several 5-gallon buckets were observed in the loading dock of the building. While exact historic operations could not be confirmed, it is likely that most waste and chemicals entered and exited the building through this area.
- ➤ An oil slick, indicating a release, was observed in the loading dock of the building. The extent and age of the oil slick is unknown at this time. VHB was unable to identify the origin of the oil.
- > Several transformers and other PCB containing equipment were observed in the basement of the main hospital building.

The results of this assessment have not revealed any known **controlled recognized environmental conditions (CRECs)** associated with the subject property.

The results of this assessment have revealed the following known **historical** recognized environmental conditions (HRECs) associated with the subject property:

- ➤ A spill of approximately 400-gallons of heating oil occurred on the Site in December 8, 1974. A filter device was installed in Harbor Brook and removal operations were conducted at two catch basins and at a location identified as M.H. (manhole) "A" in the report.
- ➤ A spill of approximately 300-gallons of No. 6 heating oil occurred on the Site in February 26, 1997. Containment booms were installed and a contractor vacuumed the drains and power-washed the pavement.

The results of this assessment have revealed the following **de minimis conditions** associated with the subject property:

Universal waste was observed throughout the Site. Waste observed included tires, light tubes, light bulbs, etc. The disposal of universal waste may be regulated.

Legal consultation is recommended to confirm the Site's status relative to the Transfer Act. Based upon available documentation, the Site does <u>not</u> appear to meet the definition of a "hazardous waste establishment" as defined by CGS 22a-134 at this time.

1.0 Introduction

The City of Meriden (the Client) engaged Vanasse Hangen Brustlin, Inc. (VHB) to conduct a Phase I Environmental Site Assessment (ESA) of the former Veteran's Memorial Medical Center identified by the City of Meriden Tax Assessor's Office as Parcel ID 0112-0054-0001-0019 (the Site). A Site Locus Map is provided as **Figure 1**. This assessment was prepared in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. Work was conducted in accordance with VHB's Proposal for services between VHB and the Client dated March 21, 2014. This report contains all of the limitations inherent in these methodologies in addition to those limitations presented in **Appendix A** of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report.

1.1 Purpose

The purpose of the Phase I ESA was to identify, to the extent feasible, recognized environmental conditions in connection with the property. This assessment included a site reconnaissance as well as research and interviews with representatives of public agencies, property management firms/ agencies, and regulatory agencies as noted herein.

1.2 Scope of Services

The scope of work for this assessment was in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. Work was conducted in accordance with the Proposal for Services between VHB and the Client dated March 21, 2014. In preparation of the Phase I Environmental Site Assessment, it is assumed that information provided within the Environmental Database, regulatory agency



records, municipal agency records, as well as information obtained from the user is accurate.

1.3 Significant Assumptions

While this report provides an overview of potential environmental concerns, both past and present, the environmental assessment is limited by the availability of information at the time of the assessment. It is possible that unreported disposal of waste or illegal activities impairing the environmental status of the property may have occurred which could not be identified. The conclusions and recommendations regarding environmental conditions that are presented in this report are based on a scope of work authorized by the Client. Note, however, that virtually no scope of work, no matter how exhaustive, can identify all contaminants or all conditions above and below ground.

1.4 Limitations and Exceptions

The report has been prepared in accordance with generally accepted environmental methodologies referred to in A STM 1527-13, and contains all of the limitations inherent in these methodologies in addition to those limitations presented in **Appendix A** of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report. This Phase I ESA is limited to Parcel ID 0112-0054-0001-0019 as identified by the City of Meriden's Tax Assessor's Office.

The conclusions of this report are based in part, on the information provided by others. The possibility remains that unexpected environmental conditions may be encountered at the Site in locations not specifically investigated, or for which state records are incomplete or missing. Should such an event occur, VHB must be notified in order that we may determine if modifications to the conclusions are necessary.

The services performed and outlined in this report were based, in part, upon visual observations of the Site and associated structures. The opinion(s) presented herein cannot be extended to portions of the Site that were unavailable for direct observation and were reasonably beyond the control of VHB.

The objective of this report was to assess environmental conditions at the Site, within the context of our contract and existing environmental regulations within the applicable jurisdiction. Evaluating compliance of past or future owners with applicable local, provincial and federal government laws and regulations was not included in our contract for services.



Our observations relating to the condition of environmental media at the Site are described in this report. It should be noted that compounds or materials other than those described could be present in the Site environment.

1.5 Special Terms and Conditions

No special terms and conditions were applied to this project. Project limitations are provided in **Appendix A**.

1.6 User Reliance

This report may be distributed and relied upon by the Client, its successors and assigns. Reliance on the information and conclusions in this report by any other person or entity is not authorized without the written consent of VHB. VHB assumes no liability for use of this report by any person or entity other than the Client, for which it was prepared.

2.0 Site Description

2.1 Location and Legal Description

The Site is located at 1 King Place in Meriden, Connecticut and is further identified as the City of Meriden Tax Assessor's Parcel ID 0112-0054-0001-0019. The Site is approximately 5.64 acres in size. There is one large abandoned building and a former parking garage structure on the Site. The Site is bounded on the north by Orange Street beyond which is a cemetery, on the south by Bronson Avenue beyond which is residential homes, on the east by Cook Avenue and beyond by residential homes and small commercial businesses, and to the west by Queen Street and residential homes. The current owner of the Site is listed as the City of Meriden. The Site is zoned as Transit-Oriented Development - Hanover (TOC – Hanover). A Site Plan is depicted in **Figure 2**.

2.2 Site and Vicinity General Characteristics

According to the City of Meriden GIS tool, the Site is zoned as Transit-Oriented Development – Hanover (TOD – Hanover). The Site is surrounded by a combination of small commercial and residential properties. The area to the north of the Site is zoned as Multiple-Family District (R-3). The area to the east of the Site is zoned as Multiple-Family District (R-3) and Transit-Oriented Development – Hanover (TOD – Hanover). The areas to the south of the Site are zoned as Two- or Three-Family Residential District (R-2) and Central Commercial Annex (C1A). The area to the west of the Site is zoned as Central Commercial Annex (C1A).

2.3 Current Use(s) of the Property

The property currently consists of a large abandoned building on the eastern half of the Site. There is also a parking garage structure on the western half of the Site. Specific historic tenant uses are described in **Section 4.4.**

2.4 Structures, Roads, and Other Improvements on the Site

There is one abandoned building remaining on the Site. The building was built in segments as described in the following table:

Building			
Name/Number	No. Stories	Construction	Use
Original Building c1923	3	Brick exterior walls. Flat roof.	Hospital
Nursing Building c1925	4	Brick exterior walls. Flat roof.	Hospital
Addition 1 c1952	7	Brick exterior walls. Flat roof.	Hospital
Addition 2 c1958	7	Brick exterior walls. Flat roof.	Hospital
Power Room c1965	2	Brick exterior walls. Flat roof.	Hospital
Addition 3 c1968	3	Brick exterior walls. Flat roof.	Hospital
North Addition Unknown	3	Brick exterior walls. Flat roof.	Hospital
Southern Addition Unknown	2	Brick exterior walls. Flat roof.	Hospital
Laundry Storage Unknown	2	Brick exterior walls. Flat roof.	Hospital
Parking Garage c1980	2	Concrete	Parking

There is one former road that bisects the Site. This road is King Place. Since the building had been abandoned, the road has been blocked off with fences and barricades. On the west side of King Place is a paved parking area and a parking garage structure. The remainder of the Site is vegetated.

2.4.1 Utilities Provided to the Site

Municipal Services/Utilities				
Service/Utility	Date of Connection/Installation	Source		
Sewage Disposal	Currently connected, but not in operation. Original	City of Meriden Water		
	connection/installation date not available, but likely at time of building construction.	Division		
Water Supply	Currently connected, but not receiving water.	City of Meriden Water		
	Original connection/installation date not available, but likely at time of building construction.	Division		
Storm Water	Unknown	Municipal Storm Drains		

25 Current Uses of Adjoining Properties

The current adjoining property uses are:

Adjoining Properties		
North	Cemetery	
South	Residential properties	
East	Commercial businesses and residential properties	
West	Residential properties	

3.0 User Provided Information

The User of this Phase I ESA is the City of Meriden. As such, they are subject to the terms, conditions and limitations referenced herein and as issued in connection with the Agreement and the provisions thereof. Any use or reliance upon information provided in this report, without the specific written authorization of VHB, shall be at the Users' sole risk. Ms. Juliet Burdelski provided information on behalf of the User relative to this Phase I ESA.

3.1 Title Records

VHB is not aware of any title company or professional engaged by the Client to review recorded land title records and lien records.

3.2 Environmental Liens or Activity and Use Limitations

VHB was not informed by the Client of any environmental clean-up liens, engineering controls, land use restrictions or institutional controls against the property that are filed or recorded under federal, tribal, state or local law.

3.3 Specialized Knowledge

The Client does not have any specialized knowledge or experience related to the property or nearby properties.

3.4 Commonly Known or Reasonable Ascertainable Information

The Client has provided VHB with a data package compiled by an environmental consultant about the property in 2013.

3.5 Valuation Reduction for Environmental Issues

The Client has provided no information regarding valuation reduction for environmental issues associated with the Site.

3.6 Owner, Property Manager and Occupant Information

The property owner information was obtained from the Client and confirmed at the City of Meriden Tax Assessor's Office.

3.7 Reason for Performing Phase I ESA

The Phase I ESA was performed in support of potential brownfields redevelopment activities.

3.8 Other/Previous Environmental Reports

The Client provided VHB with a Brownfields Site-Specific Assessment Grant Application Data Package. The report is identified below along with a summary of relevant report information, findings, or RECs. The complete Data Package can be found in **Appendix B**.

Brownfields Site-Specific Assessment Grant Application Data Package prepared December 2013.

- The subject Site is identified as the property located at 1 King Place, which is a former hospital.
- ➤ The City of Meriden is the current owner of the Site and acquired it through involuntary acquisition via tax foreclosure.
- ➤ The hospital was built in phases from approximately 1920 to 1980.
- ➤ Hospital operations ceased in the late 1990s and the Site has been vacant since.
- ➤ Historical Site uses prior to the hospital include a bank, a single family home and a public school.
- ➤ There is a No. 6 fuel oil UST on the southern portion of the Site. Documentation is conflicting about the size of the tank. Listed sizes include 15,000 and 20,000-gallons.

- ➤ UST documentation at the Meriden Fire Marshal's Office did not include UST closure reports or confirmatory soil sample data when prior UST systems were removed or replaced. It is unknown whether the original USTs were removed or whether they were abandoned in place.
- Recommendations in the data package include the removal or abandonment of the UST on Site.
- ➤ A spill of approximately 400-gallons of heating oil spilled from an underground storage tank on December 8, 1974. Approximately 25-gallons entered Harbor Brook.
- ➤ A spill of approximately 300-gallons of No. 6 heating oil during the filling of a UST occurred on February 26, 1997. A small amount was reported to reach Harbor Brook.
- ➤ The Site is listed on the Connecticut DEEP Brownfields Inventory, with the Connecticut Brownfields Redevelopment Authority (CBRA) listed as the contact party.

4.0 Records Review

The purpose of the records review was to obtain and review records that will help identify recognized environmental conditions in connection with the properties. Some records reviewed pertained not only to the properties, but also to properties within an additional approximate minimum search distance in order to help assess the likelihood of problems from migrating hazardous substances or petroleum products. Unless stated otherwise the approximate minimum search distances used below were as specified in the A STM Standard 1527-13.

4.1 Standard Environmental Records

A search of available federal and state environmental records was obtained from Environmental Data Resources, Inc. (EDR) of Milford, Connecticut on April 17, 2014. A copy of this search is provided in **Appendix C**. While it is not possible for VHB to verify the accuracy and/or completeness of information contained in the database report and the files reviewed, the use and reliance of this information is an accepted practice in the performance of environmental assessments and due diligence reviews.

A summary of the regulatory information from the database search is provided in the Federal and State sections below.

4.1.1 Federal Environmental Records

Record Source	Search Radii	Subject Property Listed	Number Sites Within Search Distance
Federal National Priorities List (NPL) Sites	1.0 mile	No	0
Federal Delisted NPL Sites	0.5 miles	No	0
Federal CERCLIS Sites	0.5 miles	No	0
Federal CERCLIS NFRAP Sites	Property & Abutting	No	0
Federal RCRA CORRACTS Sites	1.0 mile	No	2
Federal RCRA Non-CORRACTS TSD Sites	0.5 miles	No	0
Federal RCRA Generators	Property & Abutting	No	0
Federal Engineering/Institutional Control Sites	Property & Abutting	No	0
Federal Emergency Release Notification System (ERNS)	Property	No	N/A

4.1.2 State Environmental Records

Record Source	Search Radii	Subject Property Listed	Number Sites Within Search Distance
State and Tribal Equivalent CERCLIS Sites	1.0 miles	No	24
State and Tribal Landfill or Solid Waste Disposal Sites	0.5 miles	No	0
State and Tribal Leaking Storage Tank Sites	0.5 miles	No	12
State and Tribal Registered Storage Tank Sites	Property & Abutting	Yes	0
State and Tribal Engineering/Institutional Control Sites	Property	No	NA
State and Tribal Voluntary Cleanup Sites	0.5 miles	No	3
State and Tribal Brownfield Sites	0.5 miles	Yes	1

4.1.3 Summary of State and Federal File Records for Subject Property

VHB reviewed relevant files at the CTDEEP for the Site and other relevant properties on April 17, 2014. The Site was identified an Underground Storage Tank (UST) Site. Information gathered from relevant files reviewed at the CTDEEP is summarized in the following table:

Database	ID/File Number	Status
Underground Storage Tank (UST)	80-7086	 Tank 1 was an asphalt-coated or bare steel 20,000-gallon heating oil UST that was installed at the Site in 1954. The tank has since been removed but a date and record of closure was not found.
		 Tank 2, also known as A1R1, was an asphalt-coated or base steel 15,000-gallon heating oil UST that was installed in 1990. The tank is listed as 'temporarily closed,' however no documentation about the temporary closure or plans to permanently close the UST were found.
		 Tank 3 and 4, also known as A2 and A2R1, were coated and cathodically protected steel 2,000-gallon heating oil USTs that were installed at the Site in 1982. Both the tanks are listed as 'temporarily closed,' however no documentation about the temporary closures or plans to permanently close either UST were found.
		 Tank 5, also known as A3, was a coated and cathodically protected steel 5,000-gallon heating oil UST that was installed at the Site in 1982. The tank is listed as 'temporarily closed,' however no documentation about the temporary closure or plans to permanently close the UST were found.
		 Tank 6 was a fiberglass reinforced plastic 10,000-gallon UST that was installed at the Site in 1984. The last document naming the tank lists the status as 'currently in use.'

VHB also reviewed the CTDEEP List of Contaminated or Potentially Contaminated Sites (CPCS) and the List of Significant Environmental Hazards Reported to the CTDEEP. The Site was not listed on the CPCS. There is an abundance of properties listed in the City of Meriden. VHB reviewed the list to determine if any of the listed properties had the potential to impact the subject Site. A copy of the CTDEEP CPCS for Meriden is included in **Appendix D**. The Site was not listed as a Significant Environmental Hazard. There were no Significant Environmental Hazards listed for

the City of Meriden. A copy of the List of Significant Environmental Hazards Reported to the CTDEEP is included in **Appendix E**.

4.1.4 Summary of State and Federal File Records for Sites within Search Radii

Based upon a review of the surrounding properties in the EDR Report, the distance and the likely direction of groundwater flow in the vicinity of the Site, and the regulatory status of any petroleum and/ or hazardous material releases, none of these properties appear to present a significant environmental hazard to the Site.

4.2 Additional Record Sources

For historical information, VHB visited the Meriden City Hall, reviewed aerial photographs, historic Sanborn Maps, topographic maps, historic city directories, and interviewed people knowledgeable of the Site as discussed herein. If available/ applicable, we have also incorporated historical information obtained from environmental reports on the Site prepared by others.

Various municipal offices were visited on April 24, 2014 and April 29, 2014 to obtain information regarding Site history and use; zoning; and OHM use, storage, release, and/ or disposal practices that may have occurred at the Site. Information obtained during the review is summarized below.

4.2.1 Assessor's Office and City Clerk's Office

VHB verified the lot information, property owner, and other relevant information at the Tax Assessor's office. The City Clerk's Office is responsible for the land records. Copies of files obtained during the municipal visit are provided in **Appendix F**. Relevant information obtained from the assessor's office and the clerk's office included the following:

Site Address	1 King Place
Parcel ID	0112-0054-0001-0019
Current Owner	City of Meriden

Transfer Date	Deed Reference	Grantee	Grantor
01/07/2014	4874/313	City of Meriden	Bradley Research Center LLC
02/26/2004	3262/327	Bradley Research Center LLC	JEMInc.

4.2.2 Building Department/Planning Division

The City of Meriden Building Department receives and reviews applications for permits relating to building, electrical, plumbing, etc. The Planning Division enforces land use regulations relating to zoning, subdivision and wetlands. Copies of files obtained during the municipal visit are provided in **Appendix F**. Relevant information obtained from the Building Department and Planning Division included the following:

Zoning	Transit-Oriented District - Heritage	
Date of Construction	1923	
Heat Source	The building was heated via heating oil.	
Of Interest From the File	 The most recent building file included a 2007 inspection of gas pipelines No permits have been pulled for the Site in approximately 20 years 	

4.2.3 Water Division

The Water Division is in charge of obtaining, treating, and delivering a public water supply of satisfactory quality under adequate pressure to the residents of Meriden. The water supply includes six surface water reservoirs and six groundwater wells. Relevant information obtained from the Division included the following:

Water Supply	City of Meriden Water Division	
Water Source	Six surface water reservoirs and six groundwater wells	

According to Mr. Peter Miller, of the Neighborhood Preservation Program, there were at least four water connections associated with the Site. Mr. Miller believes that at least two of the lines have been cut and capped in the street. VHB contacted the Water Division on April 28, 2014. The Division informed VHB that there are four connections to the Site. There is currently no water being provided to the Site; however, according to records at the Water Division, all the connections are still in place and have not been cut or capped. The representative on the phone said that it has been years since the Site has received water service.

4.2.4 Public Works Engineering Services

The Engineering Services portion of the Public Works Department is in charge of issuing storm and sanitary sewer permits.

Sewage Disposal	Meriden Sewer
Date of Sewer Connection	Unknown

During the Site visit, VHB observed several manhole covers in Kings Place that were marked 'Meriden Sewer.' VHB spoke to a representative of the Water Division on April 28, 2014 who stated that since the building does not currently have water service, there is not sewer service currently at the Site. A sewer connection existed in the past, but the Division was unable to confirm when the connection was made.

4.2.5 Fire Marshal's Office

VHB contacted the Fire Marshal for the City of Meriden, Mr. Steve Trella, on April 28, 2014. Fire Marshal Trella informed VHB that based on information in the Site file, there are still three tanks in the ground at the Site. Two of the tanks appear to be on the southern end of the Site near the boiler room smoke stack. According to a Site Figure, one of the tanks in the area contains No. 6 heating oil and the other tank contains No. 2 fuel oil. A 1998 Underground Storage Facility Notification sheet indicates that the No. 6 heating oil tank is 15,000-gallons in size and the No. 2 fuel oil tank is 2,000-gallons in size. The third tank appears to be in a court yard near the former nursing school building. According to the Site Figure, this tank contains No. 2 fuel oil. The 1998 Underground Storage Facility Notification sheet indicates that the tank is 5,000-gallons in size.

Fire Marshal Trella also indicated that there is concern about a large pile of solid waste and miscellaneous debris in the loading dock of the building. The contents within the pile are unknown and may create a multitude of problems if the pile were to catch on fire. Fire Marshal Trella stated that an environmental firm is currently working to test the contents of the pile to determine proper disposal procedures.

4.2.6 Environmental Health

Mr. Scott Bryden, the Environmental Health Administrator for the City of Meriden, informed VHB that there were a few files for the Site relating to bulky waste and garbage issues.

4.3 Physical Setting Source(s)

4.3.1 Topography

The surface elevation of the Site is approximately 153 feet above the National Geodetic Vertical Datum (Environmental Data Resources First Search Report, April 14, 2014). Topography across the Site, according to topographic maps, generally slopes to the south and to the east.

4.3.2 Soils/Surficial Geology

VHB used the U.S. Department of Agriculture (USDA) Web Soil Survey Map. According to the map, the majority of the soil at the Site, approximately 68%, is mapped as 307, or urban land. Approximately 30% of the soil at the Site is mapped as 230B, or Branford-Urban land complex, 0 to 8 percent slopes. 230B is composed of approximately 40 percent Brandford and similar soils, 35 percent urban land, and 25 percent minor components. 230B is well drained. A very small portion of the Site, approximately 2%, is mapped as 306, or Udorthents-Urban land complex. 306 is composed of approximately 50 percent Udorthents and similar soil, 35 percent urban land, and 15 percent minor components. Udorthents are typically well drained soils.

_

4.3.3 Bedrock Geology

According to the Connecticut GIS Data distribution page, the underlying bedrock is characterized as the New Haven Arkose formation. The New Haven Arkose formation consists of reddish, poorly sorted arkose.

During the site reconnaissance, VHB did not observe bedrock outcrops at the Site.

4.3.4 Groundwater

Groundwater in the vicinity of the Site is classified by the CTDEEP as GB. Groundwater resources classified as GB are those whose designated uses are industrial process water and cooling waters and baseflow for hydraulically-connected water bodies and is presumed not suitable for human consumption without treatment. The nearest GA groundwater classification is located approximately 2,750 feet to the east of the Site. GA groundwater is groundwater whose designated uses are existing private and potential public or private supplies of water suitable for drinking without treatment and baseflow for hydraulically-connected surface water bodies. All ground waters not specifically classified are considered Class GA. The Site does not lie within an aquifer protection area. The nearest aquifer protection area is located approximately 1,900 feet to the north of the Site.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology and characteristics of the soil. Based on topography and hydrology of the area, groundwater flow is expected to be generally to the south and east, towards Harbor Brook.

4.3.5 Wetlands

A wetland survey was not part of the scope of services for this A STM Phase I Environmental Site Assessment; however, based upon visual observations during the Site reconnaissance, wetland resource areas do not appear to be present at the Site.

4.3.6 Surface Water

Surface water bodies have not been identified on-Site. The closest surface water body, Harbor Brook, is located just approximately 250 feet to the southwest of the Site. According to the CTDEEP Surface Water Quality Classes, Harbor Brook is classified as B. The classification B is considered by the CTDEEP to be waters whose designated uses are "habitat for fish and aquatic life and wildlife; recreation; navigation; and industrial and agricultural water supply."

4.3.7 Flood Plains

According to the Federal Emergency Management Agency Flood Insurance Rate Map for the New Haven County, Connecticut (Community Panel No. 09009C0166H, dated December 17, 2010), the very southern portion of the Site and the surrounding areas to the south and east are located within a flood area identified as Zone AE. Zone AE is where Base Flood Elevations have been determined. The Base Flood Elevation is the water-surface elevation of the 1% annual chance flood.

4.3.8 Threatened and Endangered Species

VHB personnel reviewed the CTDEEP Natural Diversity Data Base (NDDB), which identifies general areas of concern with regard to state and federally listed Endangered, Threatened, and Special Concern Species and significant natural communities. The Site is not located in an NDDB area. The NDDB map for the City of Meriden is included in **Appendix G**.

4.4 Historical Use Information on the Property

The objective of consulting historical sources is to develop a history of the previous uses of the properties in order to help identify the likelihood of past uses having led to recognized environmental conditions in connection with the property back to first developed use. VHB reviewed various historical information sources and conducted interviews as described in this report. Typical historical sources include Sanborn Maps, city directories, aerial photographs, topographic and other maps, and municipal records. Based on VHB's research the Site appears to have been first

developed in the 1890s. The Site appeared to originally be used for residential purposes and was then developed for hospital use in 1901.

4.4.1 Sanborn Maps

Environmental Data Resources, Inc. provided VHB with copies of certified Sanborn Maps for the Site. VHB reviewed the Sanborn Maps for the following years to identify any potential RECs: 1891, 1896, 1901, 1950, 1953, and 1971. Copies of the maps provided by EDR can be found in **Appendix H**:

Year	Use	Issues Noted	Observations
1891	The Site is not visible in the 1891 Sanborn Map.	None noted.	Surrounding: Mostly vacant with a few residential homes.
1896	Only a small portion of the Site is visible in the 1896 Sanborn Map. A few buildings appear on the Site. They all appear to be residential.	None noted.	Surrounding: Residential
1901	King Street is depicted bisecting the Site. On the east side of King Street, Meriden Hospital has been constructed. Over a dozen small buildings, 'flats,' have been constructed around the hospital. The King Street Public School has been constructed in the location of the present day parking garage.	None noted.	Surrounding: Residential
1950	The portion of the Site on the east side of King Street is not depicted. The King Street Public School has been replaced by the Samuel Huntington Public School. According to dates on the map, the southern portion of the school was built in 1925 while the northern portion of the school was built in 1880.	None noted.	Surrounding: Residential
1953	The portion of the Site on the west side of King Street appears the same. The Meriden Hospital has expanded on the east side of King Street. Additional buildings are labeled 'dinic,' 'helps quarters,' 'laundry,' 'maintenance shop,' 'boiler room,' 'tunnel,' 'laboratory,' and 'nurses home.'		Surrounding: Residential
1971	A few additional buildings have been constructed around the Samuel Huntington Public School. The Meriden Hospital building layout has been changed. A new large portion labeled 'F.R.X. – 1967-68' has been constructed on the northern half of the Site and appears to be in the same location as the present structure in that portion of the Site.		Surrounding: Residential

4.4.2 City Directories

EDR provided a City Directory summary in their report prepared as part of this ESA. According to the summary in the EDR report, a variety of tenants occupied the Site in 1999 including the Counseling Center Veterans Memorial Medical Center, Donaco Property Management, James McGuire, Medsearch Veterans Memorial Medical Center, Midstate Medical Center Laboratory, Prestige Club Midstate Medical Center, and Veterans Memorial Medical Center West Campus. The Site was occupied by the Meriden Express Line in 2003. A complete list of these businesses can be found in **Appendix I**.

4.4.3 Aerial Photographs

VHB reviewed aerial photographs dated 1934, 1951-1952, 1965, 1970, 1985-1986, 1990, 1995, and 2004 for the Site and vicinity provided by the University of Connecticut Libraries Map and Geographic Information Center. A summary of this review is provided below:

Year	Observations	
1934	Site: The Site appears to be developed with two large buildings on the east side of King Place and several smaller buildings surrounding. There is one large building on the west side of King Place and several small, likely residential, buildings.	
	Surrounding: The area to the north of the Site appears to be vacant. The area to the south and west of the Site appears to be residential. Residential homes appear immediately to the east of the Site, but beyond appears to be a large facility with several holding tanks.	
1951- 1952	Site: Several large structures appear to have been added to the existing structures on the east side of King Place. The remainder of the Site appears the same as in 1934.	
	Surrounding: Same as above.	
1965	Site: Same as above.	
	Surrounding: Same as above.	
1970	Site: A large structure has been added to the northwest corner of the Site on the east side of King Place. This structure appears to be in the same location as the present day structure. The remainder of the Site appears the same as in 1965.	
	Surrounding: Same as above.	
1985- 1986	Site: The majority of the Site on the east side of King Place has been developed with building structures. It appears that all of the large portions of the building are now connected. Only three small buildings remain standing solo in the south east corner. The large building located on the west side of King Place has been replaced with a parking structure. Parking areas appear to make up the remainder of the Site.	
	Surrounding: Same as above.	
1990	Site: Same as above. Surrounding: Same as above.	
1995	Site: Same as above. Surrounding: Same as above.	
2004	Site: The three stand-alone structures previously visible in the southeast corner of the Site on the east side of King Place have been removed. Surrounding: The holding tanks previously visible to the east of the Site are no longer present.	

4.5 Historical Use Information on Adjoining Properties

The objective of consulting historical sources is to develop a history of the previous uses of the surrounding properties in order to help identify the likelihood of past uses having led to recognized environmental conditions in connection with the property. The historical uses of adjoining properties to the Site are summarized below. These uses were determined using the standard historical sources noted above.

- ➤ Land to the north of the Site appears to have been vacant from at least 1891 to 2004. In the 2004 aerial photograph, tombstones are visible if the image is zoomed in enough. This is consistent with present Site use as a cemetery. It is possible that the land has always been used for burial.
- ➤ Land to the east of the Site has been developed since at least 1891 with residential homes. Beyond the residential homes, a large facility with holding tanks was present from at least 1934 to approximately 2004.
- ➤ Land to the south of the Site has been developed since at least 1891 with residential homes.
- ➤ Land to the west of the Site has been developed since at least 1891 with residential homes.

5.0 Site Reconnaissance

5.1 Methodology and Limiting Conditions

The Site was inspected by Ms. Shelby Miller of VHB on April 17, 2014. Additional inspection time was required and was completed by Ms. Shelby Miller and Mr. Peter Chiarizio of VHB on April 24, 2014. Ms. Miller was accompanied by Mr. Peter Miller, of the City of Meriden Neighborhood Preservation Program, and Mr. Eric Miller, of the Waterbury Fire Department, on April 17, 2014. Ms. Miller and Mr. Chiarizio were accompanied by Mr. Peter Miller on April 24, 2014. The weather on April 17, 2014 was sunny and approximately 50 degrees Fahrenheit. The weather on April 24, 2014 was sunny and approximately 55 degrees Fahrenheit. Certain areas of the subject property were inaccessible during the day of the inspection. One of the basement areas was flooded with over eight inches of water, limiting access to the area. Another basement area had flooded previously and subsequently froze, filling the area with sheets of ice. Additional hallways and rooms were inaccessible due to safety concerns of unstable doors, hanging equipment, etc.

During the inspection, an exterior and interior walk-through of the building was performed. The exterior of adjoining properties were visually evaluated for any RECs.

5.2 Site Inspection

VHB representatives inspected the subject property on April 17, 2014 and April 24, 2014 accompanied by Mr. Peter Miller as the person knowledgeable about the property. A Site Plan depicting pertinent Site features is provided as **Figure 2**. Photographs taken during the Site reconnaissance are provided in **Appendix J**.

5.2.1 Interior Observations

VHB inspected the majority of the interior portions of the Site on April 17, 2014 and April 24, 2014 as described in the following sections. Due to the size of the building, only the basement and a small portion of the first floor were inspected on April 17, 2014. The remaining floors of the building were inspected on April 24, 2014. Several areas of the Site were inaccessible during the Site reconnaissance. Two of the subbasements encountered on April 17, 2014 could not be inspected due to major

flooding (between eight and ten inches in one area and frozen ice chunks up to four feet in the other area). Several hallways could not be inspected due to bolted doors or doors that appeared to be unstable and therefore not safe to enter.

VHB entered the Site through a main door located on the Orange Street side of King Place. The door opened into a reception area with a receiving desk. Water was visible pooling in various locations across the floor. The ceiling was open, with pipes, vents, and ducts visible. Graffiti was abundant across the walls. Several rooms were visible off of the receiving area. The room to the left was vacant and contained a bathroom inside it. The water that had pooled on the floor in this area was three to four inches deep. The additional rooms encountered off of the reception area and main hallway appeared to be preparation rooms and staff rooms (with lockers to store personal possessions).

VHB and Mr. Miller proceeded to the basement down a stairwell located in the northeast corner of the building. The first room encountered in the basement was a former file room. Large shelving units located on floor tracks were visible throughout the room. The shelves were mostly empty with only a few labels or miscellaneous papers remaining. VHB was able to access the adjacent room by walking between the shelves. A small generator was located on the floor in this room. The generator was not plugged into the wall. No evidence of a release of materials from the generator was observed. As VHB proceeded down the hallway, a large storage/ mechanical room was encountered. VHB observed a large holding container, slightly larger than a 55-gallon drum, with pipes connecting to the container. VHB could not locate any labels on the container or pipes to indicate the purpose. Due to the lack of lighting in this area, VHB was unable to determine if there had been a release of oil or hazardous material from this container.

In several areas of the basement, VHB observed the storage of paint and other materials. Most of the paint was stored in shelving units. A variety of other buckets and containers, including 1-liter, 1-gallon, 2-gallon, 5-gallon, 10-gallon, 55-gallon and other sizes of various products were observed. Some of the products within these containers including rubber & vinyl cove base adhesive, gasoline, clear adhesive, refrigerant oil, and plaster. In general, VHB did not observe any evidence of a release of material from these containers. There were several exceptions, which are further discussed in **Section 5.3.8**.

VHB observed a large quantity of fluorescent light bulbs in one of the storage rooms in the basement. At least 20 boxes of bulbs, in varying lengths, were observed on a shelving unit. In an adjoining room labeled 'Crib,' VHB observed dozens of boxes of incandescent and other small light bulbs. Also in the Crib, VHB observed approximately eleven fire extinguishers. It appeared that the fire extinguishers were still live, with the pins still in place and the gauges reading full.

VHB encountered an abundance of pipes in the basement. The majority of the pipes appeared to be wrapped. Upon closer inspection, VHB believes that the wrapping contains asbestos. While a large portion of the wrapping is intact, VHB observed

several areas where the wrapping had been disturbed, exposing fibers that may contain asbestos.

As VHB continued through the basement, a door labeled with a sign that read 'Caution. Wear your gloves.' was encountered. Behind this door, VHB observed either an autopsy room or a small morgue. One examination table was present in the center of the room. Four coolers used to store bodies were visible in one of the walls. A sign in the hallway next to the door read 'DANGER. FORMALDEHYDE. Irritant and Potential Cancer Hazard. AUTHORIZED PERSONNEL ONLY.' A large freight elevator was present proximate to the autopsy room/ small morgue. It appears that this elevator was operated with cables. No signs of hydraulic oil were present.

VHB observed several crawl areas throughout the basement that appeared to contain the connections and controls for the piping in the building. The crawl spaces were labeled with either or both of the signs 'RESTRICTED AREA. ASBESTOS. When Entering Area Use Proper Procedures.' and 'DANGER. Confined Space Authorized Personnel Only.'

Several operating rooms were identified in the basement area. These rooms contained panels for viewing x-rays and hook-ups for various gases (i.e. oxygen, nitrous oxide, etc.). In some of the rooms, gauges were still connected to the gas hook-ups. Some of the rooms also had instruments still suspended from the ceilings. All of the operating rooms had two sets of double doors.

Several small storage rooms throughout the basement contained trash bags filled with insulation. The loading dock of the building is filled with trash. It appeared that this was used as a small dumping area for a time. The trash includes metal, pipes, insulation, containers, etc. An oil slick was available between the mound of trash and several 5-gallon buckets located near the trash. Due to poor lighting, it was not determined if the oil came from the buckets or from something within the trash pile. Tires were also observed in the loading dock and throughout the basement.

The atrium on the first floor appeared to be the location of many trespassers over the years of the buildings abandonment. Evidence of trespassers included debris, graffiti, other vandalism, and scorch marks where fires had been started. A maintenance room was observed adjacent to the atrium. Several containers of cleaning products were observed in this room along with cleaning supplies such as paper towels, gloves, etc. All of the containers of products were small in size and appeared to be in good condition. There were no signs of a release in this room.

The kitchen was located on the first floor. Several large walk-in refrigerator and freezer units were observed. Mold was observed inside these units, as well as outside the units. Large cooktop and stove units were also observed in the kitchen area. These units all appeared to be rusty and in poor condition. Areas of grease staining were observed throughout the floor in the kitchen. Several floor drains were noted in the floor in the kitchen area. The destination of these floor drains was not

determined. Pools of water and plaster debris were observed in the general vicinity of some of the floor drains.

In a hallway located off the kitchen area, VHB observed a room filled with solid waste debris. Notable debris included a mattress, a couch, bags of garbage, and other household items. Some minor staining was noted on the floor. Due to limited lighting, VHB was unable to determine if the staining was likely from water or from oil/ hazardous materials.

Throughout the building, VHB observed peeling paint in hallways and in various rooms. Other building debris, such as fallen ceiling tiles, dangling lights, chunks of plaster and rotting wood were also abundantly present in the building. Pools of water were also common.

Rooms on several floors were observed to contain debris, especially insulation and pipe wrapping. Based on other observations and markings within the building, it is possible that this insulation and/or pipe wrapping material may contain asbestos. Black plastic bags were also located in these rooms. While the contents of each bag could not be confirmed, openings or rips in several of the bags indicated that insulation was also contained inside.

Laboratory spaces were encountered on the third floor of the main hospital area. Vents were abundant in the ceiling spaces of each laboratory room. The floors were generally tiled. Cabinets, sinks, chemical storage areas, and Bunsen burner connections were observed. VHB inspected a majority of the cabinets and did not find any containers of chemicals. Several areas of minor staining were observed on some of the shelves. VHB observed an oven/ incubator on a countertop in one of the laboratory rooms. A walk-in refrigerator/ freezer was also located near the laboratory spaces. VHB was unable to inspect the interior of this unit.

Animal droppings were observed on the upper levels (Floors, 5, 6, and 7) of the main hospital area. Animal droppings were also observed in the stairwells to these floors. Several live birds were observed nesting in former patient rooms.

VHB also inspected the basement of the nurse's building. Several of the rooms in the basement had small pits that appeared to be for sump pumps. Staining was observed along the edges of the pits. A small elevator was observed in this portion of the building. The mechanical aspects appeared to be a motorized pulley system. Some staining was observed around the mechanical equipment.

The following table identifies if specific A STM conditions of concern were noted during the interior inspection and where in this report those are described further.

INTERIOR INSPECTION						
Condition	Observed		Fruith on December of			
	Yes	No	Further Described			
Hazardous Substances or Petroleum Products in Containers	х		Report Section 5.3.1			
Unidentified Substances in Containers	X		Report Section 5.3.1			
Storage Tanks	X		Report Section 5.3.2			
Drains, Trenches or Sumps	X		Report Section 5.3.3			
Wastewater Discharge		X	Report Section 5.3.3			
Wells		Χ	Report Section 5.3.3			
Odors (strong, pungent, noxious)		X	Report Section 5.3.4			
Pools of Liquid	X		Report Section 5.3.5			
Potential PCBs	X		Report Section 5.3.6			
Stains or Corrosion	X		Report Section 5.3.8			

5.2.2 Exterior Observations

VHB inspected the exterior portions of the Site on April 24, 2014. A majority of the exterior portions of the Site were accessible during the Site inspection. Several courtyard areas have been boarded up to inhibit trespassing at the Site. VHB was unable to gain access to these cordoned off areas.

In general, exterior areas of the Site were in fair condition. The hospital building occupies the majority of the eastern half of the Site. There are landscaped areas between the building and each adjacent roadway. A parking structure and paved parking area occupy the majority of the western half of the Site. Landscaped areas also surround these features.

The paved parking area appears to be in poor condition. The pavement is cracked in numerous places and weeds and other vegetation appear to be growing up through the cracks. Solid waste debris has begun to pile in the northwest corner. Based on the location, it is possible that the debris is coming from adjoining residential properties. A landscaped area is located between the parking area and King Place. The landscaping includes mulch, low lying shrubs and weeds. VHB did not observe any staining or stressed vegetation.

There is a chain-link fence between King Place and the hospital building, to deter trespassers from attempting to break windows. Some landscaping is present within the fenced area. The landscaping includes mulch and various types of shrubbery. VHB did not observe any staining or stressed vegetation.

King Place is in fair condition. Some cracks are observed in the pavement. No major staining was observed on the surface. VHB observed several manhole covers labeled 'Meriden Sewer' in the pavement. VHB observed one storm water catch basin in the pavement as well. The destination of this catch basin was not confirmed, however it is likely that the discharge point is Harbor Brook, which is located a few hundred feet from the Site.

A loading dock is located on the south side of the property and is accessible from Bronson Avenue. The pavement in the loading dock area was in poor condition, with cracks and staining observed throughout. The loading dock entrances on the face of the building appeared to be in poor condition. VHB observed several patches in the pavement that indicated prior drilling work at the Site. A smoke stack was located proximate to the loading dock. The stack appeared to be in good condition. There was a small paved area around the smoke stack. VHB observed several castings in the paved area which indicated the presence of underground storage tanks below. Based on the number of castings, VHB estimates two or three USTs may be present. Additional drilling patches and several monitoring wells were observed in this area. VHB also observed a storm water catch basin in this area. The remainder of the south side of the Site was grass. The grass appeared to be in fair condition.

The east side of the property featured some landscaped areas and a paved area that appeared to provide access to several garage bays. The pavement appeared to be in fair condition. The landscaping consisted of grass, small trees and shrubbery. VHB observed a monitoring well in the sidewalk on the east side of the property.

The north side of the property was landscaped areas between the hospital building and Orange Street. The landscaped areas were mostly dirt and mulch with a few small trees.

VHB did no observe any bedrock outcrops during the Site reconnaissance.

The following table identifies specific A STM conditions of concern that were or were not noted during the exterior inspection and where in this report they are described further.

EXTERIOR INSPECTION							
Condition	Observed		C. without Described				
	Yes	No	Further Described				
Hazardous Substances or Petroleum		X	Report Section 5.3.1				
Products in Containers		^					
Unidentified Substances in Containers		Χ	Report Section 5.3.1				
Storage Tanks	Χ		Report Section 5.3.2				
Wastewater/Storm Water Discharges			Report Section 5.3.3				
Catch Basins	Χ		Report Section 5.3.3				
Septic Systems/Cesspools		Х	Report Section 5.3.3				
Wells (Drinking Water, Monitoring, Etc.)	Χ		Report Section 5.3.3				
Odors (strong, pungent, noxious)		Χ	Report Section 5.3.4				
Pools of Liquid		Χ	Report Section 5.3.5				
Potential PCB Containing Equipment		Χ	Report Section 5.3.6				
Pits, Ponds, Lagoons		Χ	Report Section 5.3.7				
Stained Soil or Pavement	Χ		Report Section 5.3.8				
Stressed Vegetation		Χ	Report Section 5.3.9				
Solid Waste/Debris	X		Report Section 5.3.10				



5.3 Summary of Environmental Site Features

5.3.1 Hazardous Substances and Petroleum Products (Drums and Other Containers)

VHB encountered a large storage/ mechanical room in the basement of the building. VHB observed a large holding container, slightly larger than a 55-gallon drum, with pipes connecting to the container. VHB could not locate any labels on the container or pipes to indicate the purpose. Due to the lack of lighting in this area, VHB was unable to determine if there had been a release of oil or hazardous material from this container.

In several areas of the basement, VHB observed the storage of paint and other materials. Most of the paint was stored in shelving units. A variety of other buckets and containers, including 1-liter, 1-gallon, 2-gallon, 5-gallon, 10-gallon, 55-gallon and other sizes of various products were observed. Some of the products within these containers including rubber & vinyl cove base adhesive, gasoline, clear adhesive, refrigerant oil, and plaster. In general, VHB did not observe any evidence of a release of material from these containers. There were several exceptions, which are further discussed in **Section 5.3.8**.

Various maintenance/ supply rooms were observed throughout the building. Cleaning products were observed in these rooms in both small spray bottles and large dispensers.

Several buckets and drums were observed in the loading dock of the building. VHB was unable to identify the contents of these containers. An oil slick was observed between the containers and a large pile of solid waste debris. Due to poor lighting, VHB was unable to determine if the oil was released from the containers or from something within the pile of waste and debris.

5.3.2 Underground and Aboveground Storage Tanks

VHB observed castings and fill/ vent pipes for several underground storage tanks on the south side of the property. Based on the number of castings and the fill/ vent pipes observed, VHB was unable to determine if two or three tanks were present. Several monitoring wells were observed in the areas surrounding the tanks. VHB also observed several asphalt patches that appeared to be from previous drilling work at the Site.

5.3.3 Wells, Drywells (Underground Injection Control), Floor Drains, Sumps, Wanholes and Catch Basins

VHB observed several monitoring wells around the exterior of the property. The majority of the monitoring wells were located in the area of the USTs. Several other monitoring wells were observed on the east side of the property between the Site building and Cook Avenue.

VHB observed floor drains throughout the building. The floor drains were most present in the basement, kitchen and laboratory areas. The destination of each floor drain was unable to be determined. Several of the floor drains were in close proximity to debris, such as plaster or peeling paint, and pools of liquid.

VHB observed two areas of apparent sump pumps in the basement of the former nursing building. The areas were square pits in the concrete floor. Staining was observed along the edges of both of these pits. Based on the characteristics of the stains, they appear to be resulting from oil or a similar material.

VHB observed manhole covers throughout the property. The manhole covers were most abundant along King Place, where many utilities appear to enter the Site. Most of the manholes were labeled as water or sewer. One manhole cover was observed in the basement of the building. This manhole was not labeled and its purpose was not determined.

VHB observed several storm water catch basins on the Site during the exterior inspection on April 24, 2014. One of the catch basins was located along King Place. The other catch basin was located in the area of the USTs. The discharge point of these catch basins was not confirmed; however, it is likely that they lead to Harbor Brook, which is located a few hundred feet from the Site.

VHB observed a trench in the floor in the boiler room off of which the flooded and frozen sub-basement was located. The trench appeared to house various pipelines, such as a piping chase. Staining and debris were observed within the trench.

5.3.4 Odors

No unusual odors were noted during the two Site inspections; musty odors permeated the facility.

5.3.5 Pools of Liquid

VHB observed pools of water throughout the interior of the Site building. Pools of water were observed on every floor. The depth of the water ranged from a few



millimeters to a flooded room with approximately eight inches of standing water. Slight sheens were visible on water surfaces observed in the kitchen area. VHB did not observed any pools of any other liquid.

5.3.6 Polychlorinated Biphenyls (PCBs)

PCBs were used until 1978 and are a group of compounds formed by the chlorination of biphenyl. PCBs have extremely high physical and chemical stabilities which led to their being used in many applications, including heat transfer fluids, hydraulic fluids, and dielectrics. PCBs are often found in transformers, capacitors and hydraulic systems. PCBs were also added as a plasticizer in caulking used to seal joints between masonry units and around windows, in addition to other building materials such as paints, mastics, sealants, adhesives, and specialty coatings. A ccording to the U.S. EPA PCBs were used in some buildings primarily between 1950 and 1980.

Electrical equipment containing PCBs are still in use and can pose a serious health hazard if fluids come in direct contact with humans, soil or groundwater. Fires involving electrical equipment containing PCBs can cause the material to be dispersed over a large area and potentially expose many people to a health risk. Because of the health hazard associated with PCBs, they are regulated under the Toxic Substances Control Act ("TSCA"), and sometimes by state agencies.

The Site inspection identified the presence of several electrical transformers, switches, and other electrical equipment at the Site. VHB was not able to locate labeling on any of the transformers to indicate whether or not each unit contained PCB-fluids. Due to the likely age of the equipment, there is potential that PCBs were used.

The disposal of PCB impacted building materials resulting from renovation or demolition activities may be subject to federal and State regulations.

5.3.7 Pits, Ponds and Lagoons

VHB identified two pits in the basement of the nursing building that appeared to have contained sump pumps. Staining was observed along the edge of the pits.

5.3.8 Staining – Exterior Soil and Pavement, Interior Floors

Staining was observed throughout the building. A majority of the staining appeared to be water damage from leaks and the buildup of pools of water.

Some staining was apparent in the kitchen as a result of oil and grease used for kitchen operations. Grease/ oil staining was also observed along the sump pump pits and around the motor for the elevator in the former nurses building.

Staining was observed in the cabinets where paint cans were observed. The staining appeared to be along the edges of the paint cans. A few small areas of staining were observed on the shelves. Staining was also observed on some of the shelves within the "Crib." Upon closer inspection, it appeared that most of the staining was a result of rusting activity.

In one of the boiler rooms, VHB observed several plastic drums of various size and contents. The floor beneath the drums appeared to be stained. Due to poor lighting in this room, the extent of the stain, including its potential cause, was unable to be determined. Several large canisters of gas, without notable labeling, were also observed in this room. The bottoms of the canisters were fairly rusted and staining was observed on the floor beneath. On the opposite side of the room from the plastic drums, VHB observed a 55-gallon blue metal drum. The drum did not have a label. The bottom of the drum appeared black in color and staining was evident on the floor around the drum.

VHB observed an oil slick in the loading dock of the building. The slick appeared to stretch between a large pile of solid waste debris and an area of buckets and drums. Due to limited visibility, VHB was unable to identify the origin of the slick or the length. It was between two and three feet in width.

VHB observed a black area of floor in a large open room near the loading dock. There was a 5-gallon bucket in the black area, which was also against a wall. VHB was unable to determine the material or whether it came from the bucket or from under the wall.

Limited staining was observed in the laboratory cabinetry on the third floor, potentially a result of stored chemicals used in the laboratory.

5.3.9 Stressed Vegetation

No stressed vegetation was noted at the Site during the exterior inspections.

5.3.10 Solid Waste, Debris and Disposal

VHB observed several areas of solid waste, debris, and disposal throughout the Site. There appeared to be a solid waste disposal area in the northwest corner of the paved parking lot. Solid waste observed included household items.

A large pile of solid waste was observed in the loading dock of the building. VHB was able to see electronic waste (computer monitors, etc.), tires, and piping

VIIB Vanasse Hangen Brustlin, Inc.

insulation. The remaining contents could not be identified due to the size of the pile and the limited lighting.

VHB observed stacks of tires throughout the property. The tires appeared to be large in size.

Various rooms throughout the building were filled with solid waste and debris. A majority of these areas were filled with building insulation and pipe wrappings. Several areas contained household items such as mattresses, couches, miscellaneous furniture, clothing, etc.

6.0 Non-Scope Considerations

6.1 Lead-Based Paint (LBP)

In 1978, the U.S. Product Safety Commission issued a ban on paints or surface coatings that contain greater than 0.06 percent lead. Many structures built before 1978 have paint that contains lead (LBP). Lead from paint, chips, and dust can pose serious health hazards if not taken care of properly.

Due to the age of the original building and all of the additions, it is likely that LBP was used during the construction. Peeling paint was observed throughout the building. The disposal of lead paint waste resulting from renovation or demolition activities may be subject to federal and State regulations and the User is advised that prior to building renovations they should retain an expert to evaluate any previously unevaluated areas (such as the basements) and advise beforehand on how to demolish, dispose of, and renovate LBP.

6.2 Asbestos-Containing Materials

A sbestos is the name given to a group of fibrous silicate minerals, typically those of the serpentine group. The tensile strength, flexibility, and non-flammability of asbestos have led to many uses including structural materials, brake linings, insulation, and pipe manufacture. A sbestos is of concern as an air pollutant because when inhaled it may cause asbestosis, mesothelioma, and bronchogenic carcinoma. The 1973 National Emission Standards for Hazardous Air Pollutants partially banned the use of spray-applied asbestos containing building materials (A CBM) in new buildings. The government expanded these regulations in 1975 and 1978 to ban the use of all types of A CBM in new buildings. In 1989, the USEPA announced regulations that would phase out most uses of asbestos by 1996.

During the Site inspection, VHB observed several signs and labels in the basement indicating the presence of asbestos. The management and disposal of asbestos-containing building materials resulting from renovation or demolition activities may be subject to federal and State regulations. The User is advised that prior to building renovations they should retain an expert to evaluate and advise beforehand on how to demolish, dispose or, and renovate ACBM if present.

7.0 Interviews

7.1 Interview with Owner

The Site is currently owned by the City of Meriden, who is also the Client. VHB did not specifically interview the City of Meriden; however, discussions about the property with Ms. Juliet Burdelski occurred via phone calls and emails. VHB was also able to discuss the property with Mr. Peter Miller during the two Site inspections.

7.2 Interview with Site Manager/Occupants

The Site is currently vacant, therefore there is no Site Manager and there are no Site Occupants.

7.3 Interviews with Local Government Officials

Local government officials were contacted through the municipal office research although not specifically interviewed. Information obtained from the officials is included in the municipal file review portion (**Section 4.2**) of this report.

8.0 Findings

The results of this assessment have revealed the following known or suspect recognized environmental conditions (RECs) associated with the subject property:

- Due to the age of the building, it is likely that lead-based paint was used at some point in time. The disposal of lead paint waste resulting from renovation or demolition activities may be subject to federal and State regulations.
- ➤ There is currently one known underground storage tank (UST) located in the courtyard area of the former nurses building. The current contents and condition of the tank is unknown and presents a threat of release to the Site and surrounding area.
- > Staining was observed around the mechanical equipment associated with the freight elevator in the basement of the main building and the service elevator in the former nurses building.
- > Several transformers and other PCB containing equipment were observed in the basement of the former nurses building.
- VHB observed an abundance of containers, of various sizes, conditions, and contents that appeared to be leaking or have had a release at some point in time. The majority of these containers were observed in the basement and the release was on the floor. The floors of the basement are made of concrete, which is porous. Any chemicals that released to the concrete floor may have permeated to the soil and/ or groundwater beneath the building. The following rooms were noted for the presence of leaking containers:
 - Mechanical room
 - Crib room
 - Several basement boiler rooms.
- VHB observed numerous signs stating the presence of asbestos in the basement of the building. The pipes in the basement all appeared to be wrapped with asbestos. Many of the wrappings were disturbed, exposing fibers. The management and disposal of asbestos-containing building materials resulting from renovation or demolition activities may be subject to federal and State regulations.

- ➤ The discharge location of the various floor drains observed on Site is unknown; however, it is likely to be Harbor Brook which is located approximately 250 feet southwest of the Site.
- ➤ An x-ray processing area was observed in the basement of the main building.
- > Site wide groundwater has been impacted at the Site as a result of releases of oil to the Site in 1974 and 1999.
- ➤ A storm water catch basin was identified near the underground storage tank area next to the smoke stack on the south side of the building. The discharge point of the outfall is unknown at this time, but it is likely to be Harbor Brook which is located approximately 250 feet southwest of the Site.
- ➤ There are currently two known underground storage tanks located near the smoke stack on the southern side of the Site. The last known paperwork reviewed by VHB in relation to the storage tanks was in 1991. The current contents and conditions of these tanks are unknown and present a threat of release to the Site and surrounding area.
- > Solid waste and several 5-gallon buckets were observed in the loading dock of the building. While exact historic operations could not be confirmed, it is likely that most waste and chemicals entered and exited the building through this area.
- ➤ An oil slick, indicating a release, was observed in the loading dock of the building. The extent and age of the oil slick is unknown at this time. VHB was unable to identify the origin of the oil.
- > Several transformers and other PCB containing equipment were observed in the basement of the main hospital building.

The results of this assessment have not revealed any known **controlled recognized environmental conditions (CRECs)** associated with the subject property.

The results of this assessment have revealed the following known **historical** recognized environmental conditions (HRECs) associated with the subject property:

- ➤ A spill of approximately 400-gallons of heating oil occurred on the Site in December 8, 1974. A filter device was installed in Harbor Brook and removal operations were conducted at two catch basins and at a location identified as M.H. (manhole) "A" in the report.
- ➤ A spill of approximately 300-gallons of No. 6 heating oil occurred on the Site in February 26, 1997. Containment booms were installed and a contractor vacuumed the drains and power-washed the pavement.

VIIB Vanasse Hangen Brustlin, Inc.

The results of this assessment have revealed the following **de minimis conditions** associated with the subject property:

Universal waste was observed throughout the Site. Waste observed included tires, light tubes, light bulbs, etc. The disposal of universal waste may be regulated.

Legal consultation is recommended to confirm the Site's status relative to the Transfer Act. Based upon available documentation, the Site does <u>not</u> appear to meet the definition of a "hazardous waste establishment" at this time.

9.0 Opinion

It is VHB's opinion that the Phase I Environmental Site Assessment identified conditions indicative of releases or threatened releases of petroleum, hazardous substances, and/ or hazardous materials to soil, groundwater, and soil gas at the Site. This opinion is based on information obtained from previous environmental assessments, observations made during the Site investigation and historical use of the Site as a hospital.

VHB recommends additional environmental assessments to further investigate areas of the Site. A Phase II Environmental Site Assessment is recommended to assess the quality of the surficial soils, subsurface soils and groundwater at the Site for releases of petroleum and other hazardous materials. A dye test is recommended to assess the discharge location of various floor drains within the Site building. A ground penetrating radar (GPR) survey is recommended to confirm the number, locations and approximate size of underground storage tanks at the Site. Prior to the start of Phase II Environmental Site Assessment activities, the City should undertake a Hazardous Building Materials Survey to evaluate the contents within the building. Removal of the building contents will allow for thorough completion of a Phase II Environmental Site Assessment, which, under current conditions, would be hindered by the significant amount of debris throughout the building.

10.0 Conclusions

We have performed a Phase I Environmental Site Assessment in general conformance with the scope and limitations of A STM Practice E 1527-13, the scope of work outlined in our proposal to the Client, and the limitations provided in the text of this report and Appendix A on the property located at 1 King Place in Meriden, Connecticut as described in **Section 1** of the report. Any exceptions to, or deletions from, this practice are described in **Section 11** of this report.

During this Phase I Environmental Site Assessment, VHB has identified recognized environmental conditions at the Site. Based on these findings, VHB recommends a Phase II Site Investigation of potential release areas, a dye test of the floor drain system, and a Site-wide ground penetrating radar survey for UST location. These tasks serve to investigate whether or not there has been any impact to the soil or groundwater at the Site as a result of historic Site activities.

11.0 Data Gaps/Deviations

Based upon VHB's research in an attempt to satisfy all the requirements set forth in the above-referenced standards, the following data gaps were encountered:

- ➤ Interior observations of certain areas were inaccessible for inspection due to safety concerns of blocked doorways or other obstructions.
- ➤ Interior observations of two of the sub-basement areas were not possible due to flooding.
- > VHB did not interview the previous property owners.

12.0 Signature of Environmental Professionals

VHB, declares that, to the best of its professional knowledge and belief, that Peter J. Chiarizio meets the definition of "Environmental Professional" as set forth in 312.10 of 40 CFR 312 and he/ she has the specific qualifications based on education, training and experience to assess a property with respect to the nature, history and setting of the subject property.

VHB has developed and performed the "All Appropriate Inquiries" in conformance with the standards and practices set forth in 40 CFR Part 312, except as otherwise noted in Section 10.0 and elsewhere in this report. Section 10.0 contains specific data gaps and deviations of the research data identified by VHB during preparation of this report and **Appendix A** contains limitations to the work performed by VHB associated with this assessment.

I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

I declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in 312.10 of this part.

Environmental Professional:		
fity/Clejo		
Peter J. Chiarizio, LEP	Date	

13.0 References

Connecticut Department of Energy and Environmental Protection, Aquifer Protection Areas - Meriden, CT Map, April 2014.

Connecticut Department of Energy and Environmental Protection, List of Contaminated or Potentially Contaminated Sites, April 2014.

Connecticut Department of Energy and Environmental Protection, List of Significant Environmental Hazards Reported to the DEP, April 2014.

Connecticut Department of Energy and Environmental Protection, Natural Diversity Data Base Maps - Meriden, CT Map, April 2014.

Connecticut Department of Energy and Environmental Protection, Water Quality Classifications - Meriden, CT Map, April 2014.

Environmental Data Resources, Inc. Certified Sanborn® Map Report (No. 3915976.3), April 17, 2014.

Environmental Data Resources, Inc. City Directory Image Report (No. 3915976.5), April 22, 2014.

Environmental Data Resources, Inc. FirstSearch Report (No. 3915976.2s), April 17, 2014.

Federal Emergency Management Agency Flood Insurance Rate Map, New Haven County, Connecticut, Community Panel No. 09009C0166H, December 17, 2010.

Meriden Building Division, April 2014.

Meriden City Clerk, April 2014.

Meriden Health and Human Services, April 2014.

Meriden Neighborhood Preservation Program, April 2014.

Meriden Planning Division, April 2014.


Meriden Public Works, April, 2014.


Meriden Tax Assessor, April 2014.

United States Department of Agriculture & Natural Resources Conservation Service, Soil Survey of the State of Connecticut, 2003.

University of Connecticut – Connecticut GIS Data, Connecticut Bedrock Geology – Polygon Features Map, 2000.

Figures

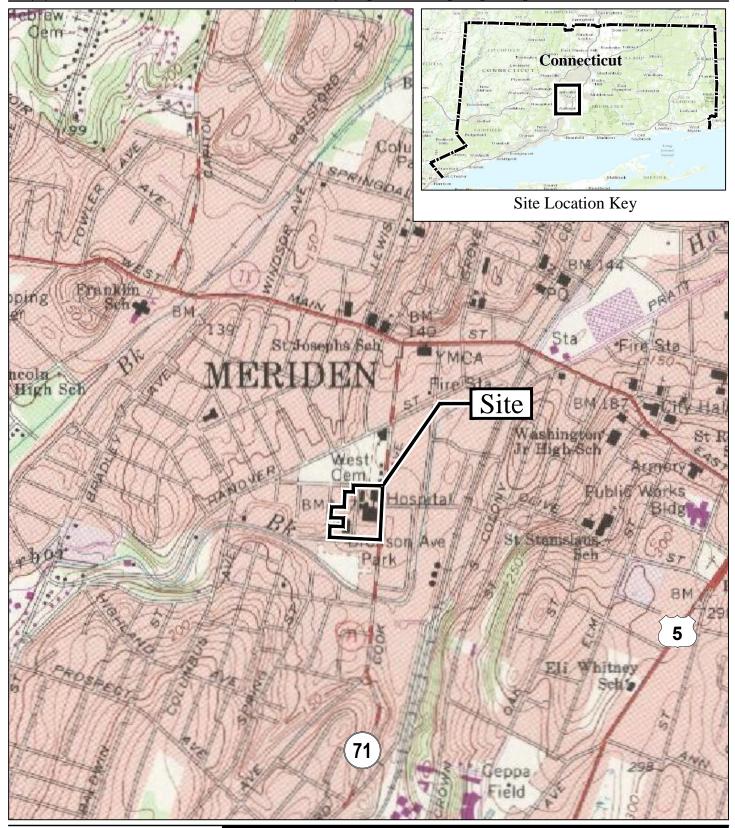

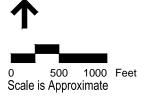


Site Location Map 1 King Street Meriden, Connecticut Vanasse Hangen Brustlin, Inc.

Figure 1 April 2014



Source: 2012 CTECO Aerial Photography

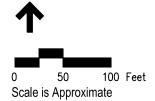


Site Plan 1 King Street Meriden, Connecticut

Vanasse Hangen Brustlin, Inc.

Figure 2



Source: 2012 CTECO Aerial Photography

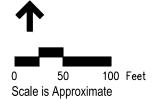

Fgure 3 Areas of Concern (AOC) Map 1 King Street Meriden, Connecticut

Legend: 1. LBP 2. UST 3. Staining 4. Transformer 5. Containers 6. Asbestos 7. Floor Drains 8. X-Ray 9. Groundwater 10. Catch Basin 11. UST 12. Solid Waste 13. Oil Slick 14. Transformer

Vanasse Hangen Brustlin, Inc.

Appendix A: Limitations



Limitations

Former Veterans Memorial Medical Center 1 King Place Meriden, CT

The City of Meriden (the Client) engaged Vanasse Hangen Brustlin, Inc. (VHB) to conduct a Phase I Environmental Site Assessment (ESA) of the vacant property identified by the Meriden Tax Assessor's Office as Parcel ID 0112-0054-0001-0019 (the Site). This assessment was prepared in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report.

- ➤ In conducting this assessment, VHB has obtained and relied upon information from multiple sources to form certain conclusions regarding potential environmental issues at and in the vicinity of the subject property. Except as otherwise noted, no attempt has been made to verify the accuracy or completeness of such information.
- ➤ The objectives of the assessment described in this report were to assess the physical characteristics of the subject property with respect to overt evidence of past or present use, storage, and/ or disposal of oil or hazardous materials, as defined in applicable state and federal environmental laws and regulations, and to gather information regarding current and past operations and environmental conditions at and in the vicinity of the subject property.
- Where access was denied or conditions obscured, VHB makes no report on such areas.
- No attempt has been made to assess the compliance status of any past or present Owner or Operator of the Site with any federal, state, or local laws or regulations.
- ➤ The findings, observations, and conclusions presented in this report are limited by the scope of services outlined in our Proposal between VHB and the Client dated March 21, 2014. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and as included in this report.

- ➤ The assessment presented in this report is based solely upon information gathered to date. Should further environmental or other relevant information be developed at a later date, the Client should bring the information to the attention of VHB as soon as possible. Based upon an evaluation, VHB may modify the report and its conclusions.
- ➤ The EDR was conducted under the Notice of Disclaimer/ Waiver of Liability included in the summary report.

Appendix B: 2013 Data Package

Site Eligibility

a. Basic Site Information.

(a) Site name: 1 King Place

(b) Site address: 1 King Place, Meriden, CT 06451

(c) Current owner: City of Meriden

b. Status and History of Contamination at the Site.

- (a) Contamination: The city owns the site through involuntary acquisition (tax foreclosure). No formal assessments have been conducted on the property; however, a recent site visit performed by a Licensed Environmental Professional (LEP) on December 16, 2013 at the city's request revealed several potential environmental conditions on the site that fall into the category of hazardous substances.
- (b) Operational history and current use(s): The site is a 5.64-acre parcel located in the southwestern quadrant of the Meriden city limits and is improved with two primary structures: a 245,000-square-foot masonry building that was constructed in phases between the early 1900s and the late 1980s for use as a hospital and a two-story, 26,230-square-foot reinforced concrete parking garage building constructed circa 1980. Hospital operations ceased in the late 1990s and the site has since remained vacant.

Prior to use as a hospital, the site had several uses including a bank, single-family homes, and a public school dating back to the late 1800s. Use as a hospital began on a portion of the site in the early 1900s and through the 1980s the hospital slowly overtook surrounding uses, ultimately resulting in the hospital spanning a majority of two city blocks.

(c) and (d) Environmental concerns and method, nature, and extent of contamination: Based on the LEP's inspection of the site and review of select regulatory and public records, the following potential environmental concerns have been identified:

Underground Storage Tanks: A site plan, dated May 1986, depicts the locations of three underground storage tanks (USTs) on the property. Two of the USTs, designated A1 (No. 6 oil) and A2 (No. 2 oil), are shown to the south of the boiler room and one UST, designated as A3 (No. 2 oil), is shown along the northern portion of the site. Underground Storage Facility Notification Forms for the Site include documentation of the following USTs:

- o A-1, installed in 1968, 20,000-gallon capacity, No. 6 heating oil.
- o A-2, installed February 1982, 2,000-gallon capacity, No. 2 heating oil.
- o A-3, installed October 1982, 5,000-gallon capacity, No. 2 heating oil
- o A1R1, replacement to A-1, installed October 1990, 20,000-gallon capacity, No. 6 heating oil. This tank is noted on another USFN form as being a 15,000-gallon capacity tank.
- o A2R2, replacement to A-2, installed February 1982 (this may be an erroneous filing based on the identical installation date with UST A-2.

These registration documents, which are filed with the Meriden Fire Marshal's Office, did not contain additional documentation such as UST closure reports or confirmatory soil sample data when UST systems were removed/replaced. It is unknown whether the original USTs were removed or whether they were abandoned in place. Based on the development history of the site, including the former Samuel Huntington Public School building, it is possible that other USTs are present at the site.

Asbestos Containing Building Materials: Asbestos containing building materials were identified during the December 2013 site reconnaissance. These materials include: unspecified materials stored inside a marked-asbestos containment bag; pipe wrappings (Air Cell and other suspect thermal systems insulation); nine-inch by nine-inch floor tiles and associated mastic; ceiling tile and glue daubs; and various mastics, moldings, and plasters. Further, based on the age of the facility, additional asbestos containing materials may be present. These materials may include (but are not necessarily limited to) roofing materials, vapor barriers, gaskets, textiles, fire and steam hoses, and brick additives.

Lead Containing Materials: Based on the development history of the site, and the relatively older ages of many portions of the buildings, the use of lead-based products in site materials may have been employed. These lead-based products potentially include (but are not necessarily limited to) paint, pipe joint compounds, and pipe welding compounds.

Polychlorinated Biphenyls (PCBs): Numerous compressor units, a total of eight elevators, and other machinery and equipment were observed throughout the facility. It is unknown whether the hydraulic or dielectric fluids within this equipment contain PCBs; however, based on the age of the site buildings, it is possible that PCB-containing dielectric and hydraulic fluids were once utilized on the site. These materials will require waste determination for PCBs and proper removal/disposal at the time of site redevelopment.

Connecticut Non-Hazardous Waste Materials: Numerous waste containers of various sizes (ranging from 5-gallon buckets to 55-gallon drums) were observed throughout the facility. These materials, which include waste boiler coolants, compressor oils, motor oils, lubricants, turbine oil, gasoline, and other flammable petroleum fluids, will require waste determination testing and proper removal/disposal at the time of site redevelopment.

Universal Waste Materials: Fluorescent and halogen-containing light bulbs, batteries, and other suspect mercury-containing equipment (e.g. thermostats, thermometers, etc.) which are present in the building will require proper removal and disposal at the time of site redevelopment.

Solid Waste Materials: Several piles of vehicle tires and sealed trash bags were observed throughout the facility. The contents of the sealed trash bags are unknown and will require waste determination and proper disposal pending determination of waste.

Defunct Building Materials: Numerous piles of broken, destroyed, and dilapidated building materials were observed throughout the facility. These materials should be classified via waste determinations and property disposed/removed from the Site at the time of site redevelopment.

Building Demolition Materials: Thorough waste classifications should be made for all debris which is to be removed from the site as general construction/demolition debris.

Radioactive Materials: A United States Nuclear Regulatory Commission license was identified for the site for in vitro clinical or laboratory testing with radiation sources. Additional evaluation of the site is warranted to determine specific radiation source uses and, to the extent required, radiation sources should be addressed as part of overall site redevelopment.

c. Sites Ineligible for Funding.

The City of Meriden affirms that 1 King Place is:

- (a) not listed or proposed for listing on the National Priorities List;
- (b) not subject to unilateral administrative orders, court orders, administrative orders on consent, or judicial consent decrees issued to or entered into by parties under CERCLA;
- (c) not subject to the jurisdiction, custody, or control of the U.S. government.

d. Sites Requiring a Property-Specific Determination.

To the best of the city's knowledge, this site does not fall into any of the categories that require a property-specific determination to be eligible for funding.

Property Ownership Eligibility

a. CERCLA § 107 Liability.

The City of Meriden affirms that it is not liable for any potential contamination at 1 King Place under CERCLA 107 because it did not contribute to contamination at the site and all disposals of hazardous substances occurred before acquiring the property. The City of Meriden did not own or operate the site when hazardous materials were deposited there, or arrange for treatment or disposal of hazardous materials or accept hazardous materials for transport to disposal or treatment facilities at the site. The City of Meriden is not affiliated with the responsible party. The city acquired the site through involuntary acquisition (tax foreclosure), which makes the city eligible for one of the CERCLA liability protections, as follows "a local or state government entity that acquired the property involuntarily through bankruptcy, tax delinquency, or abandonment, or by exercising its power of eminent domain." The City of Meriden commits to comply with all continuing obligations after acquiring the property. The City has taken appropriate care regarding the hazardous substances at the site, including preventing future releases and exposure to the hazardous substances.

b. Enforcement or Other Actions.

There are no known or anticipated environmental enforcement actions related to this site. There are no known inquiries or orders from federal, state, or local government entities regarding the responsibility of any party for the contamination or hazardous substances at

the site.

- c. <u>Information on Liability and Defenses/Protections Where Applicant Owns the Site or Will Own the Site During the Performance of the Grant.</u>
 - i) Information on the Property Acquisition. The city acquired the property involuntarily through tax foreclosure on January 7, 2014. The City acquired the property for the amount of the back taxes owed on the property, \$1.4 million. The previous owner was Bradley Research Center LLC. The city at no point in time has had any familial, contractual, corporate or financial relationships or affiliations with the previous property owner, Bradley Research Center LLC.
 - ii) Timing and/or Contribution Toward Hazardous Substances Disposal. Disposal of all hazardous substances at the site occurred before the City of Meriden acquired the property. The City of Meriden did not cause or contribute to any release of hazardous substances at the site. The City of Meriden has not, at any time, arranged for the disposal of hazardous substances at the site or transported hazardous substances to the site.
 - iii) Pre-Purchase Inquiry.
 - 1. Property assessment information: N/A the site was involuntarily acquired through tax foreclosure, no environmental assessments have been performed on the site to date.
 - 2. Who performed the AAI investigation or Phase I environmental site assessments and identify his/her qualifications to perform such work: N/A the site was involuntarily acquired through tax foreclosure, no environmental assessments have been performed on the site to date.
 - 3. Appropriate updates of the original assessment: N/A the site was involuntarily acquired through tax foreclosure, no environmental assessments have been performed on the site to date.
 - iv) Post-Acquisition Uses. The site had been vacant prior to the city's involuntary acquisition on January 7, 2014 and remains vacant.
 - v) Continuing Obligations.

Since taking title to the property on January 7, 2014, the City Manager has set up a task force to oversee the immediate and continued security of the building. Task force members include the Chief of Police, Fire Marshal, Director of Planning and Enforcement, City Building Inspector, City Housing Inspector, Director of Parks and Buildings, Director of Economic Development, City Attorney, Director of Public Works, and the City Manager. In the short term, the task force is scheduled to do a formal inspection of the property on January 9, 2014. Following that inspection, the task force will develop a formal plan to secure the building and reduce the potential for trespass and exposure to hazardous materials.

Since acquiring the property, the City has placed concrete (jersey-type) barriers at the north and south entrance to the property to discourage vehicular access. The City has

also installed fencing around the previously open access doors and has boarded and/or locked all access doors. The task force has implemented police foot patrols, and is considering additional recommendations including installation of police cameras and lighting.


The LEP that conducted the site walk through along with the Director of Economic Development and the City Manager in December 2013 has recommended the following to deter trespassers:

- Board up and secure lower level access points, including doors and windows
- Install 6' high chain link fencing around vulnerable entries
- Install adequate and appropriate signage to deter entry

In addition, the LEP recommended that authorized personnel entering the building are equipped with suitable lighting and general personal protective equipment (i.e., hard hats, gloves, safety glasses).

These recommendations will be considered along with those of the task force and implemented immediately. By involuntarily taking the property, the City has nonetheless committed to addressing the long term environmental liabilities by whatever means necessary in order to remediate the site and reduce public exposure to potential environmental hazards.

The City of Meriden confirms that it will comply with all land-use restrictions and institutional controls, assist and cooperate with those performing the assessment and provide access to the property, comply with all information requests and administrative subpoenas that have or may be issued in connection with the property, and provide all legally required notices.

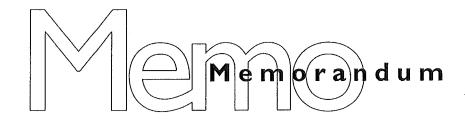



ATTORNEY / CLIENT WORK PRODUCT – PRIVILEGED AND CONFIDENTIAL

DATE: March 7, 2014

To: Deborah L. Moore, Esq.

FROM: Douglas C. Dalena, Esq.

RE: Veterans Memorial Medical Center, Meriden Records Search

This memorandum summarizes a review of federal and state environmental records for Veterans Memorial Medical Center (VMMC) at 1 King Place in Meriden, Connecticut (the Site). Besides VMMC, the Site has also been known as Bradley Research Center (BRC) and Meriden-Wallingford Hospital (MWH).


The research included: 1) a search of EPA's Enforcement and Compliance History Online (ECHO) database at http://echo.epa.gov/; 2) a records request at the Department of Energy and Environmental Protection (DEEP) file room; and 3) a search by DEEP staff of the Site Information Management System (SIMS) for enforcement and compliance data.

Overview

Neither DEEP nor EPA records show any RCRA enforcement or compliance action for the Site. According to Dave Ringquist at DEEP, the department has no Connecticut Property Transfer Act filings for the Site. The Site had air permits for a boiler and a generator and registration numbers for two other boilers. DEP revoked the permits and registration numbers in 2010 after inspectors concluded that the equipment was not operational. The Site has four fuel tanks registered under the State's Underground Storage Tank Program. It is also listed as a Connecticut Brownfields site on DEEP's Brownfields Inventory. At least two oil spills have been reported at the Site; one in 1974 and one in 1997. It also had a water permit for discharge into the nearby Harbor Brook.

Underground Storage Tanks (DEEP File No. SIMS-80-7086)

The Site has four underground storage tanks, according to a DEEP UST compliance inspection checklist dated April 16, 2013:

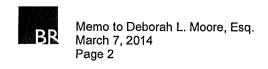

1.	15,000 gallons	#6 Heating Oil	Installed 10/1/1990
2.	2,000 gallons	#2 Fuel Oil (Generator)	Installed 02/1/1982
3.	2,000 gallons ¹	#2 Fuel Oil (Generator)	Installed 2/1/1982
4.	5,000 gallons	Heating Oil	Installed 2/1/1982

Based on its April 2013 inspection, DEEP issued a Notice of Violation (NOV) for 1) failure to perform cathodic protection testing on all four tanks, and 2) failure to remove or permanently close the three tanks installed in 1982 because they were more than 30 years old.


As the new property owner, the City should consider promptly removing or abandoning these tanks in accordance with DEEP requirements and updating DEEP records accordingly.

Spills

DEEP spill report files include two reports of oil spills at the Site:

- 1. On December 8, 1974, 400 gallons of heating oil spilled from an underground storage tank. Twenty-five gallons reached Harbor Brook, to the south off Bronson Avenue. A filter device was installed in Harbor Brook and removal operations were conducted at two catchbasins and at a location identified as M.H. (manhole) "A" in the report. A hand-drawn map in the report shows the spill and cleanup locations.
- 2. On February 26, 1997, 300 gallons of #6 heating oil spilled as a result of overfilling a tank. A small amount reached Harbor Brook through storm drains. Containment booms were installed and a contractor vacuumed the drains and power-washed the pavement. Earlier that night, about 100 gallons spilled, but did not reach the Brook.

¹ It is possible that this is a second reservoir for Tank 2. The tank inventory submitted to DEP in 1998 by the previous owner in 1998 lists only three tanks, and a map in the file shows only three tanks. The two 2,000-gallon tanks are identified as A2 and A2R1 on the DEP inspection checklist.

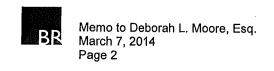

Clean Air Act (CAA)

ECHO lists two CAA source identification numbers for the Site; one for VMMC (0900901920) and one for BRC (0900908855). Under those identification numbers, EPA's Air Facility System (AFS) lists inspection, compliance and enforcement history, including some NOVs.

The Site had air permits and registration numbers for four (4) sources, all of which appear to have been revoked in or by 2010:

1. Air Management Permit No. 100-0020 Y-S Boiler

2. Air Management Permit No. 100-0021 Caterpillar Diesel Generator

3. Registration No. 01000062 Keeler boiler

4. Registration No. 01000063 Keeler boiler

DEEP records included an unsigned version of a letter from DEP Commissioner Amey Marrella revoking both air permits, as well as an unsigned version of a letter from DEP Commissioner Gina McCarthy revoking both registration numbers. DEEP staff could not locate signed and dated versions of the letters.

A 1998 DEP Air Management Bureau Premise Evaluation Report (PER) shows that the Site had operated the following equipment before closing:

- 3 dual-fuel, oil/gas boilers;
- 2. 2 standby diesel generators, 1 permitted (Permit No. 0100-0020, see above) and one too small to require a permit;
- 3. 2 "Steri-Vac" sterilizing units, using 196 lbs. of ethylene oxide per year;
- 4. 1 4-gallon recirculating parts cleaner, which used Graymills "Super Agitene" solvent.

A Pre-Inspection Questionnaire (PIQ) also lists morpholine, an anti-corrosive additive used in steam plants, as having been used at the Site.

A notation in the PER stated that at least some of this equipment was scheduled to be moved to Mid-State Medical Center on Lewis Street in 1998. A DEEP intern wrote in the air file that the Site's previous owner, George DiScala, told him in March 2011 that the three boilers and the generator remained on the Site but were not operational.

Clean Water Act

ECHO lists water permits No. 110001730039, associated with VMMC, and No. 110002351749, associated with BRC, but the records search at DEEP produced no additional information about these permit numbers.

DEEP's Water Permitting Bureau had on file a discharge permit issued in 1997 for "minor non-contact cooling water blowdown" (Permit No. GCW010058). The permit was for a maximum daily flow of 3,000 gallons, discharging to Harbor Brook.

Brownfields

The Site is listed on the Connecticut DEEP Brownfields Inventory, with the Connecticut Brownfields Redevelopment Authority (CBRA) listed as the contact party.

Other Searches

The request for DEEP records also included files on Remediation, Solid Waste, Water Orders, Hazardous Waste, Tank Closure Reports, Industrial Water, Air Pre-Inspection Questionnaires, Water Industrial Surveys and Stormwater Correspondence. ECHO lists no information under RCRA, Air Emissions Inventory, Greenhouse Gas Emissions, Toxic Releases or Clean Water Act (except for the two water permit numbers).

Documents

Brown Rudnick has copies of the spill reports, UST inventories, a map of the storage tanks, and key documents related to the air and water permits and registrations, which we will forward to you by mail.

DEEP FILE ROOM SEARCH





Plant Information

J.E.M., INC 1 KING PLACE MERIDEN, CT 06450 <u>EPA Plant ID</u>: 110002351749

Operating Status:	0	HPV Flag:	
Operating Status Description:	OPERATING	State Registration Number:	10000207834001
State County Compliance Source;	0900908855	Government Facility Code Description:	PRIVATELY OWNED/OPERATED
Region Code:	01	Class Code:	В
Primary SIC Code:	8062	Class Code Description:	POTENTIAL UNCONTROLLED EM
Primary SIC Description:	GENERAL MEDICAL & SURGICA	Compliance Status:	3 0
NAICS Code:	622110	Compliance Status Description:	IN COMPLIANCE - INSPECTIO
NAICS Code Description:	General Medical and Surgical Hospitals	Date Plant Information Last Updated:	03/18/2010

AFS Links

- Overview
- SearchModel
- Law
- AFS Search User Guide
- Contact Us
 AFS Home



Links for This Facility

- Air Facility System
- EnviroMapper for Envirofacts
- MyEnvironment
- Facility Registry System
- Enforcement and Compliance
 History

Air Program Information

Air Program Code	Air Program Description	Air Program Status	Air Program Status Description	Air Program Subpart	Air Program Subpart Description	Class Code	Class Code Description	Compliance Status	Compliance Status Description	
0	SIP	0	OPERATING			В	POTENTIAL UNCONTROLLED EM	3 🗗	IN COMPLIANCE - INSPECTIO	
F	FESOP - (NON- TITLE V)	Х	PERMANENTLY CLOSED	·		в О	POTENTIAL UNCONTROLLED EM	3 6	IN COMPLIANCE - INSPECTIO	

Pollutant Data

-	Air Program Code	Pollutant Code / CAS Number	Pollutant / CAS Description	Attain Indicator	Attain Indicator	Pollutant Compliance Status	ES Pollutant Compliance	Pollutant Class Code	Pollutant Class Description
					Description		Description		, .
-	†								

0	FACIL	FACILITY-WIDE PERMIT REQUIREMENTS			Р	PRESENT, SEE OTHER PROGRA	• .	
0	SO2	SULFUR DIOXIDE	Α	ATTAINMENT AREA FOR A GIV	3	IN COMPLIANCE - INSPECTIO	B	POTENTIAL UNCONTROLLED EM
F	FACIL	FACILITY-WIDE PERMIT REQUIREMENTS			3	IN COMPLIANCE - INSPECTIO	В	POTENTIAL UNCONTROLLED EM

Compliance Monitoring Strategy

	CMS Start Date	FY2008 CMS Indicator	FY2008 CMS Indicator Description	FY2009 CMS Indicator	FY2009 CMS Indicator Description
İ					
1					

Plant Actions

Action Number	Key Action Numbers	Air Program Codes	National Action Type	National Action Description	Action Type	Action Description	Date Achieved	Penalty Amount	Results Code	Results Code Description	Pollutant Code	Regional Data Element	Regional Data Element 16
00005		0	7C	STATE/LOCAL NOV ISSUED	АВ	STTE NOTICE OF VIOLATION	22-AUG- 06		MV	IN VIOLATION	FACIL		15839
00005		F	7C	STATE/LOCAL NOV ISSUED	AB	STTE NOTICE OF VIOLATION	22-AUG- 08		MV	IN VIOLATION	FACIL		15839
00004		0			18	CASE CLOSED	27-OCT- 03		мс	IN COMPLIANCE	:		
00004		F			J8	CASE CLOSED	27-OCT- 03		мс	IN COMPLIANCE			
00003		0	7C	STATE/LOCAL NOV ISSUED	АВ	STTE NOTICE OF VIOLATION	03-SEP- 03		MV	IN VIOLATION			15030
00003		F	7C	STATE/LOCAL NOV ISSUED	АВ	STTE NOTICE OF VIOLATION	03-SEP- 03		MV	IN VIOLATION			15030
00002		0	7C	SȚATE/LOCAL NOV ISSUED	АВ	STTE NOTICE OF VIOLATION	28-NOV- 01		MV	IN VIOLATION			
00001		0	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	22-JAN- 01		мс	IN COMPLIANCE			



Envirofacts Search Results



Plant Information

VETERANS MEMORIAL MEDICAL CENTER (W) 1 KING PLACE MERIDEN, CT 06450 EPA Plant ID: 110001730039

Operating Status:	0	HPV Flag:	
Operating Status Description:	OPERATING	State Registration Number:	10000201152001
State County Compliance Source:	0900901920	Government Facility Code Description:	PRIVATELY OWNED/OPERATED
Region Code:	01	Class Code:	B 1
Primary SIC Code:	8062	Class Code Description:	POTENTIAL UNCONTROLLED EM
Primary SIC Description:	GENERAL MEDICAL & SURGICA	Compliance Status:	3 0
NAICS Code:	622110	Compliance Status Description:	IN COMPLIANCE - INSPECTIO
NAICS Code Description:	General Medical and Surgical Hospitals	Date Plant Information Last Updated:	03/18/2010

AFS Links Overview

- Search • Model
- Law
- AFS Search User Guide
- Contact Us
- AFS Home

Links for This Facility

- Air Facility System
- EnviroMapper for Envirofacts MyEnvironment
- Facility Registry System
- Enforcement and Compliance

Air Program Information

Air Program	Air Program Description	Air Program Status	Air Program Status Description	Air Program Subpart	Air Program Subpart Description	Class Code	Class Code Description	Compliance Status	Compliance Status Description
Code 0	SIP	O	OPERATING	Subpart	Description	В	POTENTIAL UNCONTROLLED EM	3 6	IN COMPLIANCE - INSPECTIO

Pollutant Data

 Program Code	Pollutant Code / CAS Number	Pollutant / CAS Description	Attain Indicator	Attain Indicator Description	Pollutant Compliance Status	ES Pollutant Compliance Description	Pollutant Class Code	Pollutant Class Description
0	P1 ·	FINE PARTICULATES: HIGH PROBABILITY	A	ATTAINMENT AREA FOR A GIV	3	IN COMPLIANCE - INSPECTIO	8	POTENTIAL UNCONTROLLED EM

!		OF VIOLATION						
· 0	РТ	TOTAL PARTICULATE MATTER	Α	ATTAINMENT AREA FOR A GIV	3	IN COMPLIANCE - INSPECTIO	В	POTENTIAL UNCONTROLLED EM
0	SO2	SULFUR DIOXIDE	Α	ATTAINMENT AREA FOR A GIV	3	IN COMPLIANCE - INSPECTIO	В	POTENTIAL UNCONTROLLED EM

Compliance Monitoring Strategy

i	CHE CLA DALL	EVACAR CMC Indiantan	TV2000 CMC Indicator Description	FY2009 CMS Indicator	FY2009 CMS Indicator Description
	CMS Start Date	FY2008 CMS Indicator	FY2008 CMS Indicator Description	F1 2009 CIVIS INDICATOR	F12003 CMS (Ildicator Description
- 1					
ŧ			;		l i
ŧ					
1					l

Plant Actions

Action Number	Key Action Numbers	Air Program Codes	National Action Type	National Action Description	Action Type	Action Description	Date Achieved	Penalty Amount	Results Code	Results Code Description	Pollutant Code	Regional Data Element	Regional Data Element 16
00011		0	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	26-MAR- 98		мс	IN COMPLIANCE			
00010		0			00	0,PX,A2	01-APR- 98						
00009		0	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	18-JUL- 95		МС	IN COMPLIANCE			
00008		. 0	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	05-JAN- 94		мс	IN COMPLIANCE			
00007		0	5C	STATE INSPECTION - LEVEL 2 OR .GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	04-NOV- 91		мс	IN COMPLIANCE			
00006	·	0	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	02-MAY- 90						
		0	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	08-APR- 88						
00004		0	7C	STATE/LOCAL NOV ISSUED	AB	STTE NOTICE OF VIOLATION	17-JUN- 87					-	

00003	0	8C	STATE/LOCAL ADMINISTRATIVE ORDER ISSUED	X1	STATE ORDER ISSUED	20-JAN- 87			
00002	0	7C	STATE/LOCAL NOV ISSUED	AB	STTE NOTICE OF VIOLATION	29-JUL- 86			
00001	o	5C	STATE INSPECTION - LEVEL 2 OR GREATER	13	STATE INSPECTION - LEVEL 2 OR GREATER	17-JUL- 86			

ECHO

EPA Menu



Detailed Facility Report

Facility Summary

BRADLEY RESEARCH CENTER, LLC 1 KING PLACE, MERIDEN, CT 06451

Facility Information (FRS)

FRS ID: 110002351749

EPA Region: 01 Latitude: 41.534287 Longitude: -72.808344

Industry:

Indian Country: --

Regulatory Interests

Clean Air Act: Operating Minor (0900908855)

Clean Water Act:

Resource Conservation and Recovery Act:

Safe Drinking Water Act:

Also Reports

Air Emissions Inventory (EIS): Greenhouse Gas Emissions (eGGRT): Toxic Releases (TRI):

Enforcement and Compliance Summary

Facility/System Characteristics

Facility/System Characteristics

Indian Country Latitude Permit Expiration Date Longitude Statute Identifier Universe Status Areas 41,534287 -72,808344 110002351749 CAA 0900908855 Other Minor Operating SIP

Facility Contact Information

Contact Name Contact Telephone System Identifier Facility Name Facility Address FRS 110002351749 BRADLEY RESEARCH CENTER, LLC 1 KING PLACE, MERIDEN, CT 06451 AFS 0900908855 J.E.M., INC I KING PLACE, MERIDEN, CT 06450 х x

Facility SIC Codes

 System
 Identifier
 SIC Code
 SIC Desc

 AFS
 0900908855
 8062
 -

Facility NAICS Codes

System Identifier NAICS Code NAICS Desc AFS 0900908855 622110 General Medical and Surgical Hospitals

Enforcement and Compliance

Compliance Monitoring History (5 years)

Statute Source ID System Inspection Type Lead Agency Date Finding
No data records returned

Compliance Summary Data

 Statute
 Source ID
 Current SNC/HPV
 Description
 Current As Of
 Qtrs in NC (of 12)

 CAA
 0900908855
 No
 - 01/04/2014
 0

Three Year Compliance Status by Quarter

Program/Pollutant/Violation Statute QTR 1 QTR 2 QTR 3 QTR 4 QTR 5 QTR 6 QTR 7 QTR 8 QTR 9 QTR 10 QTR 11 QTR 12 Type 01/01-04/01-07/01-10/01-01/01-04/01-07/01-10/01-01/01-04/01-07/01-10/01-CAA (Source ID: 0900908855) 06/30 03/31 09/30 12/31 06/30 09/30 06/30 03/31 12/31 03/31 09/30 12/31 2013 2011 2011 2011 2011 2012 2012 2012 2012 2013 2013 2013 No Viol Facility-Level Status No Viol **HPV** History Program/Pollutant in Current Violation CAA SIP

Informal Enforcement Actions (5 Years)

Statute Source ID Type of Action Lead Agency Date
No data records returned

Formal Enforcement Actions (5 Years)

Statute Source ID Type of Action Lead Agency Date Penalty Penalty Description
No data records returned

ICIS Case History

Primary Law/Section Case No. Case Type Lead Agency Case Name Issued/Filed Date: Settlement Date Federal Penalty State/Local Penalty SEP Cost Comp Action Cost No data records returned

Environmental Conditions

Water Quality

Permit ID	Watershed (HUC 8)	Watershed Name (HUC 8)	Watershed (HUC 12)	Watershed Name (HUC 12)	Receiving Waters	Impaired Waters	Combined Sewer System?
110002351749	01100004	QUINNIPIAC	011000040103	Headwaters Quinnipiac River		No	

Air Quality

•	Non-Attainment Area?				Pollutant(s)
Yes No		P	Ozone Lead		
Yes			Particulate Ma	tter	un de la companya de La companya de la co

Pollutants

No data records returned

TRI History of Reported Chemicals Released in Pounds per Year at Site

Year No data	Total Air Emissions records returned	Surface Water Discharges	Underground Injections	Releases to Land	Total On-site Releases	Total Off-site Releases	
TRI	Total Releas	es and Transfers	by Chemical	and Year			

Demographic Profile

Demographic Profile of Surrounding Area (3 Miles)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2010 US Census and American Community Survey data, and are accurate to the extent that the facility latitude and longitude listed below are correct. The latitude and longitude are obtained from the EPA Locational Reference Table (LRT) when available.

Radius of Area: Center latitude: Center Longitude: Total Persons:	3 41.534287 -72.808344 64,050	Land A Water A Population I Percent Mi	rea: 1% Density: 2,303/s	q.mi.	Households Housing Units Households on Pub Persons Below Po	s in Area: lic Assistance:	25,056 27,001 821 18,507
White: African-Amer Hispanic-Ori Asian/Pacific Is	Race Breakdown			Child 5 yea Minors 17 ye Adults 18 y	Breakdown ars and younger: ears and younger: years and older: years and older:	Persons 4,309 (6.73%) 15,495 (24.19%) 48,555 (75.81%) 7,946 (12.41%)	(%)
Education Le Le 9th t Hig	Level (Persons 2 ss than 9th Grac through 12th Gr th School Diploi ome College/2-y	le: ade: na:	Persons (% 2,802 (6.47%) 4,901 (11.32%) 14,754 (34.08%) 12,081 (27.91%))	Income Breakdown Less than \$15,000: \$15,000 - \$25,000: \$25,000 - \$50,000: \$50,000 - \$75,000:	Househo 8,750 (20,21%) 2,415 (9.63%) 6,093 (24,29%) 4,538 (18.09%)	ids (%)

Education Level (Persons 25 & older) B.S./B.A. or More: Persons (%) 8,750 (20.21%) Income Breakdown Greater than \$75,000: Households (%) 9,042 (36.05%)

EPA AND DEEP SEARCHES



Connecticut Department of Environmental Protection

Office use only	
DEP Staff :-	
Records Center Staff -	
Initials	

File Request Form

Requestor Name: DUG DACENA Company Name: BROWN RUDNICK			Date:	2/19/11	/
Address: /85 ASYLUM ST. (Phone Number: 203.982.2566	CITM PLACE	<u> </u>		•	100 020
Facility/Co Name: UETERANS MEMORIAL MED. CENTER Address: L. KING PLACE Town: MERIDEN	REM - KOOCS - PER	IND ECOR PRG	Ps SHAZ SII	区 ORD 图 SOL PIQ	BUST- EXTCR
Facility/Co Name: BRADEY RESEARCH CENTER Address: L KING PL Town: MERIDEN	REM OCS	☐ IND ☐ COR ☐ PRG	☐ P5 ☐ HAZ ☐ SII	☐ ORD ☐ SOL ☐ PIQ	SO TO SO SW SUST STCR
Facility/Co Name:Address:Town:	REM OCS	☐ IND ☐ COR ☐ PRG	☐ P5 ☐ HAZ ☐ SII	☐ ORD ☐ SOL ☐ PIQ	☐ SW ☐ UST ☐ TCR
Facility/Co Name:Address:Town:	REM OCS	☐ IND ☐ COR ☐ PRG	☐ P5 ☐ HAZ ☐ SII	☐ ORD ☐ SOL ☐ PIQ	□ sw □ ust □ tcr
Facility/Co Name: Address: Town:	REM.	☐ IND ☐ COR ☐ PRG	☐ P5 ☐ HAZ ☐ SII	☐ ORD ☐ SOL ☐ PIQ	□ sw □ ust □ tcr
Facility/Co Name: Address: Town:	REM OCS	☐ IND ☐ COR ☐ PRG	☐ P5 ☐ HAZ ☐ SII	ORD SOL	☐ SW ☐ UST ☐ TCR
Facility/Co Name: Address: Town:	REM OCS	☐ IND ☐ COR ☐ PRG	☐ P5 ☐ HAZ ☐ SII	☐ ORD ☐ SOL ☐ PIQ	SW UST TCR
Comments: LOOKING FOR ANY ENVIRONMENT, PAA	CONMENTY SE l's e	etc, PER	7 ON 1175 (41)	THIS ?	PRIZERY L. RURA)
AIR PERMIT NO: 090090192			ST: 5	ins-80) - 70 86
WASER PERMIT NO: 11000173 I- Remediation IND - Indust) orr'dence File	s P5 –	Water Indi	ustrial Survey
	water Corre	spondence Fil	es HAZ -	- Hazardou	

REN

ORD

COR - Oil & Chemical Spills Correspondence PIQ - Air Pre-Inspection Questionnaire

PER - Air Permits

PRG - Air Enforcement

STK - Air Stack Tests

SII - Gas Station Vapor Recovery

IS - Air Indirect Source

OB – Air Open Burning

TAX- Air Tax Abatement

CRA – CT Resource Recovery Authority

TCR - Tank Closure Report

SS - Sub-Surface

WPA -Water Perm Application

DMR – Discharge Monitoring

Reports

DEEP SIMS SEARCH



State of Connecticut Department of Energy and Environmental Protection SIMS - Inquiry



E	nter search name to save:	Save		ew Search	Refine Search
	By Site By Environmental Interest	В	y Client	В	y Document
	records returned: 10 (1 - 10)	Sort By:	Туре	<u> </u>	Descending Go
	display per page 10 💌				
	Type (ID) water Permiting 2 and Flow Status		Start Date	End Date	
T	Application - Non-contact Cooling Water (199700165) Issued		01/17/1997	01/16/1997	0 3 a
	Clients: VETERANS MEMORIAL MEDICAL CENTER, WEST (Applicant, Uni	known affi	iliation)		1
	Sites: VETERANS MEMORIAL MEDICAL CENTER (MERIDEN, CT)				
Г	Permit - Air Quality Registration (100-0062-R) Active		12/27/1967		
•	Clients:		4		
	BRC, LLC (Owner or Operator) Art Englishes:), ard	4nt		
	BRADLEY RESEARCH CENTER, LLC (Meriden, CT)				
Γ	Permit - Air Quality Registration (100-0063-R) Active		12/27/1967		9 B B
	Clients: BRC, LLC (Owner or Operator)				
	Sites: BRADLEY RESEARCH CENTER, LLC (Meriden, CT)				
7					
7	Closed Clients: Closed		09/03/2003	10/27/2003	
	Clients: Eul. TI Cry. and	Ont.			
	Sites: BRADLEY RESEARCH CENTER, LLC (Meriden, CT)				•
_					
	Enforcement Action - Notice Of Violation (NOVUST Active GP13-0018)	(04/16/2013		
<i></i>	*Clients: BRADLEY RESEARCH CENTER, LLC (Respondent)	SI			
	Sites: VETERANS MEMORIAL MEDICAL CENTER (MERIDEN, CT)	J -			
	(Alternative Names: BRADLEY RESEARCH CENTER, LLC)				
****	Permit - Non-contact Cooling Water (GCW010058) Revoked	(01/16/1997	06/11/1997	
	Clients: VETERANS MEMORIAL MEDICAL CENTER, WEST (Permittee)				
	Sites: VETERANS MEMORIAL MEDICAL CENTER, WEST (FEMILLE)				
~					
	Permit - New Source Review (100-0020) Active	(03/16/1987		OIBIN.
	Clients: BRC, LLC (Owner or Operator)	Ena.	ind Enf		
	Sites:			c A	(Files Me destroy

- profile - additional details
- map site - geographical presentation of site location
- documents - check to see if document(s) are associated with the entity.
- application/permit - view/maintain application or permit associated to the environmental interest
- enforcement action - view/maintain enforcement action associated to the environmental interest
- client - view/maintain client associated to the environmental interest
- accounts receivable - view/maintain accounts receivable information associated to the client
- financial service - view/maintain financial service associated to the environmental interest

SIMS Home | Help | Feedback | SIMS Disclaimer

© 2014 The Connecticut Department of Energy and Environmental Protection



State of Connecticut Department of Energy and Environmental Protection SIMS - Enforcement Actions



Assignment List **Environmental Interest** Administration detail | clients | sites | fees | workflow | history | environmental interests

Enforcement Action

Environmental Interest: Notice Of Violation (NVAR1583906105)

Client(s): J.E.M INC. (Respondent) Site(s): J.E.M INC. (MERIDEN, CT)

Status: Closed

Workflow: No Workflow

Enf Action Description: 174-4(C)(1)

Find

Action Date:

Enforcement Action Details

Engineering

Air Management

Engineering & Enforcement (Air-EngTch)

Add New

Verity

Add Document

Enforcement Action ID: NVAR1583906105

Program:

Assigned Staff: Chagnon Teraesa

Category:

Number of Violations:

Date of Discovery:

Action Date: 8/22/2006

Resolution Date: 4/10/2007

Resolution Type:

Launch a report...

Total Penalty: \$0.00

Civil Penalty: \$0.00

SEP Penalty: \$0.00

SEP Description:


NAICS Code:

SIC Code:

SIMS Home | Help | Feedback | SIMS Disclaimer

© 2014 The Connecticut Department of Energy and Environmental Protection

UST

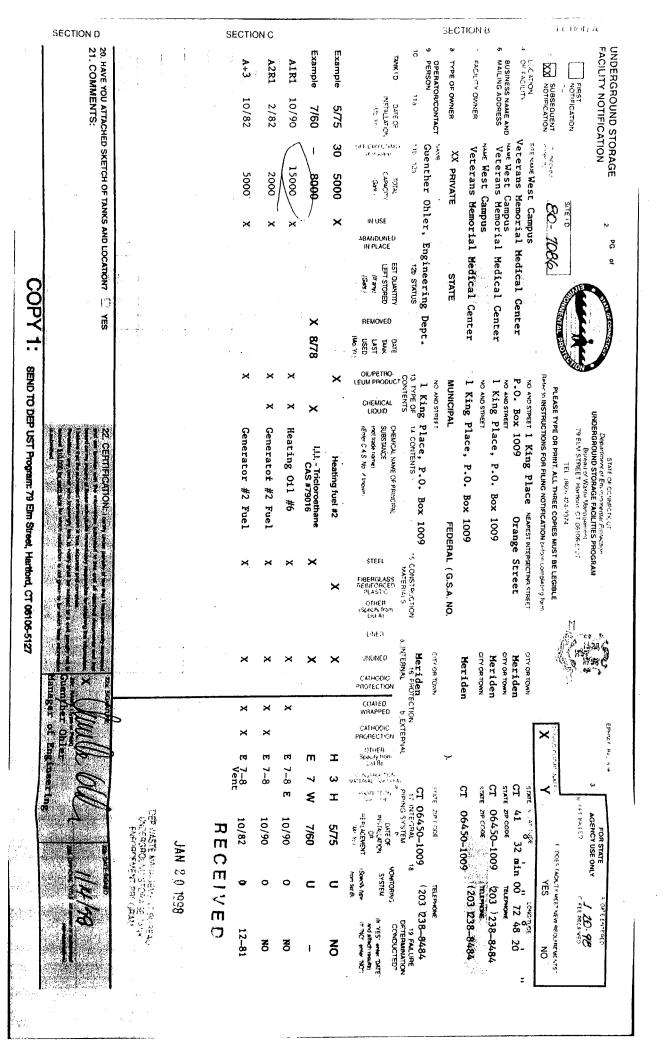

Connecticut Department of



NOTICE OF VIOLATION NOV # NOVUST-GP13-0018 - Site # 80-7086

George Discala/ Bradley Research Center LLC 23 1/2 First Street Norwalk, CT 06855

The purpose of this Notice is to inform you that personnel of the Department of Energy and Environmental Protection ("DEEP") have made observations or otherwise obtained information indicating that a violation of law has occurred at the property located at 1 KING PL, MERIDEN, CT 06451-5415. On 4/16/2013, the DEEP, Bureau of Materials Management and Compliance Assurance, Storage Tank and PCB Enforcement Unit conducted an inspection. Based upon that inspection, it appears that you have failed to comply with Sections 22a-449(d) 101-113 of the Regulations of Connecticut State Agencies. Specifically:

Regulation: CT state regulation (d)-1(e)(1)(E)

Violation Reason: Cathodic protection systems require annual testing to ensure that a structure to soil

test voltage reading of at least minus 0.85 volts is maintained.

Required Action: The UST system owner or operator must have the requisite CP test performed on the tank and/or piping.

Applies To: TANK A1R1 (Containing Heating Oil with Capacity of 15000 gallons)

Applies To: TANK A2 (Containing Heating Oil with Capacity of 2000 gallons) Applies To: TANK A2R1 (Containing Heating Oil with Capacity of 2000 gallons)

Applies To: TANK A3 (Containing Heating Oil with Capacity of 5000 gallons)

Regulation: CT state regulation 110(c)

Violation Reason: UST system components have not been permanently closed, through removal or proper in-place abandonment, prior to the last day of their thirty (30) year life expectancy.

Required Action: Remove or properly abandon in-place UST system components which have exceeded their thirty (30) year life expectancies, and perform the requiste environmental assessment, as specified in section 22a-449(d)-107.

Applies To: TANK A2 (Containing Heating Oil with Capacity of 2000 gallons) Applies To: TANK A2R1 (Containing Heating Oil with Capacity of 2000 gallons) Applies To: TANK A3 (Containing Heating Oil with Capacity of 5000 gallons)

When you have corrected the violation(s) alleged in this Notice, you should submit in writing the details of the corrective action(s). The submittal should be made within thirty (30) days on the enclosed Compliance Statement, and sent to the UST NOV Compliance Office. Until the DEEP has received such a statement, the DEEP will presume you remain in violation. If the violation(s) cannot be corrected within thirty (30) days. provide a schedule of compliance (that includes a timetable) on the enclosed Compliance Statement within thirty (30) days describing the actions you will take to correct the violation(s). Your actions in response to

this Notice, including submission of the attached Compliance Statement, may affect the DEEP's decision whether or not to take formal enforcement action.

The Compliance Statement should include, but not necessarily be limited to (1) initial analytical results for samples taken from the site; (2) analytical results for samples showing that contamination at the site has been corrected; (3) analytical results evaluating the migration or lack thereof of contamination at the site, (4) documentation confirming that the alleged violations have been remedied, and (5) measures taken to prevent future such violations at this site or other sites or (6) a schedule for providing (1) through (5).

- A. Other violations may exist; legal obligations. This Notice does not necessarily specify all violations of Connecticut environmental law or violations of any other legal requirements, which may exist at the aforementioned property. This Notice does not preclude the DEEP or other state, local or federal agencies from commencing any enforcement action regarding any such violations. Your facility may be inspected again pursuant to law and without additional prior notice to determine compliance with state and any applicable federal law. It is your responsibility to comply with all legal requirements, whether or not the DEEP notifies you of any violations or takes any enforcement action against you. Nothing in this Notice relieves you of other obligations under applicable federal, state and local law.
- B. <u>Enforcement action</u>. Civil penalties of up to \$25,000 may be assessed for each day of each violation under Sections 22a-131 and 22a-438 of the Connecticut General Statutes. Notwithstanding the issuance of this Notice, the DEEP may seek such penalties and may issue an order, seek an injunction, or take other legal action under Chapters 439, 445 and 446 of the Connecticut General Statutes.
- C. <u>No assurance by Commissioner</u>. No provision of this Notice and no action or inaction by the Commissioner shall be construed to constitute an assurance by the Commissioner that actions you may take to address the violation alleged herein will result in compliance.
- D. <u>DEEP contact</u>. Should you have any questions regarding the above, please contact the UST NOV Compliance Office via telephone at (860) 424-3886, via FAX at (860) 424-4061, or via email at deep.ustnov@ct.gov.

For DEEP:	For Respondent:
Q. Y. Purple 860-681-2885	
Signature of staff issuing NOV	Signature
4/16/2013	
Date	Name (Please Print)
	Title
	4/16/2013
· · ·	Date



UST Compliance Inspection Checklist
Connecticut Department of Energy and Environmental Protection
Storage Tank and PCB Enforcement Unit
79 Elm Street, Hartford, CT 06106
860-424-3374


GENERAL:

Inspection Date: 4/16/2013

Site ID:	80-7086	Inspector	George Purple
Site Name	VETERANS MEMORIAL MEDICAL CENTER	Reason	Compliance
Site Address	1 KING PL MERIDEN, CT 06451-5415	Inspection Type	Full Inspection
	Contact Information		
	Contact Information GUENTHER OHLER, 1 KINGS PL. Meriden,	CT 06450, Phon	e: 2032388484-
Contacts Contact Type Other Owner		CT 06450, Phon 23 1/2 First Str	e: 2032388484- eet Norwalk, CT 06855

Tank ID: AIRI - Temporarily Closed (15000 gallons) - Installed: 10/1/1990
Constitution Coated & Cathodically Protected Steel Hile Expedential 30 years
(sti-P3) (Convergious Notes January 16 Cathodically Protected Cat
Release Detection
Referse Detection Railman Mellingt Tank Tightness Testing with Inventory Control
Steening Mathan
Corrosion Protection Type: BLANK
<u>भाणपूर्वस्तरम् ल</u> ोक्समहरूप्रस्तातः
Compartment: 1 - Heating Oil (15000 gallons)
Abilipassasatigo: (axxailleassatigo):
angunaszoret szinnegen szi
Piping - Installed: 10/1/1990 [(confidence of Galvonized Steel (co) and (on the first to the f
Constrainting Shifes Piping Installed: 10/90 Piping Spition:
- Pro-
Piping Release Detection Pump Paping American Suction (Check Eine Leak Detector
Valve is at Tank)
aligimi i aya Yeshilo ila
STSSTIFFS A THOU
Tank ID: A2 - Temporarily Closed (2000 gallons) - Installed: 2/1/1982
Coated & Cathodically Protected Steel [10](23)(31)(1)
(sti-P3)
Release Detection Printing Tank Tightness Testing with Inventory Control

Secondary Method	
Corrosion Protection Type: BLANK	કાર(કાવ(મુક્તિ) કાંગેલ (ઇન્ડિપાર) કાંગેલ (કેલ્સ્ટ્રોને કાંગેલ (કેલ્સ્ટ્રોને કાંગેલ (કેલ્સ્ટ્રોને કાંગેલ (કેલ્સ
Compartment: 1 - Heating Oil (2000 gallons)	
Spill Prevention	\$(6)X(3)J(H)\\$(\$)X(3)J(H)\\$(\$)X(6)J(H)\\$(\$)X
Product Notes	isjallia Bravention Profe
Piping - Installed: 2/1/1982	
Construction Bare or Galvonized Steel	Activity of the state of the st
Construction Notes Piping Installed: 02/82	Rights Option
Piping Release Detection	
Pump Type Pressure	Line Leak Detector.
Primary Method	
Secondary Method	
Tank ID: A2R1 - Temporarily Closed (2000 gallons) - Install	led: 2/1/1982
Construction Coated & Cathodically Protected St	eel នៃជាស្រីស្រីសាស
(sti-P3) Construction Notes	ું દુધના (ભૂગોલા)
Release Detection	Jarames towns
Primary Method Tank Tightness Testing with In	nventory Control
Secondary Method	
Corrosion Protection Type: BLANK	
Impressed Current System	इंडिस्साबाल इक्सलेरिक्सी । १५-
Compartment: 1 - Heating Oil (2000 gallons)	
Spill Prevention	६७४५४४४१११११२४४५१११०४४ इ.स.चाप्रस्थरवर्गाकार्यस्य
Product Notes Piping – Installed: 10/1/1990	Estbilia 8 4 A and Constructor
Construction Bare or Galvonized Steel	१९६१० वर्षभाष्ट्रास्ट्रास्ट्रास्ट्रास्ट्रास्ट्रास्ट्रास्ट्र
Construction Notes Piping Installed: 10/90	Triping 41010m.
Piping Release Detection	
Pump Type American Suction (Check	Line Leak Detector
Valve is at Tank)	
Primary Method Secondary Method	
e de colto a tova de la colto	·
Tank ID: A3 - Temporarily Closed (5000 gallons) - Installed	: 2/1/1982
Coated & Cathodically Protected Sto	eel ខ្នុងស្រែងស្រួនបាលេខ
(sti-P3)	er neglations
Release Detection	
Tank Tightness Testing with In	nventory Control
Secretary Mathins (1975)	
Corrosion Protection Type: BLANK	Marie Europe State Control
than the management	मुद्रसिक मुद्रमा स्थापित
Compartment: 1 - Heating Oil (5000 gallons)	ENGRE THAT SECOND SECOND
\$ 2-cyle 54,275-140 \$ \$ \$ \$	જાય હતી કરિયા તો ઉત્તર
eron concerts	galding and production

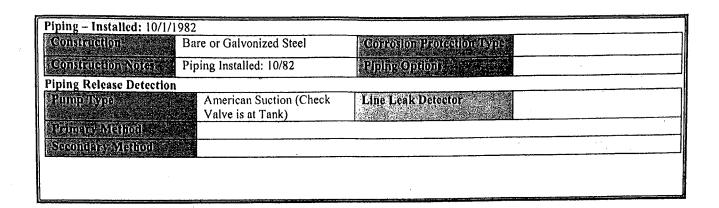

Narrative Comments

Site is still abandoned and in disrepair. For some unexplainable reason site would not GPS. No one on site to sign. Follow up needed three of the tanks A2, A2R1, and A3 were installed 2-1-82 and need to be removed.

Potential Violations

Regulation: CT state regulation (d)-I(e)(I)(E)

Violation Reason: Cathodic protection systems require annual testing to ensure that a structure to soil test voltage reading of at least minus 0.85 volts is maintained.

Required Action: The UST system owner or operator must have the requisite CP test performed on the tank and/or piping.

Applies To: TANK A1R1 (Containing Heating Oil with Capacity of 15000 gallons) Applies To: TANK A2 (Containing Heating Oil with Capacity of 2000 gallons)

Applies To: TANK A2R1 (Containing Heating Oil with Capacity of 2000 gallons)

Applies To: TANK A3 (Containing Heating Oil with Capacity of 5000 gallons)

Regulation: CT state regulation 110(c)

Violation Reason: UST system components have not been permanently closed, through removal or proper in-place abandonment, prior to the last day of their thirty (30) year life expectancy.

Required Action: Remove or properly abandon in-place UST system components which have exceeded their thirty (30) year life expectancies, and perform the requiste environmental assessment, as specified in section 22a-449(d)-107.

Applies To: TANK A2 (Containing Heating Oil with Capacity of 2000 gallons)

Applies To: TANK A2R1 (Containing Heating Oil with Capacity of 2000 gallons)

Applies To: TANK A3 (Containing Heating Oil with Capacity of 5000 gallons)

A. Puple 860-681-2885

Inspector Signature

NOON SITE TO SIGN


Recipient Signature

VETERANS MEMORIAL MEDICAL CENTER, WEST

Recipient Printed Name

Facility Owner
Position/Title

	SECTION D		SEC	TION C		and programme of the second	angle and the second			SECT	TON B		SECTION	A
	20. HAVE YOU ATTACHED SKETCH OF TANKS AND LOCATION? 21. COMMENTS:			A2R1	AIRI	Example	Example	XXX	OPERATOR/CONTACT 9. PERSON 10	8. TYPE OF OWNER	7 FACILITY OWNER	LOCATION 4 OF FACILITY BUSINESS NAME AND 6. MAILING ADDRESS	FIRS	UNDERGROUND STORAGE FACILITY NOTIFICATION
	U ATTACHI ENTS:		, , , , , , , , , , , , , , , , , , ,	2/82	10/90	7/60	5/75	DATE OF INSTALLATION (Mo.Yr.)	UCONTACT	WNER	WNER	Y NAME AND DDRESS	FIRST NOTIFICATION CB SUBSEQUENT NOTIFICATION	OUND S
	ED SKET					\	30	LIFE EXPECTANCY =	(1)	X	Veteran	Veterans NAME West Veteran	≀lf checked enter no)	TORAG ATION
	CH OF TA		, (2000	15000	8000	5000	TOTAL CAPACITY (Gas.)		PRIVATE	ν <u> </u>	S T S	C	m
	ANKS AN	State of the state) × ;×	×) .	×	IN USE	Obler,		Campus Memorial	st Campus Memorial Campus Memorial	STELD.	'n
	8	Maring the sign of the filter states - the contrast on since	and the second	· • •	; ;			ABANDONED IN PLACE	Engi			⊢	1000	PG ot
် ငရ	\Box				. Y	•		EST QUANTITY EST QUANTITY EST STORED (# #ny) (Gass)	Engineering	STATE		Medical Cen	P	
۲	ğ	A Company of the Comp				× ,		REMOVED	Dept		Center	Center Center	MENTAL PRO	E OF CONNECTION
						8/78		DATE TANK LAST USED		<u>.</u>		n		THE STATE OF THE S
			>	4 X	×		×	OHUPETRO- LEUM PRODUCT ON THE CHEMICAL LIQUID	P₹	ME.	F 3	- 8 . 8	Refer	
d D			production services	×	×	×		CHEMICAL LIQUID	NO AND STREE	MUNICIPAL	NO MID STREET	NO AND STREET P.O. BOX NO AND STREET I King P	LEASE 1	=
SEND TO DEPUST Program: 78 Em Street Hardwid	22 GERIFICATION:		Generator #2 ruer	5 *5	Heating Oil #6	I,I,I, - Tricloroethane CAS #79016	Heating fuel #2	14. CONTENTS CHEMICAL NAME OF PRINCIPAL SUBSTANCE (not trade name) (Enter C.A.S. No., If known)	REIT P.O. Box 1009	4	lace, P.O.	1 King Place 1009	Bureau of Waste Management 79 ELM STREET Hambord CT 06106-5127 TEL (860) 424-3374 PLEASE TYPE OR PRINT. ALL THREE COPIES MUST BE LEGIBLE Refer to INSTRUCTIONS FOR FILING NOTIFICATION before completing in	STATE OF CONNECTIOUT Department of Environmental Protection THE STATE OF CONNECTION DEPARTMENT STORAGE FACILITIES BEOGRAM
Hart I Denkers				★	⋈ .	×	×	STEEL MATERIALS FIBERGLASS REINFORCED PLASTIC OTHER ISPECT (ION LIST A)		FEDERAL (G.S.A. NO.		Orange Street	ste Management arthord CT 06106-5127 0) 424-3374 THREE COPIES MUST BE LEGIBLE NOTIFICATION before completing form	On CBAK
NE 5107				4 ×	×	×	×	UNLINED CATHODIC PROTECTION COATED WRAPPED DE	city on town		CITY OF TOWN	CITY OR TOWN Meriden CITY OR TOWN		#C
			×	< ×	×			COATED PT OF OF OF	E M	Š	1 1 1	w len	•	
			*					CATHODIC AMPROPER OF THE PROPERTION AMPROPER OTHER				. [× ₽	EPH.
		The second of th	(X		Ħ	ш	I	(Specify from		Ļ			COOP GPIB COOP	EPHMA Revisias
		er of Monte	/-8 Vent	7-8	7-8	7	ω	CONSTRUCTION MATERIAL (See List A)	C s	,	Σ 04 0	y C v	DINA	
Section Section		and the Control of th	•		য়ে	€	I	PROTECTION 3 4 7 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		, ,	, A	STATE S LA	B 545 Bi	\Box
The second		194	1C	10	10	-	<u>-</u> -	REP INS	ñ 4	•	2 2 2	2# c 41	E 3	2

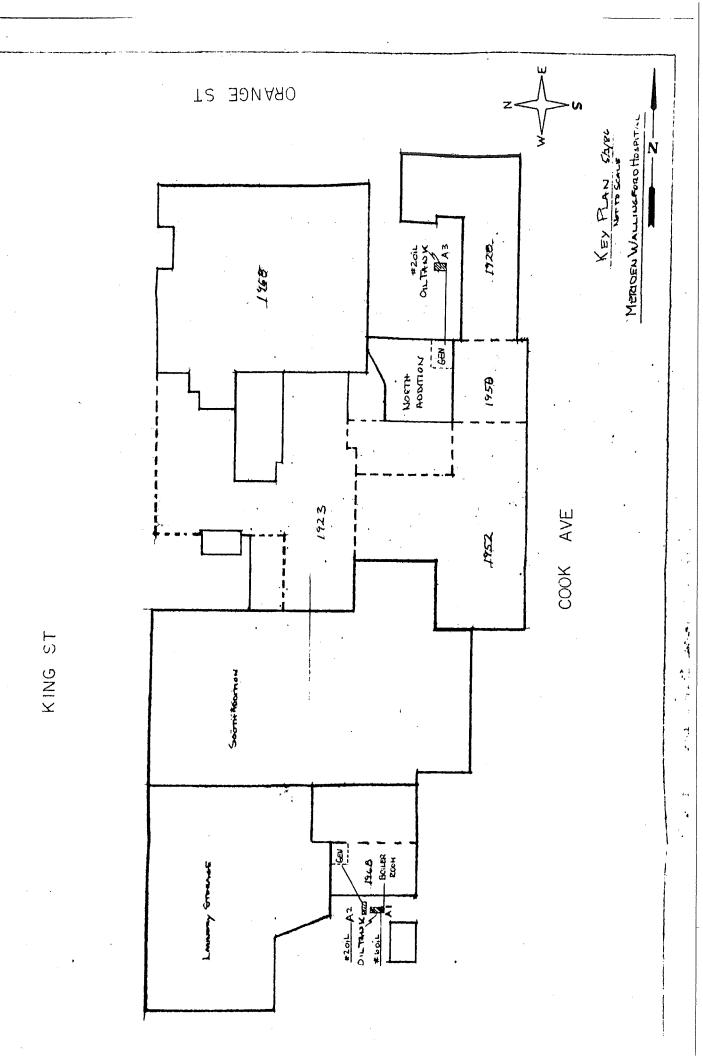

•	SECTION D		SECTIO	NC					SEC	TION B	1	SECTION .	A
	20. HAVE YOU ATTACHED SKETCH OF TANKS AND LOCATION? 21. COMMENTS:		A	門門 標準	Example AIRI 1	Example	TANK (ID)	OPERATOR/CONTACT 9. PERSON 11a	8. TYPE OF OWNER	7 FACILITY OWNER	LOCATION 4 OF FACILITY BUSINESS NAME AND 6. MAILING ADDRESS	FIRST NOTIFICATION OF THE STATE	UNDERGROUND STORAGE FACILITY NOTIFICATION
	ATTACH NTS:		10/82	2/82	7/60	5/75	DATE OF INSTALLATION (Mo:Yr)	CONTACT	NER	Z Z Z	AME AND DRESS	PIRST NOTIFICATION CR SUBSEQUENT NOTIFICATION	OTIFICA
	ED SKET		* * · · · · · · · · · · · · · · · · · ·	1		30	LIFE EXPECTANCY (# of years)	NAME Guenther	×	Veteran	Veterans Name West Veteran	ill checked enter no i	TORAG
	CH OF T		5000	2000	15000	5000	TOTAL CAPACITY (Gass.)		XX PRIVATE	West Campus Veterans Memorial			m
	ANKS AN		×) ×	×	,	IN USE	Ohler,	,	Campus s Memori	st Campus Memorial N Campus S Memorial	SIEID	Ņ
	D LOCA	American September 1	1		any pro-		ABANDONED IN PLACE	Engi		al Me		7086	PG of
2	THOM?				; ;	7	EST QUANTITY LEFT STORED (If any) (Sats.)	Engineering	STATE	Medical Center	Medical Medical	W. Company	•
COPY					×		NEWOVED 9 3	ng Dept. s	•••	Cent	Center		THE OFFICE MANAGER
-				1	8/78	i	DATE TANK LAST USED (Mo.YY)		per tooling	er .	e r		THE STATE OF
SEND			×	×	×	×	OIL/PETRO- LEUM PRODUCT	13 TY	3	i ð	P.O. NO AND 1 Ki	Pu	•
TO DE			,	×	×		CHEMICAL LIQUID	NO AND STREE I King I TYPE OF	MUNICIPAL		STRE BO STRE	LEASE TY	S
SEND TO DEP UST Program: 79 Elm Street	22 CERTIFICATION: 1-24 AMERICAN PROPERTY OF THE PROPERTY OF TH		Generator #2 Tuel	N	CAS #79016 Heating Oil #6	Heating fuel #2	CHEMICAL NAME OF PRINCIPAL SUBSTANCE (not trade name) (Enter C.A.S. No., # known)	Place, P.O. Box		Place, P.O. Box 1009	1 King Place 1009	PLEASE TYPE OR PRINT, ALL THREE COPIES MUST BE LEGIBLE Refer to INSTRUCTIONS FOR FILING NOTIFICATION before completing to	STATE OF CONNECTICUT Department of Environmental Protection AUDIERCROTUND STORAGE FACILITIES DEOCEAN
9 Em Street, Hantord, CT 06106-5127			×	* ;	×	×	FIBERGLASS REINFORCED PLASTIC OTHER (Specify from	15 CONSTRUCTION	FEDERAL (G.S.A. NO.		NEAREST INTERSECTING STREET Orange Street 1009	A Management of the Management of Management of 106106-5127 424-3374 REE COPIES MUST BE LEGIBLE NOTIFICATION before completing form	OC BAN
16-5127			*				LINEO P	-		0	0 0	A P	
			⋊	× , >	× ×	×	UNLINED F CATHODIC F PROTECTION	CITY OR TOWN Meriden 16 PROTECTION		Meriden	Meriden corror nown Meriden corror nown Meriden		#C
			×	× ×	×		COATED WRAPPED	и ПЕСТЮР		ä ²	5 2 5 2		
			×	×			CATHODIC F PRORECTION	4		,		X D GIRID C	EPHM-5 Re, 346
		Barrier Land	E 7-8 Vent	7-	E 7	Ξ	OTHER Specify from List B) CONSTRUCTION MATERIAL (See Lat A)		Ļ			COOPDINAT	
		e G	TT.	t		I	PROTECTION 1	STATE ZIPC CT 064 17 INTEG		CI O	STATE SPO	HES B FEE B	
3-18-5		W. 19 54 4	- :	10	.		E SE	6 48×		06. 24.0	241 71 8	B S	2 1

SPILLS



STATE OF CONNECTICUT

DEPARTMENT OF ENVIRONMENTAL PROTECTION Bureau of Waste Management, Oil and Chemical Spill Response Division



Emergency Incident Report

Case No.: 97-01017

Staff Receiving Call: 205 PYZNAR, ED

Assigned To: 936 WOFFORD, RON

Date Reported: 02/26/1997

Time Reported: 22:24

Date of Release: 02/26/1997

Time of Release: 21:00

Town of Release: MERIDEN

State of Release: CT

Location of Reported Release: 1 KING PLACE VETERAN MEMORIAL MEDICAL CENTER

Reported By: JIM HAMELILN

Phone: (203) 238-8686

Representing: VETERENS MEMORIAL MEDICAL CENTER

Responsible Party:

Phone:

Street Address:

Town:

State:

Zip Code:

CONTAINED

Does the Responsible Party Accept Financial Responsibility?

Release Type: PETROLEUM Release Substance: #6 FUEL OIL Media: GROUND SURFACE

Total Quantity:

100 Gallons

0 Cubic Yards

0 Cubic Feet

0 Drums

0 Pounds

Emergency Measures: CONTRACTED TO UNITED RECOVERY

Has the Release Been Terminated?: YES

Type of Waterbody Affected:

Name of Waterbody Affected: NONE

Total Quantity Recovered: 0

Total Quantity in Water: 0

Corrective Actions Taken: CONTRACTED

Discharge Class: PRIVATE

Cause of incident: OVERFILL

Agencies Notified:

Status:

(Printed on Recycled Paper) 79 Elm Street . Hartford, CT 06106 - 5127 An Equal Opportunity Employer



Connecticut Department of Environmental Protection 79 Elm Street Hartford, CT 06106 - 5127 Bureau of Waste Management Oli and Chemical Spill Response Division

EMERGENCY INCIDENT REPORT

Case No.	Staff receiving call: 205 . A	ssigned to: 921
Date Reported: 2-26-9	7 Time Reported: 22:	24 : December 2-7/-97
Time of Release: 21:00.	State of Release:	Town of Release: Meriden
cocation of Reported Releaser	King place Veleran	s memorial medical conter
Reported by: Jim Hai	melin Phones	203 - 238-8686
Representing: Veteren's	nemorial med center	
Responsible Party:	•	Phone:
Street :	State	:Town: Zip Code:
Does the Responsible Party Acc	ept Financial Responsibility?Yes	Zip Code:
Release Type: X Petroleum	Chemical Dielect to Harred	ous WasteSewage RelatedBiomedical
Gas Em	issionOther	ous WasteSewage RelatedBiomedical
Release Substance: # 6		
•		Inside Building _athers
Total Quantity: 100 Galler		Inside Building others
Emergency Managers Con	tracial its 1100+F	Drums
Has the Beleves Been To-	d7XYes _No and and and and	THE COURT OF THE PROPERTY OF T
The of Wateroody Affected:	USRiverStream/BrookGro	oundwater Senitary Sewer Catch Basin Pond Floor
		fected: NONE
Total Quantity Recovered:	-Total Quantity in W	Asteri
CORRECTIVE ACTIONS TAKEN:		
Cleaned	Evaportated Foamed	Fumped Out Sanded
Cantracted	Neuvalized	Referred Sail Removed
Dispersed	None Required	
Dissipated	Other	Removed Tank UST/Enforcement
RELEASE CLASS		CAUSE OF INCIDENT
Commercial	Above Ground Tank Failure	Man Pal
. Governmental	Blow Back	Hose Failure Pumping Bilge
Industrial	Cargo Tank Failure	Pump Failure
Inland Terminal	Container Failure	and the state of t
Marine Terminal	Oumping " -	1,
Natural . ,	Fire	
Other	Fuel Tank Faiilure	
Private	•	Other
Transportation	•	Power Failure Failure
Utility		Pumping Valve Failure
Vessel		Vandallam
gencies natified:EPA-ER	U.S. Coast Guard Local Fire M.	ershal Local PoliceDOHSAgriculture DEP/
- OE7OE7		Other:
tatus of incident: Open	Clased	



CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION 79 ELM STREET HARTFORD, CT 06106

BUREAU OF WASTE MANAGEMENT OIL AND CHEMICAL SPILL RESPONSE DIVISION

EMERGENCY INCIDENT FIELD REPORT

	· · · · · · · · · · · · · · · · · · ·
Assigned By: 921 Reported By: Representing: Veteraus Address of Reporter: 1 King Location of reported discharge: 1 K	INT PI
Date of Discharge Historic Discharge Substance: ## 6 o'il Estimated time of Discharge: Emergency Measures Cleaned, C	Chemical Gas Emission Air Other Ongoing TOTAL QUANTITY 300 gal Unknown at this time Unknown at this time Containment Contracted Boom Containment Sorbent Pads
Sanitary Sewer Catch Total Recovered Total Name of Waterbody if Applicable: Waterbody threatens navigable waterway Notification to U.S EPA Yes Notification to USCG Yes 1136 Spill Funds authorized: Yes (If Yes. By whom:)	Basin Pond Floor drain Other in water UNKN Total Recovered from Water HARBOR BROOK Yes No OPA-90 Yes No No Contact: D. VAldez Time/Date 2300 hu No Contact: Time/Date No Time/Date
Address: [King P7	Med Ctr. Accept Responsibility: Yes No Accepted By Whom: Jim Hamelin Time/Date accepted: 2170 - 2-26-97 OCSRD Representative: 936
Address: Veteraws Memoradoress: Veteraws Memoradoress: 1 KING-PL MERIDAN	rial Medical Center

. *	Transportation Incident: Make/Model	Yes	No Type:	Tractor Trailer			
	Tractor Number:		Tmiler Degi	Registration #stration/Number:			
	Operator of Vehicle:	The second secon		Stration/Number Drivers License #			
	Owner of Vehicle:			Phone Number:			
	Contractor retained:	Yes No	Not required	If Yes-Name:			
	Equipment:	Boom	Pads Vac Truc	k Manpower(N	lumber of persons	nel)	
	Speedy Dry			pecial (specify)			
	Time/Date Requested:			me/Date Arrived:			
	Special Contacts:						
	var present sucral stor A sua vutfall ar	n the modraum all annuments and company to the comp	loading of	ee it t uh contra	to Har	ber Brook, + Absusbau) f
	United I le R.P. +	Zvolevtiv	l Serve	er Five	war	buil by	
£	le R.P. +	prop.	rine ://	let. Men	, Med C	The state of the s	
	The storm	drain	e were V	ac-out,	paverie	of war	
P	ewer wash	ed and	estream a	Iac MAIN	talwest		



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION



STATE OFFICE BUILDING

HARTFORD, CONNECTICUT 06115

WATER COMPLIANCE AND HAZARDOUS SUBSTANCES

Oil Spill Report

DATE Occamber 8, 1974 TIME	OCCURRENCE NO.
FROM TROOP: "I"- "H" BY: Opt. Bushe	TIME: 2235
PERSON MAKING REPORT Maurice Lemelin	PHONE:
REPRESENTING (COMPANY) Meriden - Walling ford Hospital	
ADDRESS (COMPANY) Meriden	
<u>'</u>	
LOCATION OF SPILL (CITY & STATE) Meriden	
TO (BODY OF WATER) Horbor Brook	
QUANTITY AND TYPE 400 gallons - number six sil	
AMOUNT THAT REACHED THE WATER 25 gallons	
SOURCE Inground whomage lank	
CAUSE Over flow during from for peroid	
DISCHARGE STOPPED CONTAINMENT MEASURES	
OTHER AGENCIES CONTACTED City of Meriden - PWD	
DATE AND TIME OF SPILL December 6, 1974 TIM	E 22/5
LEGAL RESPONSIBILITY ACCEPTED BY POLLUTER Oleriden - Wallings	
CLEANUP ACTIONS BEING TAKEN Filter device erected in Harbor	Brook. Removal operations
conducted at M. H. 'A' and two careh basins as indica	
syde	
CLEANUP CONTRACTOR City of Meriden - PWB REQUESTED 22	230 ARRIVED 2400
CONTAINMENT LOCATION No Ved above	
REMOVAL LOCATION Noved above	
De AM	6
DEVERSE SIDE FOR SIGNATURE	E

SEE REVERSE SIDE FOR ADDITIONAL INFORMATION

This paper was produced from recycled paper - both broke and reused.

Bijler Hease C.B. st. King NAH Q Bronsen FHETV Davice

Not to seate

WATER



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION



Bureau of Water Management Permitting, Enforcement and Remediation Division

February 6, 1997

Guenther Ohler Veterans Memorial Medical Center-One King Place, P.O. Box 1009 Meriden, CT 06450

Dear Mr. Ohler:

Enclosed is a certificate of registration for the minor non-contact cooling water general permit. Before the implementation of our new computer system, DEP did not send out certificates of registration. We are sending out this mailing to all applicants who have registered for the general permit since 1992.

This certificate will serve two purposes. First, this is a way for us to acknowledge to you that your registration has been processed. Second, it is a way for our inspection staff to know that you have the appropriate permit for your discharges.

The expiration date noted is the expiration date for all dischargers who have registered for this permit. A mass mailing will be done nine months prior to the expiration of this permit to notify you of this date together with instructions on how to file for a permit renewal.

When corresponding with our office regarding your registration please use the "Site No." and the "Permit No." on the certificate. These numbers are unique to your discharge and its location.

If you have any questions regarding general permits for wastewater discharges please call 424-3018 and ask for the Engineer of the Day.

-> Art Marger

ENVIRONMENTAL RISK LIMITED
120 Mountain Avenue Bloomfield, CT 06002

Tel: (860) 242-9933 • Fax: (860) 243-9055 • www.erl.com

June 15, 2000

RECEIVED

JUN 1 6 2000

WATER MANAGEMENT BURRAN

Mr. Michael Harder Director Permitting, Enforcement and Remediation Division Water Management Bureau Connecticut Department of Environmental Protection 79 Elm Street Hartford, CT 06106

Re:

Notice of Non-Applicability for Non-Contact Cooling Water General Permit - Veterans

Memorial Medical Center West Campus, Meriden

ERL Project No. 07257-10

"GCW010058

Dear Mr. Harder:

Mr. Guenther Ohler of MidState Medical Center in Meriden, Connecticut received a letter dated May 22, 2000 from the CTDEP indicating that the sampling results for discharges to surface waters were not submitted as required. On behalf of MidState Medical Center, Environmental Risk Limited is submitting this letter to inform you that Veterans Memorial Medical Center West Campus is no longer operational. The facility was shut down and sold in 1999, after the hospital relocated and became MidState Medical Center. Please update your records to indicate that this facility has been closed and permitting requirements (for either air or water) no longer apply.

The new facility (MidState Medical Center) is covered under the General Permit for the Discharge of Minor Non-Contact Cooling and Heat Pump Water, however; all discharges (<5,000 gpd) are directed to the sanitary sewer and no reporting requirements apply.

If you have any questions or require additional information, please feel free to call Suzanne Ferrarotti or me at (860) 242-9933.

Very truly yours,

ENVIRONMENTAL RISK LIMITED

Amy L. Voisine

Associate

ALV/ceb

s:/ongoing/midstate/letters/7257nccwDEP ltr

cc: Guenther Ohler, MidState Medical Center

ration

ANS MEMORIAL

MON NOME ON THE

neral Per

Sidhey/did∺olbrook Commissioner

Address

One King Place

Meriden, CT 06450 Permit No.

GCW010058

Site No.

080-226

Issue Date: 1/16/1997

Exp. Date: 6/11/2002



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION APPLICANT 79 ELM STREET HARTFORD, CT 06106-5127

DOCUMENT ID:

3767

DATE CHEATED: 01-17-1997

OFFICE AMOUNT:

(s)

500.00

FIRE MICHITARD:

€O

500.00

APP. 7178:

NEW

APP. NO: 199700165

GENERAL PERMITS

CO./IND.

Ħ

CO./IND. HAM

CHECK/RECEIPS NO.

77.

Į,

TIPE.

SSEROOK

500.00

罢

1 KINGS PLACE

GUENTHER CHIER

COMTACT

(203) 238-8484

PO BOX 1009

MERIDEN, CT 06450-1009

100247

VETERANS MEMORIAL MEDICAL CTR 258288

PROGRAMMENT BY:

TO PROPERTY.

CTL001R LTRUJILL

STATE OF COMMECTICUE - PERMIT APPLICATION MANAGEM

POCCHERT CONTROL REPORT

THE STATE

73.08: HOM DATE:

9 17-JAN-97

THE OF PERCENTERS

Movides of ounts. Sept 25 Lewis Are



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION

Central Permit Processing Unit 79 Elm Street Hartford, CT 06106-5127

AL PROTECT	ION	
APP # /9	79700165	
	3767	an de la companya de
CHECK #	258288 -	\$500,00
700		

Permit Application Transmittal Form

Please complete this transmittal form in accordance with the instructions in order to ensure the proper handling of your application(s) and the associated fee(s). Print legibly or type.

CONTRACTOR CASSIONAL STATE		**********
P 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3	SAME TING OUT	
	DEP USE ONLY	
100000000000000000000000000000000000000		
	int No	
P. C. S. C.	2223	
Rac d C	PPR	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
	N. (1997)	
F32003000000000000000000000000000000000		
	rogrem	
SXXX KAGGGGR	(1)	
ECONOMIC TO THE PARTY OF THE PA		
1/2000000000000000000000000000000000000		
E-35500000000000000000000000000000000000	200000000000000000000000000000000000000	

Part I: Applicant Information Applicant: Veterans Memorial Medical Center - West Company Name or, if applicant is an individual, write name in the following format: Suffix (Jr, PE, PhD) Middle Initial Title (Mr, Ms, Dr) First Name Mailing Address: One King Place, P. O. Box 1009 _____State: _CT _____ Zip Code: _06451-1009 -City/Town: Meriden __ Fax: 203, 634-7499 Phone: (203) 238-8200 _____ ext.: ____ Contact Person: Guenther Ohler Phone: (203) 238-8484 ☐ Check if any co-applicants. If so, attach additional sheet(s) with the required information as supplied above. □ municipal ☐ state ☐ federal Applicant is a(n) (check one): individual XX company If a Company, list company type (e.g., corporation, limited partnership, etc.) _____corporation_ One King Place, P. O. Box 1009 _ Zip Code: 06451-1009 Applicant Billing Address: ___ __ State: __CT Meriden . Phone: 1203 238-8484 Billing Contact Name: Guenther Ohler

Part II: Project Information

Brief Project Description:	Non-Contact Cool	ing Water I	Blowdown Perm	itting	
Location (City/Town): Other Project Permits (not i	ncluded with this for	m):			
Permit Description	Issuing Authority	Submittal Date	Issuance Date	Denial Date	Permit #
		`			
		<u> </u>			
				l	




STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION

Central Permit Processing Unit

79 Elm Street

Hartford, CT 06106-5127

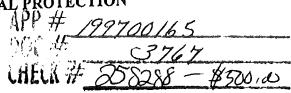

Permit Application Transmittal Form

Please complete this transmittal form in accordance with the instructions in order to ensure the proper handling of your application(s) and the associated fee(s). Print legibly or type.

DEP USE ONLY

Document Nos______

Rec'tl CPPU

Red'd Program

Part I: Applicant Information

Veterans Memorial Medical Center - West Applicant: Company Name or, if applicant is an individual, write name in the following format: Company Name or, if applicant is an individual, write name in the following format: Company Name or, if applicant is an individual, write name in the following format: Company Name or, if applicant is an individual, write name in the following format: Company Name or, if applicant is an individual, write name in the following format: Company Name or, if applicant is an individual, write name in the following format:
Mailing Address:One King Place, P. O. Box 1009 City/Town:MeridenState: _CT Zip Code:06451-1009 Phone:Q03) 238-8200 ext.: Fax: Fax:
Applicant is a(n) (check one): Individual XX company If ederal If a Company, list company type (e.g., corporation, limited partnership, etc.) Corporation If a Company, list company type (e.g., corporation, limited partnership, etc.) Corporation Applicant Billing Address: One King Place, P. 0. Box 1009 City/Town: Meriden State: CT Zip Code: O6451-1009 City/Town: Billing Contact Name: Guenther Ohler Phone: Phone: 1203 238-8484 ext.: Extra company If ederal If ederal If state If municipal If a Company, list company type (e.g., corporation, limited partnership, etc.) Corporation Phone: One King Place, P. 0. Box 1009 City/Town: Billing Contact Name: One City/Town: One City/Town:
Billing Contact Name:

Part II: Project Information

	r Cool	ing Water B	lowdown Perm	itting	
Brief Project Description:	Non-Contact Coor.	IIIE HOUS			
Location (City/Town):					
Other Project Permits (not in	cluded with this for	m):	***************************************		
	issuing	Submittel	Issuance Date	Denial Date	Permit #
Permit Description	Authority	Date			

STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION **BUREAU OF WATER MANAGEMENT**

REGISTRATION UNDER A GENERAL PERMIT SECTION 22a-430b CGS

for

MINOR NON-CONTACT COOLING WATER

60 W01005

Must submit original and (2) copies NOTICE OF COVERAGE Type or print neatly One King Place , Meriden (1475) 1. Location Address of Discharge Site Veterans Memorial Medical Center_ 2. Operator Name One King Place P.O. Box 1009, Meriden, CT Address Telephone Number (203) 238-8200 Veteran's Memorial Medical Center 3. Owner Name One King Place, P. O. Box 1009, Meriden, CT Address Telephone Number (203) 238-8200 3,000 gallons per day. 4. Maximum Daily Flow 5. Was this discharge previously covered under an individual permit? No. Permit #:(CT)(SP) 6. Complete a), b) or c) below: a) For discharge to sanitary sewers: . Name of POTW receiving discharge described above * Mail a copy of this registration to the receiving POTW b) For discharge to surface waters: Harbor Brook - Cook Avenue Name of receiving water____ Water Quality Classification (Existing/Goal) (Obtained from DEP Publication of Connecticut Water Quality Standards and Classifications) (cfs)(gpd) Seven Day Ten Year Low Flow 1.68 cfs Name of reference source for low flow value CT Water Resource Bulletin No. 36 and USCS Repor (Within closest 15 sec.) Latitude: 41°32' Longitude: 72°48'30" 89-4167 c) For discharge to groundwater: Water quality classification of groundwater receiving discharge (Existing/Goal)_ 7. For discharges to surface waters or groundwaters... (Enclose an 8 1/2" by 11" copy of the applicable section of the United States Geological Survey quadrangle map, with a scale of 1:24,000, showing exact location of discharge and including name of USGS map.) APPLICANT CERTIFICATION "I certify under penalty of law that I have read and understand all conditions of the general permit for Minor Non-Contact Cooling Water discharges issued on June 11, 1992, that all conditions for eligibility for coverage under this general permit are met, and all terms and conditions of this general permit are being met for all discharges which have been initiated and are the subject of this Registration. This document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel property gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information contained in this registration is, to the best of my knowledge and belief, true, accurate and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowingly making false statements." Prim or Type Name GUENTHER OHLER TILLE DIRECTOR OF ENGINEERING Dale 1/10/97

Complete a) or b) below, not both	
a) For any discharge which has not been initiated, created, originated or maintained as of the	date the registration is submitte
"I certify that in my professional judgement proper operation and maintenance of any systems installed to treat the registration will insure that all effluent limitations and other conditions in the general permit for the discharge of h on June 11, 1992 are met, or if there is no treatment system for such discharge(s), that the discharge(s) will meet such general permit without treatment. This certification is based on my review of engineering reports and plans and activities and (2) any proposed treatment system for the wastewaters to be discharged. I am aware that there are in this certification, including the possibility of fine and imprisonment for knowingly making false statements."	linor Non-Contact Cooling Water issual effuent limitations and conditions specifications describing (1) the propos
Print or Type Name	
The orange of the second of th	
Signature	
P.E.NumberDate	-
Address	Affix P.E. Stamp Here
b) For any discharge other than those specified in paragraph a) above:	
	ations in Part VII of such general permi
and proper operation and maintenance of any systems installed to treat such conditions in such general permit are neach discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner Non-Contact Cooling Water issued on Juparameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements."	ret, or if there is no treatment system fo ut treatment. This certification is base d in accordance with 40 CFR Pent 130 year, at least one week apart, and wer me 11, 1992 and were analyzed for th g water less than 5000 gallons per day zed as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner Nen-Centact Cooling Water issued on Juparameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and enaly I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements."	ret, or if there is no treatment system fo ut treatment. This certification is base d in accordance with 40 CFR Pent 130 year, at least one week apart, and wer me 11, 1992 and were analyzed for th g water less than 5000 gallons per day zed as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Minor Non-Contact Cooling Water issued on Ju parameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and enaly I am aware that there are significant penalties for false statements in this certification, including the possibility of fine	ret, or if there is no treatment system fo ut treatment. This certification is base d in accordance with 40 CFR Part 130 year, at least one week apart, and wer ine 11, 1992 and were analyzad for th g water less than 5000 gallons per da zed as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three affluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner Non-Contact Cooling Water issued on Juparameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements." Print or Type Name 60000 T BROOKMAN	ret, or if there is no treatment system fi ut treatment. This certification is base d in accordance with 40 CFR Pert 13: year, at least one week apart, and wel ine 11, 1992 and were analyzed for th g water less than 5000 gallons per da zed as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three affluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner Nen-Centact Cooling Water issued on Juparameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one affluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements." Print or Type Name 60000 T BROOKMAN	net, or if there is no treatment system f ut treatment. This certification is base d in accordance with 40 CFR Part 13 vear, at least one week apart, and we ine 11, 1992 and were analyzed for to g water less than 5000 gallons per to get as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner Non-Contact Cooling Water issued on Ju parameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact coolin this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements." Print of Type Name 60000 T BROOKWAM	ret, or if there is no treatment system fi ut treatment. This certification is base d in accordance with 40 CFR Pert 13: year, at least one week apart, and wel ine 11, 1992 and were analyzed for th g water less than 5000 gallons per da zed as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyses which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner New-Centact Cooling Water issued on In parameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements." Print or Type Name 60000 T BROOKMAN Signature RISA Date 1/6/97 ENVIRONIMIENTAL RISK LIMITED	ret, or if there is no treatment system fo ut treatment. This certification is base d in accordance with 40 CFR Part 130 year, at least one week apart, and wer ine 11, 1992 and were analyzed for th g water less than 5000 gallons per da geater less than 5000 gallons per da geater less than 5000 gallons per da
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner Nem-Centect Ceeling Water issued on Its parameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements." Print of Type Name 600004 T BROOKMAN Signature P.E.Number 968 Date 1/6/97 ENUIRONIMUMINIAL RISK LIMITED Address 1200000 for any person and \$250.00 for any municipality must be submitted with this	net, or if there is no treatment system f ut treatment. This certification is base d in accordance with 40 CFR Pert 13: year, at least one week apart, and we ine 11, 1992 and were analyzed for ti g water less than 5000 gallons per da zed as specified in the previous sentenc
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyse which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Minar Non-Contact Cooling Water issued on In parameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact coolin this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements." Print or Type Name 60000 T BROOKMAN Signature 1968 Date 1/6/97 P.E.Number 968 Date 1/6/97 Address 12000 for any person and \$250.00 for any municipality must be submitted with this	net, or if there is no treatment system for the treatment. This certification is based in accordance with 40 CFR Part 13 year, at least one week apart, and welling 11, 1992 and were analyzed for the water less than 5000 gallons per day and as specified in the previous sentence and imprisonment for knowingly making
such discharge(s), that the discharge(s) will meet all effluent limitations and conditions of such general permit withat in part on my review of analyses of a minimum of three effluent samples collected, preserved, handled and analyses which samples were representative of the discharge during standard operating conditions, were taken in the previous of the type(s) specified in Part VIII.D. of the general permit for Miner New-Centact Coeling Water issued on In parameters specified in Part VIII.A. of such general permit. In the case of discharges of minor non-contact cooling this certification may be based on review of analyses from one effluent sample collected, preserved, handled and analy I am aware that there are significant penalties for false statements in this certification, including the possibility of fine false statements. Print or Type Name GORDOM T. BROOKMAM Signature ROBERT TO BROOKMAM ENURONMENTIAL RISK LIMITED	net, or if there is no treatment system for the treatment. This certification is based in accordance with 40 CFR Part 13 year, at least one week apart, and welling 11, 1992 and were analyzed for the water less than 5000 gallons per day and as specified in the previous sentence and imprisonment for knowingly making

Bureau of Water Management 165 Capitol Avenue. Hartford, Connecticut 06106 Atm: General Permit Coordinator

AIR

REGISTRATION CERTIFICATE EPAC-10 REV. 7-73



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION



			STACK NO.	01001002001
FUEL BURNING	INCINERATOR	PROCESS MFG.	AIR POLLUTION	REGISTRATION NO. 0100062
	VALLINGFORD HOS			DATE ISSUED 12/05/73
181 COOK	NI (No. & Street, Town, Zip) ムVE REPRESENTATIVE	MERIDEN	CONN	
DE	PARTMENT OF ENVIRONM	MENTAL PROTECT	TION	•

REGISTRATION CERTIFICATE EPAC-10 REV. 7-73



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION



		STACK NO.	01001002001
EQUIPMENT CLASSIFICATION FUEL BURNING INCINERATOR	PROCESS MFG.	AIR POLLUTION	REGISTRATION NO. 0100063
MERIDEN WALLINGFORD HOS			12/05/73
LOCATION OF EQUIPMENT (No. & Street, Town, Zip) 181 COOK AVE	MERIDEN	CONN .	
COMMISSIONER OR HIS REPRESENTATIVE			

DEPARTMENT OF ENVIRONMENTAL PROTECTION

MEMORANDUM

DATE:	June 21, 2010				
TO:	Gary Rose, Direct Anne Gobin, Bure Amey Marrella, C	au Chief			
FROM:	Lidia J. Howard, A Susan E. Amarello Richard Pirolli, As	o, Supervising APCE			
SUBJECT:	Revocation of Permit Nos. 100-0020 and 100-0021 for a Y-S boiler and a Caterpill Diesel engine located at Bradley Research Center, 1 King Place in Meriden				
DISCUSSIO	N :				
Caterpillar Di	esel engine on Marc	ned Permit Nos. 100-0020 and the 16 and July 17, 1987 respectable of Research Center was	ctively. According to	an inspection	
facility. Mr. S	chnell concluded the	ell from the Enforcement Sec at an abandoned building wit er was once located (See Atta	h the windows boarde		
		n report it is recommended th Diesel engine be revoked.	at Permit Nos. 100-00	020 and 100-0021	
		/ /			
Lidia J. Howa	rd, APCE II	Date		•	
REVIEW:					
Susan E. Ama Supervising A					
Richard A. Pir					

Mr. George M. Discala Bradley Research Center, LLC 23 ½ First Street Norwalk, CT 06855

RE: Revocation of Registration No(s). 100-0062 and 100-0063 for two Keeler boilers located at Bradley Research Center (formerly Meriden Wallingford Hospital), One King Place (formerly 181 Cook Avenue) in Meriden, CT

Dear Mr. Discala:

The Commissioner of the Department of Environmental Protection (DEP) may revoke any license on the Commissioner's own initiative or at the request of the licensee in accordance with Section 4-182(c) of the Connecticut General Statutes, Section 22a-3a-5(d) of the Regulations of Connecticut State Agencies (RCSA), and any other applicable law.

The DEP Bureau of Air Management Registrations for two Keeler boilers located at Bradley Research Center (formerly Meriden Wallingford Hospital), One King Place (formerly 181 Cook Avenue) in Meriden, CT are being revoked because the building has been abandoned. The enclosed memorandum offers further explanation of DEP's action. Registration No(s). 100-0062 and 100-0063 are hereby revoked unless within thirty days of issuance of this notice a request for hearing is filed. Such request shall conform with the provisions of RCSA Subsection 22a-3a-6(i).

This letter in no way grants immunity from legal action resulting from the failure of this premises to remain in compliance with existing air pollution regulations, nor does it provide an exemption from compliance with future Federal, State or local laws.

If you have any questions concerning this notice, please contact Ms. Allison Leonard of my staff at (860) 424-4152.

Date	Gina McCarthy
	Commissioner

GM: aml Attachment

cc: William Simpson, Air Planning and Standards

Robert Girard, Air Enforcement

Certified Mail No. 7006 2760 0001 5812 5480

Mr. Kevin Hyde Bradley Research Center 1 King Place Meriden, CT 06451

RE: Revocation of Permit Nos. 100-0020 and 100-0021 for a Y-S boiler and a Caterpillar Diesel engine located at Bradley Research Center, 1 King Place in Meriden

Dear Mr. Hyde:

Pursuant to Section 22a-174-2a(h) of the Regulations of Connecticut State Agencies (RCSA) the Commissioner of the Department of Environmental Protection (DEP) may revoke any permit on the Commissioner's own initiative or at the request of the Permittee in accordance with Sections 4-182(c) and 22a-174c of the Connecticut General Statutes, RCSA Section 22a-3a-5(d), and any other applicable law.

Pursuant to RCSA Section 22a-3a-5(d)(2)(F) the Commissioner may revoke a license due to a change in pertinent law or technology. Bradley Research Center was required to obtain construction permits for a Y-S boiler and a Caterpillar Diesel engine under RCSA Section 22a-174-3 which was in effect at the time the permit was issued. A field inspector visited the premises on January 29, 2010. It is the Department's current understanding that the building is currently abandoned. As such, there is no longer any reason for the outstanding NSR permits authorizing the use of this source.

DEP Bureau of Air Management Permit Nos. 100-0020 and 100-0021 for a Y-S boiler and a Caterpillar Diesel engine located at 1 King Place in Meriden are hereby revoked, unless within 30 days of issuance of this notice a request for hearing is filed. Such request shall conform with the provisions of RCSA Subsection 22a-3a-6(i).

This letter in no way grants immunity from legal action resulting from the failure of this source to remain in compliance with existing air pollution regulations, nor does it provide an exemption from compliance with future Federal, State or local laws.

If you have any questions concerning this notice, please contact Ms. Lidia J. Howard of my staff at (860) 424-3539.

Date	Amey Marrella	
	Commissioner	

AM: ljh

cc: Ernest Bouffard, Air Engineering Robert Girard, Air Enforcement Lori Jackson, Air Enforcement Certified Mail

MEMORANDUM

DATE: 2/25/2014

TO: Anne R. Gobin, Bureau Chief

Amey W. Marrella, Deputy Commissioner

Gina McCarthy, Commissioner

FROM: Allison M. Leonard, APCE

Susan E. Amarello, SAPCE

Richard A. Pirolli, Assistant Director

Gary S. Rose, Director

SUBJECT: Revocation of Registration No(s). 100-0062 and 100-0063 for two Keeler boilers

located at Bradley Research Center (formerly Meriden Wallingford Hospital), One King

Place (formerly 181 Cook Avenue) in Meriden, CT

DISCUSSION:

Registration No(s). 100-0062 and 100-0063 were issued on December 5, 1973 pursuant to the former Section 22a-174-2 of the Regulations of Connecticut State Agencies (RCSA) for two Keeler boilers located at Bradley Research Center (formerly Meriden Wallingford Hospital), One King Place (formerly 181 Cook Avenue) in Meriden, CT. These two Keeler boilers are assumed to have been removed or rendered inoperable because the building is currently abandoned. A field inspector visited the premises on July 13, 2007 and confirmed that the facility was no longer in operation and had been rendered inaccessible. In accordance with Section 4-182(c) of the Connecticut General Statutes, RCSA Section 22a-3a-5(d) and any other applicable law, the commissioner may revoke any license on the commissioner's own initiative. These Registrations are no longer valid and are being revoked to update the air emissions inventory. A copy of the inspector's report is included as a part of this record.

The Bradley Research Center is located at the intersection of King Place and Cook Avenue. Although the address has changed, the building remains in the same location and the front door may have changed locations.

The field inspector confirmed that the building has been rendered inaccessible. For this reason it is assumed that the two Keeler boilers have either been removed from the facility or are in inoperable condition.

This transaction is a registration revocation at the commissioner's initiative, pursuant to RCSA Section 22a-174-2a(j)(3), where the subject equipment has been removed from the site or has been rendered physically inoperable. In this case the two Keeler boilers have been either removed from the site or rendered physically inoperable.

TYPE OF INSPECTION	RI	LO	G NUMBER: 2010-0021	
SOURCE NAME	BRADLEY RESEARCH CENTER			
ADDRESS	1 King Place, Mer	1 King Place, Meriden		
CONTACT NAME				
TELEPHONE NUMBER				
DATE OF INSPECTION	1/29/10	START TIME: 10:21 A	M END TIME: 10:53 AM	
REPORT FILE NAME	20100129BradleyF	Research.ri		

INSPECTION REPORT:

At 10:21 AM on 1/29/10 I arrived at the new hospital in Meriden as I could not locate King Place. The sky was partly cloudy, wind from the West at 15 to 25 mph and the temperature was about 19 degrees F. I went to the reception desk at the hospital and was told that King Place was the roadway between the old hospital and the parking lot there.

I went to the site of the old hospital in Meriden where I observed an abandoned building with the windows boarded up. This complex of buildings probably included the Bradley Research Center.

RECOMMENDATION: Source has been abandoned. Remove Permits 100-0020 and 0021 from the emissions inventory.

Phil Schnell: 11/10

STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION BUREAU OF AIR MANAGEMENT REGISTRATION VERIFICATION PROJECT

Company Name Meriden Wallingford Hospital Company Location 181 Cook Avenue	·
	•
Mailing Address Phone 238-0771 # Not in Service Cont	act/Title
Has there been a change in ownership? Nam	ne of New Owner
Registered Equipment Description 2 Boilers, Ke	eler 900 HP
Registration Number 100-0062,0063 Town/Premises Numbers 100-020 Client/Sequence Numbers	Inspection Date 7/13/67 Inspection Start Time 2:30 Inspection End Time 3:45
Inspector Name AMANDA HAFF	Inspector Number
Was the equipment removed from the facility?	
If so, when?	
Is the equipment currently operating?	
If not, when was it last operated?	
Is the equipment inoperable?	
If so, how and since when?	
Is the equipment dismantled?	
If so, since when?	
Is the equipment maintained for possible future use?	
Type(s) of fuel(s) used	
Burner maximum firing rate (MMBtu/hr)	
Fuel usage for 2004 (include units)	
If the registered equipment was removed and repla	aced by another unit: N/A 🖂
Equipment Description	
Construction Date	
Burner Maximum Firing Rate (MMBtu/hr)	
Types of Fuel(s) Used	
Equipment is Operating Under 22	a-174-3b □ 22a-174-3c
□ Per	rmit No None
Comments: NINDONS UP DOUBLED IN Phone # is out of service Amanda Haff	p/looks abandoned,
(Print Name Here and Sign Above)	$\frac{7/13/67}{\text{Date}}$
Fuel Burning Equipment	6/28/05

-4 NEW 5-72	*) * Faviron	mantal Dyator	0. The state of Environmental Protection Air Compliance Section State Office Bldg Hartford Comp. 061	lianos Castio	ctuty Off		mathematical Can	- 2112	15 12 546 3400	3		1. APPLICATION NO.		2. STACK NO.
ū			LEGAL NAME	Æ				BUSINE	BUSINESS ADDRESS (No. & Street, City, Zip Code)	Vo. & Street, (City, Zip Code)	-		PHONE
FIRM	MeRIDEN	LACH-NO	17 3 8 5 D		HUSPITA	7	18	1 Cook	Ave					238-0771
DIVISION		,												
APPLICANT		いななな												
INSTALLATION	TYPE OF EQUIPM	ENT (e.g., Boiler)					AIR POLLUTION CONTROL EQUIPMENT USED (If "Yes," file form EP-7)	ONTROL EQUIPME	NT USED (If "Ye	s." file form E	P.77)			
EQUIPMENT BEING REGISTERED	دو	oile	RS /	Keeler	900 HP		YES [No	1	,			 i	
MAJOR ACTIVITY OF HRM	MFG.	OFFICE	RETAIL OR WHLSE, STORE		SCHOOL OR CHURCH	MOTEL/		SPITAL [WARE-	RESI	RESIDENCE OR APTS.	OTHER (Specify)		
	FUEL	GRADES	SULFUR	ASH	ANNUAL USAGE	USAGE MAX	MAXIMUM FIRING RATE	NG RATE	SEASC	SEASONAL USE		FUEL	FUEL SUPPLIER	
	1	- Bituminous	• %	. %		1		-		\top	971	530	1.10	LIGITHERS !!!!
	COAL	Anthracite	. %	. %					:	1				
TYPES OF	<u>≅</u>	Kerosene	. %	. %		١				1				
ELS USED			. %											
		5	. %	•	totac			10 × 04						
	7	6	1.90 %	. %	885,03	\\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \			BNP/BEE	- July	Y			
	NAT. GAS					٥٠	MOKE		8	1 1			,	
BURNER	ARE OIL HEATERS	USED?	OIL TEMPE	OIL TEMPERATURE BEFORE INJECTION	NECTION	BURNER	BURNER MANUFACTURER		_			BUS	BURNER MODEL No.	40.
UIPMENT	X YES	S 8		1350	140°	-19	Pe,	PABODY	KNS,				ABT	•
AL BURNER	HAND	UNDERFEED		TRAVELING GRATE	GRATE	SPREADER STOKER		STOKER WITH GAS		CYCLONE FURNACE	PULVERIZED COAL		OTHER (Specify)	scify)
TYPE OF BURNER	PRESSURE OR GUN		ROTARY CUP	N	X STEAM ATOMIZER	IZER	☐ AIR ATO	AIR ATOMIZER		TANGENTIALLY FIRED		OTHER (Specify)	iER cifγ)	
COMBUSTION	YES CONIROL	No S		 * 	TIME SWITCHED	SMOKE INDICATOR	OR MANUAL	UAL [OTHER (Specify)		N 138€	TYPE OF DRAFT FORCED		NATURAL
		MATERIAL	72	RATE OF EMISSIONS (Tons/Yr.)	SNS	METHOD DETERMINE	METHOD USED TO DETERMINE EMISSIONS			BREACHING GAS TEMPERA:	BREACHING GAS TEMPERATURE (°F)	Æ (°F)	No. OF ID	No. OF IDENTICAL UNITS
POLLUTANTS								15. EC	15. EQUIPMENT	ATE SOURCE	7	67		
						4		N N N N N N N N N N N N N N N N N N N		EXHAUST GAS FLOW RATE (ACFM):	CFM):	NORMAL V	, MAX	MAXIMUM S S O
										OPERATING HOURS:	_	HOURS PER DAY		HOURS PER YEAR
16. STACK	HORIZ.	VERT.	I.D. W 6 ir.	ir. OR	in, ×	in. STAC	STACK HEIGHT (Feet)	∏ Si Si ∏	IS STACK EQUIPPED WITH RAIN HAT?	WITH RAIN HA	(T?			
Carrie	X YES	N S	FIREYE	0.00/#	ŏ		METAL .	×	REFRACTORY		OTHER (Specify)	Specify)		
CATION	Name of nearest intersecting street:	est BRON	SON	AUE	:	Dista	Distance to stack from intersection:	136		Д.	DIRECTION TO STACK:	e one	E, SE, (S,)	SW, W, NW
. CERTIFICATION		have examined te and complete.	I certify that I have examined the above information and that to the best of my knowledge it is true and complete. (Signature subjects signer to provisions of the General Statutes regarding false and misleading statements).	fion and that to tts signer to pro	the best of my	knowl- General	The same of the sa	7			Lesson Carlon	De la		7/27/72
	٠ - ١٠	V X X X	11	7711	ジイン		,	*	,,	. (1)	7			

	CERTIFICATION	CATION		4. STACK	ORMATION	EQUIPMENT			WASTE						6360	IXILIARY	TYPES OF				COMBUSTION		NCINERATOR		AAJOR ACTIVITY OF FIRM	NSTALLATION	APPLICANT	NOISIVIE	IRM		0: Departme
	certify that I have examined the above information and that to the best of my knowledge it is true and complete. (Signature subjects signer to provisions of the General Statutes regarding false and misleading statements).	intersecting street: BRON SON		VERT.	FLOW RATE (ACFM):		6 .	4	3 28/	-	STE (Lb./Hr.)	ALOUR BURNEY	NAT. GAS	6-	5	4		Kerosene	01070	FIFE	YES NO	UP PASS BREACHING	BARO- METRIC SUDING DOOR	SINGLE SINGLE CHAMBER CHAMBER	MFG. OFFICE		SAMO		MERIDEN-WE		🖭 Department of Environmental Protection, Air Compliance Section, State Office Bldg., Hartford, Conn. 06115. Tel. 566-2690
	above information and thignature subjects signer inding statements).	SON AUE	Packer 1	I.D. // in. OR	008H	MAXIMUM			009 068C	5		FREQUENCY OF PATEN		. %	. %	. %	%	. % .	2	SULFUR ASH	1000°F	FLUE CONNECTOR	BUTTERFLY	X DESTRUCTOR	RETAIL OR WHLSE. STORE				ALLING GRD	LEGAL NAME	on, Air Compliance
1,51	nat to the best of my know to provisions of the Gener	70	lodel HT	in. X	3600	NORMAL		equipment)		POLLUTANTS	Tons/Hr.	PATED CABACITY .		%	%		% 31,2000a	%			SWITCHED	OTHER (Specify)	GUILLOTINE X	OTHER (Specify)	SCHOOL OR			•	HOS PITAL		Section, State Office
The same with the	Al SIGNED	to stack ersection:	METAL	in. STACK HEIGHT (Feet)	The second secon	DATE SOURCE STARTED UP		nt)	40	NTS				D-6 8			1. 17001		7.) (Lbs., G	MAXIMUM FIRING RATE	SMOKE INDICATOR	F. NUMBER OF BURNERS:	NONE (Specify)	E. ME HOU OF RE) &	1111	Bldg., Hartford, Co
11-11-11-1	A STATE OF THE STA	, ok /	REFRACTORY	IS STACK				Year page 10 of the Control of the C			MATERIAL				0 /		2.38 million		(BTU/hr.) M	_	MANUAL			CHUTE	WARE- HOUSE			ľ		BUSINESS ADDRESS (No. & Street, City or Town)	nn. 06115. Tel. 56
C	THE THE	FT. DIRECTION TO STACK:	OTHER (Specify)	IS STACK EQUIPPED WITH RAIN HAT? YES NO	1100	BREACHING GAS TEMPERATURE (°F)				555.165	RATE OF EMISSIONS (Tons/Yr.)			1		1	1		nth to Month	SEASONAL USE	OTHER TEM	PRIMARY CHAMBER SECONDARY CHAMBER	FORCED,		RESIDENCE OR APTS.				IN MERIDEN	lo. & Street. City or Town)	6-2690
į	Jak.	Circle one SE,	ecify)			NO. OF IDENTICAL UNITS				ETA 7							Pembek		Name	FUEL SUPPLIER	ò	R G. Air pollution control Equipment used. YES		OTHER (Specify)	OTHER (Specify)				CT	ZIP CODE	1. APPLICATION NO.
	ŀ	E, S, SW, W NW				AL UNITS				rest lating	METHOD USED TO DETERMINE EMISSIONS					, , , , , , , , , , , , , , , , , , , ,	MERIDAN		City or Town	IPPLIER	Regulated.	N-41	NATURAL					-+	7	+	2. STACK NO.

TYPES OF JELS USED 16. STACK JFORMATION 2. TYPE OF IL BURNER). BURNER accimulation initial initial palialing 750. 7. STACK 4. POLLUTANTS EMITTED MAJOR ACTIVITY OF FIRM P-4 NEW 5-72 3. COMBUSTION 1. TYPE OF DAL BURNER 10: Department of Environmental Protection, Air Compliance Section, State Office Bldg., Hartford, Conn. 06115. Tel. 566-2690 8. CERTIFICATION INSTALLATION EQUIPMENT BEING DIVISION APPLICANT REGISTERED PRESSURE OR GUN X Kg Ę K I certify that I have examined the above information and that to the best of my knowledge it is true and complete. (Signature subjects signer to provisions of the General Statutes regarding false and misleading statements). OVERFIRE AIR CONTROL ARE OIL HEATERS USED? NAT. GAS Name of nearest intersecting street: SMOKE INDICATOR IN STACK STACK EXIT DIRECTION HAND HAND MERIDEN-WALLING TORD L HORIZ. OTHER MFG. YES FUEL COAL 읃 EQUIPMENT (e.g., Boiler) W ⊠ ĕ BoileRS X VERT. MATERIAL L OFFICE N N Bituminous L N O Kerosene Anthracite のアオン] UNDERFEED STOKER GRADES BRONSON ٥ N Ś 4 ROTARY CUP I.D. 5 64 AMERICAN CHIMNEY CORD STACK EXIT DIMENSIONS MAKE AND MODEL NO. CONTENT RETAIL OR WHLSE, STORE SULFUR LEGAL NAME OIL TEMPERATURE BEFORE INJECTION TRAVELING GRATE Bige low ፠ % % % ፠ RATE OF EMISSIONS ˈᡣ 유 $\widetilde{\mathbf{w}}$ CONTENT Aue (Tons/Yr.) ASH HOSPITAL % GRATE GRAIN % % % % % CHURCH OR TIME SWITCHED ___ STEAM ATOMIZER (Tons, Gals. or Cu. Ft.) (Lbs., (Gals), Cu. Ft./hr.) (BTU/hr.) ANNUAL USAGE ja × 80,000 SPREADER STOKER DETERMINE EMISSIONS SMOKE טוקור טו טטואורטווטטו ์ ∌' METHOD USED TO BURNER MANUFACTURER MOTEL/ from intersection: Distance to stack STACK HEIGHT (Feet) STACK LINING METAL $I_{\mathcal{O}}$ AIR POLLUTION CONTROL EQUIPMENT USED (If "Yes," file form EP-7) amore MAXIMUM FIRING RATE ÆS <u>~</u> 0 L MANUAL HOSPITAL OR LAB. REINJECTION REINJECTION AIR ATOMIZER アみソ 1001 ⊠ ĕ 16,027,000 W (BUSINESS ADDRESS (No. & Street, City, Zip Code) 15. EQUIPMENT INFORMATION REFRACTORY IS STACK EQUIPPED WITH RAIN HAT? AUG LYES OTHER (Specify) WARE-HOUSE Month CYCLONE TANGENTIALLY SEASONAL USE FIRED Meriden FLOW RATE (ACFM): **EXHAUST GAS** DATE SOURCE STARTED UP BREACHING GAS TEMPERATURE (°F) to Month OPERATING HOURS: 1928-1931 ⊠ ĕ RESIDENCE OR APTS. .7 DIRECTION TO STACK: OTHER (Specify) PULVERIZED COAL Size8 a s TYPE OF DRAFT
FORCED Hess 1. APPLICATION NO. EMERBENCY ONLY Name HOURS PER DAY OTHER (Specify) Ì net nee z N, NE, E, SE (Circle one) OTHER (Specify) FUEL SUPPLIER 1947 06450 TYPE RR-BURNER MODEL No. INDUCED OTHER (Specify) No. OF IDENTICAL UNITS WeTHERSHELD HOURS PER YEAR MAXIMUM 2. STACK NO. City or Town 138-077 SW, W, 7/27/72 NATURAL PHONE

LOG NUMBER(S): to be assigned GPLPE No.: 100-0047

TOWN/PREMISE: 100-20 C/S: needs

DOCUMENT NAME: jemincmer01.piq

SOURCE: J.E.M. INC. (was Veteran's Memorial Medical Center)

ADDRESS: 1 KING PLACE, MERIDEN, CT

CONTACT NAME: KEVIN HYDE (telephone (203) 639-0222)

DATE(S) OF INSPECTION: 1/22/01

Note to WJW, this is in addition to the PIQ scheduled for Mid State Medical, so there is no Log No. at this time.

CONCLUSIONS: See further advice from J. Sinclair

FIELD ENGINEER & NUMBER: JACK DOOLITTLE, /#58

RECOMMENDATIONS: All okay. See further advice from J. Sinclair.

OBSERVATIONS: This building formerly housed the Veteran's Memorial Medical Center. As part of a modernization/renovation program the hospital embarked on the construction of a new facility in mid 1997. Simultaneously with their physical relocation to this new site in late 1998, the source changed their name to Mid State Medical Center. There are a few additional reasons for confusion in this situation. For further details on this, see the report accompanying the 12/13/2000 PIQ of Mid State Medical Center.

As soon as hospital completed its move, the old building was sold. It was purchased by J.E.M. Inc. which has moved in and made this their primary address. At the time of the purchase it was planned that the building would become a source of industrial rental properties. About the time of the sale, a firm known as Donoco Property Management (local to Waterbury) came in to handle the real estate and other matters. This firm ended up in bankruptcy. Thus killing a deal to sell the old hospital utilities to an outfit known as Precision Power, which I understand to be a subsidiary of United Illuminating.

The contribution, if any, of this further complication to our problems in this matter is unknown. However, we missed significant portions of the changes although there appear to have been serious efforts from both sources to keep us informed.

In any event, having realized the complications inherent in sorting this one out, I have requested the assistance of Jaimeson

Sinclair. In my view, Jaimeson is the ideal person for this task because he is not only completely familiar with the intricacies of our permit process but is also currently involved in Administrative Enforcement.

Therefore, having given the source a new set of PIQ blanks, Jaimison and I returned to the source on 1/23/01 to complete a PIQ inspection and familiarize Jaimeson with the problem.

The inspection was completed on the basis of a PIQ questionaire supplies by John Cimino (the VP of J.E.M.). As the PIQ forms suggest, there is no process activity here. Fuel uses are drastically down since all they are doing is keeping some office space habitable and preventing the rest of the place from bein damaged by the cold.

No updates were requested.

Our further activity can await Jaimeson's determination of our most appropriate course of action.

JACK D. 2/16/01



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION



NOTICE OF VIOLATION

George DiScala Bradley Research Center, LLC 23 ½ First Street East Norwalk, CT 06855 **Notice of Violation**

15839

The purpose of this Notice is to inform you that personnel of the Department of Environmental Protection (DEP) have made observations or otherwise obtained information indicating that a violation of law has occurred at the property located at 1 King Place in Meriden, CT. Upon review of DEP records, it appears that you have failed to submit the 2005 emission statement as required by Section 22a-174-4(c) of the Regulations of Connecticut State Agencies.

When you have corrected the violation(s) alleged in this notice, you should submit in writing the details of the corrective action(s). The submittal should be made within thirty (30) days on the enclosed Compliance Statement, and sent to the contact person identified below in paragraph D. Until the DEP has received such a statement, the DEP will presume you remain in violation. If the violation(s) cannot be corrected within 30 days, provide a schedule of compliance that includes a timetable, on the enclosed Compliance Statement within 30 days describing the actions you will take to correct the violation(s). Your actions in response to this notice, including submission of the attached Compliance Statement, may affect the DEP's decision whether or not to take formal enforcement action.

- A. Other violations may exist; legal obligations. This Notice does not necessarily specify all violations of Connecticut environmental law or violations of any other legal requirements that may exist at the aforementioned property. This Notice does not preclude the DEP or other state, local or federal agencies from commencing any enforcement action regarding any such violations. Your facility may be inspected again pursuant to law and without additional prior notice to determine compliance with state and any applicable federal law. It is your responsibility to comply with all legal requirements, whether or not the DEP notifies you of any violations or takes any enforcement action against you. Nothing in this Notice relieves you of other obligations under applicable federal, state, and local law.
- B. Enforcement action. Civil penalties of up to \$25,000 may be assessed for each day of each violation under section 22a-175 of the Connecticut General Statutes. Notwithstanding the issuance of this Notice, the DEP may seek such penalties and may issue an order, seek an injunction, or take other legal action under Chapters 439 and 446c of the Connecticut General Statutes.
- C. No assurance by Commissioner. No provision of this Notice and no action or inaction by the Commissioner shall be construed to constitute an assurance by the Commissioner that actions you may take to address the violation(s) alleged herein will result in compliance.

D. Staff contact. If you question any of the information contained in this Notice, you may contact Teraesa Milardo of the Bureau of Air Management at 424-3702, or by mail at 79 Elm Street, Fifth Floor, Hartford, CT 06106-5127.

Robert W. Girard, Assistant Director

Bureau of Air Management

 $\frac{8/zz/06}{Date}$



STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION



NOTICE OF VIOLATION

John J. Cimino J.E.M., Incorporated 1 King Place Meriden, CT 06450

Notice of Violation

15030

The purpose of this Notice is to inform you that personnel of the Department of Environmental Protection (DEP) have made observations or otherwise obtained information indicating that a violation of law has occurred at the property located at 1 King Place, Meriden, CT. Upon review of emission fee invoices, it appears that you have failed to pay the 2002 emission fee by July 1, 2003 as required by Connecticut General Statutes Section 22a-174 and Section 22a-174-26(d) of the Regulations of Connecticut State Agencies.

When you have corrected the violation(s) alleged in this notice, you should submit in writing the details of the corrective action(s). The submittal should be made within thirty (30) days on the enclosed Compliance Statement, and sent to the contact person identified below in paragraph D. Until the DEP has received such a statement, the DEP will presume you remain in violation. If the violation(s) cannot be corrected within 30 days, provide a schedule of compliance, that includes a timetable, on the enclosed Compliance Statement within 30 days describing the actions you will take to correct the violation(s). Your actions in response to this notice, including submission of the attached Compliance Statement, may affect the DEP's decision whether or not to take formal enforcement action.

- A. Other violations may exist; legal obligations. This Notice does not necessarily specify all violations of Connecticut environmental law or violations of any other legal requirements which may exist at the aforementioned property. This Notice does not preclude the DEP or other state, local or federal agencies from commencing any enforcement action regarding any such violations. Your facility may be inspected again pursuant to law and without additional prior notice to determine compliance with state and any applicable federal law. It is your responsibility to comply with all legal requirements, whether or not the DEP notifies you of any violations or takes any enforcement action against you. Nothing in this Notice relieves you of other obligations under applicable federal, state and local law.
- B. Enforcement action. Civil penalties of up to \$25,000 may be assessed for each day of each violation under section 22a-175 of the Connecticut General Statutes. Notwithstanding the issuance of this Notice, the DEP may seek such penalties and may issue an order, seek an injunction, or take other legal action under Chapters 439 and 446c of the Connecticut General Statutes.
- C. No assurance by Commissioner. No provision of this Notice and no action or inaction by the Commissioner shall be construed to constitute an assurance by the Commissioner that actions you may take to address the violation(s) alleged herein will result in compliance.

D. Staff contact. If you question any of the information contained in this Notice, you may contact Teraesa Milardo of the Bureau of Air Management at 424-3702, or by mail at 79 Elm Street, Fifth Floor, Hartford, CT 06106-5127.

Patrick F. Bowe, Acting Director Bureau of Air Management

Date

7002 2030 0006 5649 2800

	Spoke to current owner of property of 3/23/11.
	Mr. George M. Discala
	Le still plans of seiling site. Fre The Three boilers
	and engine are still ox site.
Administration of the state of	Two of the boilers are upden Registrations 0100000
	and ploops. One Boiler is under permit \$ 0700-0026
garras Latan Bina as di Pi yarragangili tazardinan dinda di Bibbi hashayat karasilatinan	lend the expine is covered under permit # 0100-0021
	Note of the eguipment is circuity operational.
	Kevin J. J'Neil Apo E-Jatern
	•
a pagagang angga panga angganan ng pangan ng Arang ang Arang na Arang Arang Arang na ang ang ang ang ang ang a	
	inge.

Bureau of Air Management Administrative Enforcement Inspection Request Form

Field Inspector No. Priority: To: Bob Girard From: Lori Jackson TYPE:	Date I	No.: Submitted: 11/9/09 Required: umber:
SUBJECT: Verify Compliance with NSR Permit		
SOURCE IDENTIFICATION: Bradley Research Centelephone: Contact: Premise Address: 1 King Place Town: Meriden	ter, LLC Client: Town: 100 Retail Gasolin	Seq: Prem: 20 ne No:
Applicable Regulations:		
Special Requirements and/or Comments:		
Bradley Research Center was given 2 NSR permits num for a BLR Y-S 576-SPH-350-N6 #3 and a CAT 3512 D 2/16/01 (attached) this facility changed names and the n (also attached). An inspection is needed to verify whether compliant with all applicable regulations. If they are no rendered inoperable, or removed from the facility.	iesel. According ew company the er or not the equ	at bought them went bankrupt lipment is still operational and
Inspection Results/Observations/Descriptions:		
1/29/10 10:21 Am 7 Clordy	1 ~19°F	W 15-25 mgh
	is old hospi	41
all bldgs at this site and bouted	i if	
Recommendations (Include applicable conditions of con	npliance): S	see attached report
Date: Date: Date: PAS Supervisor: 123/10 Inspector/Engineer:	Time I	Required:
Give Copy of Kegos.	N TO	Teckson

STATE OF CONNECTICUT DEP-AIR MANAGEMENT BUREAU-HARTFORD PREMISE EVALUATION REPORT

	Unannounced []	DROP In C	Sig. Violator 🗖	•		-
Insp. Date:	Ol insp. Ti	me: /	Log No: _ Client/Seq Town/Prem	100 /- 0	2.96 to 6 - 18	e signe 34-1
No Feg/Permitted Equip C	DEP Reg/Per Nos. On F	orms of New Source	MM inspect.	Emiss. Stmts 0		
Company Location	<u> </u>	Mail Address				1
J.E.M. I Fing Plan Meriden C	inc ir T	1 King Place Meriden, CT 06451	Co.	Rep: <u>Kev, h</u> ne:(203) 6_ um by:	Hyde 39-0222	4-
CONTROL EQUIPMEN	NT STATUS: All Compliant A	Some Compliant		l Equipment	y Viol? V or N	- 1
NV (SSUED: Reg. S Equipment Description	on:	Fed	Subpart:		y Viol? Y or N	
Emissions:	I i	rolled Potential	Units	Spec. Co	ond/Limits	İ
Frimary Pollutant	Actual	< 100	TOU	CPIPE	100-0047	
50x Nov	</td <td>< 50</td> <td>117</td> <td>11</td> <td>,, 11</td> <td></td>	< 50	117	11	,, 11	
MULTI-N REPOF	LASS: A B)	Fed. Reg. Subpart:	RACT NSR GEOX TRADE NS	KU LIVI, EQUIT	Chemicals:	•
VOC Cals. Done D VC	OC Cals not needed N VO	C on Reg/Permit □ Burn	s waste oil 🗆 Deg	reaser Y/N		
Supe visor Comments:						
Supe visor's Signature:		1/	Date: 3/8	101		
INSPECTION	INTERVAL MOS: 2)	TIME: HRS Taineon Or, on Separate Form	CMST Code	3_		
Enį ineer's Signatu	ire: Jack	Insp	pector # _ <u>5</u> 🗸		701	
INSPECTI	ON LEVEL: 1 or 2	(circle)			•	

FEII R vised: 9/1/00

LAST INSP:

AIRS ID:

20001 11 11 12 12 12 12 12 12 12 12 12 12 12 1	4 t
00.2 00.4 448 (TPY) 3 3 # # 6.1 4.C 7, Ma	0.0
DESCRIPTION GROUNDWATER REMEDIATION OTEN OTON OTON OTON OTON OOO OOO OOO OOO OO	9.4°.
B5.9 B5.9 B5.9 B5.9 BESCRIPTION GROUNDWATER DESCRIPTION BLOW MOLDER POTEN BLOW MOLDER BLOW	0.0 5.0
4.4 4.4 4.4 4.4 4.4 8.9 City POTEN POTEN POTEN MERIDEN MERI	
5.2 10.3 10.3 City City POTEN POTEN POTEN POTEN 0.0 TRO9 1 7809 1	0.2
0.0 0.1 0.1 0.1 EARCH PAE ACTUAL CO(TPY) 0.0 0.0 BUREAU CO E POTEN S=100 2(E POTEN NY RESEAR NY NY RESEAR NY NY RESEAR NY NY RESEAR NY NY	0.0
0.0 0.0 0.0 0.0 0.0 COMPANY GPLPE NAME 550 RESE ACTUAL VOC(TPY) COMPANY GPLPE NAME T I GRO ACTUAL VOC(TPY) COMPANY GPLPE NAME ERADLE BRADLE BR	000
00 77	0.0
STK REG # F 1.5 2.0	000
ν	
ਂ α ਜ਼ਰਜ਼ਰਤ	

AIR INSPECTIONS/ EVALUATIONS

Engineer's Signature:

STATE OF CONNECTICUT

?	
) /= /00:	My
/30/98	1

100-0047-0	SPLPS DEP-	AIR MANAGEMEN	NT BUREAUHA LUATION REPOR	, , ,
TITLE V GP No:		AM No:	Unannounced	
Insp. Date: Insp. Start: Travel Time:	3-26-98 925 20MINS	Insp. End:	IR. ZOMINIS. 45 HRS.	
No Reg/Permitted	Location		Address	Source Emiss Stmts MM Inspect.
	Mr. Gunth Veterans N I King Plac Meriden, C		of Engineering enter (W)	to. Rep: hone: 203-238-8260 eturn by: Movember 28,097
CONTROL EQUIP	MENT STATUS:		E	scort, JIM MARRIO
Al	ll Compliant	Some Compli		No Control Equipment
NV ISSUED: Reg. Equipment Description				NSPS or NE (Circle) Fed. Subpart:
EMISSIONS:	Contro	olled		
Primary Pollutant	Actual	Potential	Units	Spec. Cond./Limits
NOX	6.9	50.	TRY	
50x	18.9	100:	Try	
			·	
PROGRAMS: MACT MULTI-MEDIA I Report Fed. Reg. Subp	POLL. PREV. NSI	ps Nox trade	CLASS: A	
RECOMMENDATIONS		<u>. </u>		H (Title III) Env Equity
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \			
VOC Cals don	voc Cals not r	needed VOC on Re	g/Permit Burns wa	aste oil Degreaser Y/N
Supervisor Comments:	x To	more 9/2	ved 18 to 12	heuris Ave - to be ical Center.
Supervisor's Signature)			Whw Date: 9/9/98
IN	ISPECTION INTERVAL	. моs: <u>2 √</u> тіме: _	1/3 HRS	CMST Code 3
	g	enort on reverse Or	on canarata form	

VETERMS MEMORIAL MEDICIAL CTR.

THE SOURCE HAS TWO KEELER BOILERS
HAVING REGISTRATION NUMBERS R-62 AND RES, ALSO GNE
YORK-SHIPLEY BOILER PERMIT NO. P-20. THE KEELER
BOILERS ARE DUAL FIRED USING NO. 6 OIL OR NATURAL GAS.
THE YORK-SHIPLEY ONLY RUNS ON GAS, DURING MY INSPECTION
NO VISIBLE EMISSIONS WERE OBSERVED,

THERE ARE TWO DIESEZ FIRED STAMDBY

GENERATORS AT THIS FACILITY. THE CATERPILLAR IS PERMITTED

(P-21) AND UNE BELL DETIROIT IS TOO SMALL TO REQUIRE A

REGISTRATION.

THE HOSPITAL DOES NOT HAVE A SMALL FUTON THERMOPAC HOT WATER HEATER AND A SMALL CLEAVER BROOKS OIL HEATER AND MORE,

FUEL USERGE FUR 1997 WOULD BETTS FOLLOWS: NATURAL GAS 380, 150 CCF, NO. 6 OIL WAS 238, 825 GALLOWS, AMD DIES EL 185 GALLOWS. THE HOSPITAL HASA GPLPE WHITH US.

THERE ARE, ALSO, TWO STERI-VAC UNITS ATTHIS.
FACILITY, EACH LOAD USES ONE CAN OF ETHYLENE OXIDE (127g).
THE MANUAL USERGE OF ETHYLENE OXIDE FOR 1997 WAS 196 POWNDS,

VETERMS MEMORIAL MEDICAL CONTOR NOWHAS A FOUR GALLON GRAY MILLS DMD 236 RECIRCULATING DRUM MOINTED PARTS CLEANOR, THE DARTS DREWASHED WITH SUPER AGATING

* OF THIS YEAR, THEIR NEW NAME WILL BE MID STATE MUDICAL CENTER.

STATE OF CONNECTICUT

开	FTS
123	Nox
1/30/98	

100-0047-GPLP	DEP-A	IR MANAGEMEN	IT BUREAUHA UATION REPOR	- ,	98 (
TITLE V GP No:		M No:	Unannounced □		
Insp. Date: 3- Insp. Start: 72	2698 S MINS	Insp. End:	R.ZOMIN'S HES.	Log No.: 97-3 Client/Seq.: 1/52-	0
No Reg/Permitted Equip Company Location	on_		Address	Source Emiss Stmts MM Inspect.	9-
	,		0 \ 0	to. Rep: hone: 203-238- .eturn by: November 2	<u>8</u> 200
CONTROL EQUIPMENT	STATUS:		(£	scort, JIM H	ARRIO
All Comp	liant	Some Compli		No Control Equipment	
NV ISSUED: Reg. Subsect Equipment Description:				NSPS or NE (Circle) Fed. Subpart:	
EMISSIONS:	Contro	lled			
Primary Pollutant	Actual	Potential	Units	Spec. Cond./Limits	
NOV ~	2009	50.	TRY		
50x 19	8.9	100:	Try		
			,		
PROGRAMS: MACT TI	TLE V 💹 SY	N MINOR ₪ NO, RA	ACT VOC RACT	NSR GP T5 GPTLE	3
MULTI-MEDIA POLL, P	rev. NSF	PS NO _x TRADE	CLASS: A	B NESHAP NSR	
Fed. Reg. Subpart:	DC.	CI	FC C	H (Title III) Env Equity	<u> </u>
RECOMMENDATIONS:					
VOC Cals done	VOC Cals not n	needed VOC on Re	g/Permit Burns w	raste oil Degreaser Y/N	
Supervisor Comments:	x To	more 9/	verles	hewir Aue -	to be
Supervisor's Signature:				who Date: 9/8/9	78
INSPECT	ION INTERVAL	MOS: 2 $TIME:$	1/3 HRS	CMST Code 3	
Engineer's Signature:	RS	eport on reverse O	r, on separate form Inspector #	Date: $9/2$	198

NO_x INFORMATION

EPC- REV. 12/22/94

STATE OF CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION Bureau of Air Wanagement STATE OFFICE BUILDING 79 Elm Street, Hartford, Conix, 06:106-5:127

COMPANY NAME:	TOWN No:.		PREM No.	
Is the premise a major source of NOx as of May 20, limits)?	1994 (consid	dering permit	YES	□ №
If no, does any fuel burning equipment, waste comsource have potential emissions in excess of 137/2 during the ozone season as of May 20, 1994?	bustor or pro 74 pounds p	ocess er day	YES	Пио
Is the source maintaining records as required?			YES	□ №
If records are inadequate, are the source's estimated to exceed 25/50 tons per year or 137/274#/day of NOx	premise em during ozor	issions likely ne season. 	YES	□ №
Has the source exceeded the 137/274 pound daily NO ozone season as of May 20, 1994 (effective date of the	x limitation (during the	YES	□ ио
Are there any additional sources not specified in the been included?	plan which	should have	YES	□ NO
Does NOx Plan need modifications?			YES	☐ NO
Based on this inspection the source:		is a NOx	Synthetic I	Minor
			meet NOx	.
		Is too sn	nall for NOx ility	RACT
		, , ,	•	

• • •	PREMISE EVALUATION REPORT 1-5-94 INDIA MAIN D. 10 100 100 100 100 100 100 100 100 100
	1 1854 A 174 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	INSPECIANT 09:30
	NO EQUIPMENT REGISTERED ALL DEP REG. and PERMIT NOS. ON PIQ NEW SOURCE
	SITE ADDRESS COMPANY ESCORT. LOUIS Cha
	Gunther Ohler PHONE: 238-82 OUT
	I 1/04 Man 1/190 (PATE)
	1 King Place RETURNBY: 9-10-93
•	$1 \cdot 1 \cdot$
	in Meriden, 06450
	Buin Waste Oil/chem/distilli.bottoms. Type of waste N/A
	> Sample (s) of materials taken/type N/A
	CONTROL LOUIPMENT STATUS ALL COMPLIANT SOME COMPLIANT NO CONTROL EQUIPMENT
	(See "UBSERVATIONS" and NV issued). , Organic Disposal Max daily = O.O gals #& Solvent Disposal Method.
	8. NV. Number Reg. Subsection Equipment Description OTHER:
	A NV. National neg. 3003ccitori
	N/N
	, and the state of
	* RECOMMENDATIONS Reinspect in one (1) year
	A. VOC Cals. done VOC Cals. Not Needed of 2 VOC on Reg. Permit Updates done
	B. Inspection Interval: 1224 Mos. Time: 2.0 HIS CMST Code 3 AIMS DATAENTHY CODED
	10 Abunduli
	SUPERVISOR
	COMMENTS
	COMMENTS
	Supervisor Signature: William & William Date: 119144
	COMMENTS
	Supervisor Signature: William J. William Jolisty Date: 119144
	Supervisor Signature: William J. William Jolisty Date: 119144
	Supervisor Signature: William & William Date: 119194
	Supervisor Signature: William & William Date: 1914
	Supervisor Signature: William & William Date: 1914
	Supervisor Signature: William & William Date: 119194
	Supervisor Signature: Lilliam & Lilliam Date: 11/9144
	Supervisor Signature: Lilliam & Lilliam Date: 11/9144
	Supervisor Signature: William & William Date: 1914
	Supervisor Signature: William & Wilking Date: 1914
	Supervisor Signature: William & Wilking Date: 1914
	Supervisor Signature: William & Wilking Date: 1914
	Supervisor Signature: William & William Date: 1914
	Supervisor Signature: William & Wilking Date: 19194
	Supervisor Signature: William & Wilking Date: 1914
	Supervisor Signature: William & William Date: 1914
	Supervisor Signature: William & William Date: 1914

LOG NUMBER(S): 93-2212

DOCUMENT NAME: VET-MED4.PIQ

SOURCE: VETERAN MEMORIAL MEDICAL CENTER

ADDRESS: 883 PADDOCK AVENUE, MERIDEN

DATE(S) INSPECTED: 1-5-94

ENGINEER'S NUMBER: 141 & 184

INSPECTION REPORT

Veteran Memorial Medical Center is located at 883 Paddock Avenue in Meriden and used to be named the WWII Veteran Memorial Hospital. Mr. Louis Charpentier, the boiler foreman, was our plant contact.

There are two (2) Keeler boilers having registration numbers R-62 and R-63, also one (1) York-Shipley boiler permit number P-20. The above boilers are dual fired using either #6 oil or natural gas. At the time of this inspection no visible emissions was noticed.

There are two (2) diesel fired stand-by generators at this facility. The catapiller is permitted (P-20) and one (1) Bell Detroit is too small to require a registration.

This facility maintains a small Fulton Thermopac hot water heater and a small Cleaver-Brooks oil heater. Both burn only natural gas and are too small to require permits or registrations.

Fuel usage for the year 1992 would be as follows: natural gas 14,050 ccf, #6 oil 238,225 gallons and diesel fuel 926 gallons.

There are also two (2) Steri-Vac units at this facility. Each load uses one can of Ethylene Oxide (127g). The annual usage of Ethylene Oxide for the year 1992 was 196.1 pound.

At the present no cold degreasers are being used, but 20 gallons of 1,1,1 Trichloroethane were shipped off site as hazardous waste.

We requested to review their copies of the permits to operate both the York-Shipley and Catapiller. Mr. Gunther Ohler, Director of Engineering, could not locate them. We reminded him that he needs to get and keep these permits. Mr. Ohler said he would call the DEP and request copies.



ONE KING PLACE, POST OFFICE BOX 1009, MERIDEN, CONNECTICUT 06/150-1009

TELEPHONE: (203) 238-8200

Date 9-1-98

FACSIMILE TRANSMISSION SHEET

Company I PEDI. OF ENVIRONMENTAL Trotection
Recipient's Fax No. 860 - 424 - 40 64
Number of Sheets (Including Cover Sheet)
From Victor Contrare
Office Telephone No. 203 - 238 - 8655
Veterans Memorial Medical Center Facilities Services Fax. No. (203) 634-7499
If transmission is incomplete or illegible, please call the office phone number listed above.
I hope this is what your looking for
Thanks Vic
Vic

MATERIAL SAFETY DATA SHEET (MSDS). This MSDS should be attached or kept with the respective product with which it is associated.

CONTINUES BEIFFING INFORMATION

GRANDER BEIFFING INFORMATION

GRANDER BEIFFING INFORMATION

T CODE : 206

OPER BEIFFING HAME: COMBUSTIPLE

LODS CLASS HUMBER: COMBUSTIPLE

LINIER COMBUST: N

CHIPPING IGANTITY: N

CHIPPING IGANT CARTON 8: GRAINGER '8" CARTON 200 LB. BU

EQ CT.: 9001

EQ COMPICE. 1001

EX COMPICE. Y COMBUST. RQ: M
RXCEPFICH: Y COMBUSTIBLE PACKAGING
EXEMPTION: N
EXEMPTION: N
ERG TO ACCOMPANY SHIPHENT INTERNATIONAL INFORMATION SELON

INTERNATIONAL : INTA : AIR SHIPMENTS. DOT SHIP HAMS: PRINCIPM DISTILLATE, NOS

HAZ CLASE : UN ID # : PACKING ChOUP: LABEL : COMMINTS: ON 1268 / LIT PLANNABLE LIGUID

INTERNATIONAL . THEO - MATER SHIPMENTS PETROLEUM DISTILLATE, NOS

HRZ CLASS : 3 UN LD S : UN 1268 / PACKING GROUP: LIT LABEL : PLAMMABLE LIQUID COMOMNITÉ:

3M747

GRAVHILLS CORPORATION MATERIAL EXPETY DATA EMERT

COMPORMS TO OSHA FORM HO. 1318-0072 COMPLIES WITH OSHA HAZARD COMMUNICATION STANDARD, 38CPRIF10,2200

MPPA HAZARD RATING PLANCADILITY

IDENTITY: SUPER AGITERS CHEMICAL FAMILY: CLEANING CHMICAL FAMILY: CLEANING CHMICAUM (CONGUSTIBLE LIQUID)

SECTION I

HANDYACTURER'S HANG: GRAYNILLS CORPORATION ADDRESS: 3705 MORTH LINCOLN AVE. CHICAGO, ILLINOIS 60613

PAGROUNCY #: 1-900-424-9300 (CHEMTRIC) THLEPRONE #: 1-312-477-4100 DP PREPARED: JANUARY 11, 1996 VER'S SIGNATURE; R.C. PAYEL

L .UM II - MALARDOUS ENGREDIENTS/IDENTITY INFORMATION
MALARDOUS COMPONENTS (SPECIFIC CHA ACQIN
CHEMICAL IDENTITY/COMPON NAME(S)); FEL TLY TLV CASE CONCENTRATION RANGE &

100 PIM 100 PPM 64742.47-8 }

ALIPHATIC PETROLEON DISTILLATE DFN (DIPROPYLIMM GLYCOL NUTHTL ETHER)

SECTION FILE - PHYSICAL/CHEMICAL CHARACTERISTICS

SOLLING BRANCE (PARCEMULT): 748-38 SPECIFIC GRAVITY (MATER-1): .78

VAPOR PRESENCE (M) HO @ 35C): 10.0

(FOLT @ 1009): 0.4

VAPOR DENSITY (AIR-1): 4.8

VOC CONTENT: 780 G/L

VISCOSITY (@ 21C): 1.32 CPS

APPEARANCE & ODOR: CLEAR GREEN LIQUID, MILD MIMERAL SPIRITS COOR,

SECTION IV - FIRE AND EXPLOSION MAIARD DATA

FLAME DOTAT (RETEMBU USEDS): 110F (TAG CC ASTM DSC)
FLAMEOBLE LIMITS: LEL: 0.6 UEL: 7.0%
EXTENDISHING MEDIA: CO2, FOAM, DRY CHEMICALS, NATHE SPRAY (FOG).

MASTE DISPOSAL METHOD. ANCIAIN SY DISTILLATION OR HAVE DYSPOSAL PERFORMED BY A LECTROSIC MADER. MASTE DISPOSAL SERVI.

PRECAUTIONS to be taken in handling & Storing: Stoke in cool area away from Mean on Open Plance. All precautions apply to Empty Container.

OTHER PRECAUTION: MOT SIGNEGRADABLE. SUFFICIENT VENTILATION IN VOLUME AND PATTURE TO KEEP WORK AREA CONCENTRATION DISCOV APPLICABLE SAFETY LEVELS.

SECTION VIII - CONTROL MEASURES

BILLER ROOM

RESPIRATORY PROTECTION (SPECIPY TYPE): NOME.

VENTILATION. LOCAL EXHAUST: HONE HECKMICAL (GENERAL): GENERAL ROOM VENTILATION EPHCIAL: HONE

PROTECTIVE CLOVES: MITRILE

EVE FROTECTION: CHEMICAL EPLACE COQUES

OTHER PROTECTIVE CLOTHING OR EQUIPHENT: FOR CONSTRUCT USE. HITRILE GLOVES AND SOLVENT RESISTANT APRON ARE RECONSUMEDED. MEAR GOGGLES AS APPROPRIATE.

NORE/HYGIENIC PRACTICES: USE SKIN LOTION OR CREAM IF GLOVES ARE NOT HORN.

HECTION IX - TRAMSPORTATION INFORMATION

DOWLSTIG [DOT]
GROUD: COMBUPTIBLE LIGUID, M.O.S., COMBUCTIBLE LIQUID, MALSON, III
AIB: USE INTERNATIONAL REGULATIONS

INTERMATIONAL (ICAO/IATA)
PETROLEUM DIBITLLAIRE, M.O.S., J. UN1268, III, CLASS 69.
EXCEPTIONS: LIMITED QUARTITY UP TO SL (VOR FLASTIC, METAL AND ALIMINUM CONTAINERS) 3.5L FOR CLASS).

THE DATA PRESENTED IS THUE AND CORRECT TO THE BEST OF OUR INIOMITIDE AND DELIEF. PRITHER SELIER MOR PREPARER MAKES MAY HARDANTIES, EXPRESSED OR INFLIEN, CONCERNING THE INFORMATION PRESENTED, MERCHANTABILITY OR FITNESS OF

SPECIAL FIRE FIGHTING PROCEDURES: COOL SEALED DRIVEN WITH MATER TO LEAGEN CHANGE OF RUTTURE. WERR SELF-CONTRAINE RELATING CRAR. MINIMIZE BREATHING OF GASES, VAPORS OR DECOMPOSITION PRODUCTS.

UNUSUAL FIRE AND EXPLOSION MALARDS: COMBUSTISLE LIQUID, DRING COULD FRACTURE IF MEATEU. AUTOIGNITION TEMPERATURE APPROXIMATELY 650F (1227).

SECTION V - REACTIVITY DATA

STABILITY: UNGRABLE () STABLE [I]
CONDITIONS TO AVOID: KEEP ANY PROMINENT PRAKE AND DEED FLAME.
INCOMPATIBILITY (MATKILL TO AVOID), ACIDS, STRONG OXIDITEDS SUCK AE LIQUID
CHIGALDIS, CONCONTRATED DAYORS, SUDJIN, ACIDS, STRONG OXIDITEDS SUCK AE LIQUID
REALBROON DECOMPOSITION OF ST-PRODUCTS; CARRON BIGGINE, CARRON HONOXIDS,
FUNDS, ANOTE AND ALDRITIONS DOWN INCOMPLETES CONSUSTION, CARRON HONOXIDS,
MARABODES POLYGRAIZATION; MAY OCCUR () MILE NOT OCCUR (X)
CONDITIONS TO AVOID, MONE

ON VI . HEALTH HAZARD DATA

(X) NOITALAHNI IYATWA 4G (C). SKIN (X) INGRESTION (X)

REALTH HAZARDS (ACUTE & CHRONIC):

Page 3 (Lest Page)

FIGUREY & FIRST AID PROCEDURES:

ARE CONTACT: ONLY HIGH VAPOR CONCENTRATION MAY BE IRRITATING. IF LIQUID GHIS

LETT BIE; IRRIGATE BIE WITH MATER FOR 15 HINDITEC.

SKIN CONTACT: FROLDWIGED & REPEATED EXPOSURE MAY DRY THE SKIE. FADH EXPOSED AREA WITH MATER & APPLY SKIM LOTION OR LANGLIN CREAM.

IMPALATION: EXCESSIVE IMPALATION HAY RESULT IN TRRITATION TO HOCE, THROAT L RESPIRATORY TRACT. VERY HIGH VAPOR CONCENTRATION CAN CAUSE HEADACHE &

LUI-QTION: DO NOT INDUCE VONITING. CALL DOCTOR. IF MORE THAN 2.0 ML/KO 18
TED AND VONITING HAS NOT OCCURRED, THEN SHEERS SHOULD BE INDUCED HITH
TISION. FREE HEAD BELOW HIP TO PREVENT ASPIRATION.

SECTION VII - PRECAUTIONS FOR SAPE HANDLING AND USE
STEPS TO BE TAKEN IN CASE MATERIAL IS PRICABED OR SPILLED, USE ABSORBERT
MATERIAL OR SAMD. SHOVEL INTO MASTE COMTAINER. DISPOSE OF PROPERLY.

94%



DATE Warch 30,

FACSIMILE TRANSMISSION SHEET

TO: LINGA YONAN
COMPANY: Dept of ENVIRONMENTAL Protectio
RECIPIENT'S FAX N: (860) 424-4064
HUMBER OF SHEETS (INCLUDING COVER SHEET): 3
FROHI Victore Conture
OFFICE TELEPHONE N: (203) 238-8655
VETERANS HEHORIAL HEDICAL CENTER Engineering FAX #: (20;
IF TRANSMISSION IS INCOMPLETE OR ILLEGIBLE, PLEASE CALL THE NUMBER LISTED ABOVE.
This is the correct updated into you
Requested. If you have my question
Feel free to call me
-4 /-

One King Place, P.O. Box 1009, Meriden, Connecticut 06450-100

		t			લ		00 526						
	To: PAGE OF	SOURCE 4	Main Plant	F 20.	W W		141,925 CCE						
	DARCES: DATA UPDATED TO:	SOURCE 3	Main Plant	Fulton Thermopac	1/1/84 4/1/95		19/A						
	FUEL BURNING SOURCES:	SOURCE 2	Main Plant	CB Oil Heater	01/01/67		N/A-						
01152-001 - 100 - 5020	morial Medical Ctr	SOURCE 1	Main Plant	Bell Detroit Generator	01/01/67	300 KW - 1-1-1	Diesel 996450 ETU Ct. Pefinery						
DEP CODE: 01152-001	(7.) COMPANY NAME: Vererans Memorial Medical Cr.		BUILDING	SOURCE DESCRIPTION DEP REGISTRATION/PERMIT HUMBER	DATE INSTALLED DATE SHUT DOWN (DISMANTLED)	HAX FUEL BURNING DESIGN (INCLUDE UNITS) DESIGN CAPACITY (HABTU/HR)	FUEL 1 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX SURNEX RATING (INCLUDE UNITS) ANNUAL USAGE (IMCLUDE UNITS) FUEL SUPPLIER	FUEL 2 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	FUEL 3 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) NAX BURRER RAITNG (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	FUEL TYPE NUMBER - SOLID FUEL PERCENT ASH	PRIMARY CONTROL SYSTEM SECONDARY CONTROL SYSTEM	OPACITY MANUFACTURER OPACITY HODEL	LAST STACK TEST DATE
32	10:	52											•



STATE OF CONNECTICUT



DEPARTMENT OF ENVIRONMENTAL PROTECTION TEL: (860) 424-3028 BUREAU OF AIR MANAGEMENT

PRE-INSPECTION QUESTIONNAIRE

INSPECTION COEDITOR	
	SEPTEMBER 16, 1997
	PAGE 1 OF
	FISCAL YEAR:
C	EPA PROGRAM CODE: SAMPLE TAKEN: UPDATE: TOWN: 100 PREMISE: 20
ION:	Center
King Place, Meriden,	
ing Place, Herrow,	TITLE: Manager
Harriott	FAX: (203)634-7499
8337 EXI:	SIC CODE: 8062
Hospital Gran Memorial Medica	
1 King Place, Meri	den, CT 06451
AL? (Y/N):	YEAR OF DATA: 1989 SESS OF BEING) CONSTRUCTED, 1, 1989? (Y/N):
AT THIS LOCATI	ION?: 1300
ERIFIED THAT THE	ATTACHED DATA IS CORRECT:
$(I \cap A)$	11/12/07
	EPA CLASS: FUEL S SEQUENCE: / ION: Ins Memorial Medical King Place, Meriden, ing Place, Meriden, enther Ohler Harriott B337 EXT: Hospital eran Memorial Medical 1 King Place, Meri AL? (Y/N): N BEEN (OR IN PROCETED SINCE FEB

SEPTEMBER 16, 1997 DEP CODE: 01152- 001-100 - 0020 PAGE ____OF ___ COMPANY NAME: Veterans Memorial Medical Ctr. (2.) ON-SITE PROCESS TYPES (CHECK ALL THAT APPLY): _INCINERATOR DEGREASER (NO. OF EACH): VAPOR- ____ COLD- ___ CONVEYORIZED- ____ ___SURFACE COATING ___LIQUID STORAGE TANK NONE __FLARES (3A.) GROUP I CHEMICALS USED ON-SITE (CHECK ALL THAT APPLY): 4-DIMETHYLAMINOAZOBENZENE DIMETHYL SULFATE 2-ACETYLAMINO FLUORENE DIOXANE, TECHNICAL GRADE ACRYLONITRILE ESTROGENS AFLATOXINS 4-AMINODIPHENYL HEPTACHLOR ARSENIC & COMPOUNDS __HEXACHLOROETHANE ARSENIC PENTOXIDE KEPONE __4,4'-METHYLENE-BIS-(2-CHLORANILINE) ARSINE ASBESTOS X MORPHOLINE M AURAMINE MUSTARD GAS AZATHIOPRINE BENZ(A)PYRENE MYLERAN 2-NAPTHYLAMINE BENZENE NICKEL CARBONYL, AS NICKEL BENZIDINE NICKEL, METAL NICKEL, SOLUBLE COMPOUNDS (AS NI) BERYLLIUM BERYLLIUM OXIDE BERYLLIUM SULFATE NICKEL SULFIDE CHLOROAMBUCIL 4-NITROBIPHENYL NITROGEN MUSTARD CHLORDANE N-NITROSODIMETHYLAMINE CHLORINATED CAMPHENE CHLORNAPHTHAZINE OXYMETHOLONE PERCHLOROETHYLENE CHLOROBENZILATE PHENACETIN CHLOROFORM POLYCYCLIC AROMATIC HYDROCARBONS BIS-CHLOROMETHYL ETHER CHLOROMETHYL METHYL ETHER 2-PROPIOLACTONE [1,1,2,2-TETRACHLOROETHANE CHROMIC ACID & CHROMATES CHROMITE ORE PROCESSES (CHROMATE) THORIUM DIOXIDE CHROMIUM, METAL O-TOLUIDINE COAL TAR PITCH VOLATILES TOXAPHENE COKE OVEN EMISSIONS TREOSULFAN 1,1,2-TRICHLOROETHANE -CYCLOPHOSPHAMIDE X TRICHLOROETHYLENE DIBROMOCHLOROPROPANE 2,4,6-TRICHLOROPHENOL 3,3'-DICHLOROBENZIDINE 1,2-DICHLOROETHANE VINYL CHLORIDE DIETHYLSTILBOESTRIOL DIETHYL SULFATE (3B.) OTHER CHEMICALS USED (CHECK ALL THAT APPLY): X ETHYLENE OXIDE NONE OF THE CHEMICALS LISTED ON THIS PAGE CADMIUM BUTADIENE LEAD MERCURY

PAGE

0F

TOXIC INFORMATION:

COMPANY NAME: Veterans Memorial Medical Ctr. (5.) BUILDING: Main Plant

										The state of the s	Direct Vent	۔ ا	[1] [2]	DEP STK VENT I.D.	DEP REG SOURCE DESCRIPTION
											25	1	[3]	STACK HGT(FT)	
												150	[3] [4]	EXHAUST GAS	PROP LINE DIST(FT)
		1			1							1 - 1 - 1	[5]	EXHAUST GAS CAS NUMBER	DEP PROC- MAT-CHEM NO.
												Ethylene Oxide	[6]	DEP COMMENT	CHEMICAL NAME
				-									[7]	8-HR HLV	BATCH TIME (HRS)
												0.0	[8]	METHOD OF DATA	PERCENT
		•											[9]	UNITS	ACTUAL STK CONCENTRAT
													[10]	(TOP-UG/M3)	MAX ALLOWED STACK CONC.
													[11]	(TOP-PPH)	MAX ALLOWED EMISS. RATE

DEP CODE: 01152 001 - 100 - 0020

SEPTEMBER 16, 1997

The state of the s		

3M-127G / Cartridge Lbs. G.7	Ethlylene Oxide	No (2) Steri-Vac 400 Direct Vent
DAILY USAGE PEAK ACTUAL REGULATION SUPPLIER /UNITS /UNITS SECTION [8] [9] [10] [11]	PRIMARY/SECONDARY HR/DAY HRS/WK TEMP DEP PROCESS – MATERIAL NUMBER CONTROL SYSTEM WKS/YR HRS/YR (°F) INPUT MATERIAL [3] [4] [5] [6] [7]	HEP REG SOURCE DESCRIPTION HEP STK VENT I.D. 1] [2]
PAGEOF	Veterans Memorial Medical Ctr. Main Plant	COMPANY NAME: Veterans M (4.) BUILDING: Main Plant

PAGE ____OF

CHEMICAL AND MATERIAL LISTING:

MATERIAL #6 0il Trichloroethylene Natural Gas Steam & Heat Ethylene Oxide Diesel Fuel Generator PURPOSE (6.) COMPANY NAME: Veterans Memorial Medical Ctr. Steam & Heat TANK I.D. SUPPLIER STREET [2] Buckley Oil Co. E & K Fuel Yankee Gas 3M-Med & Surg State Chemical [3] NW01 Meriden St Paul Wallingford New Haven Cleveland CT 06492 ST ZIP 加斯田 CI 06450 MN 55144 R 44100000 CCF Lbs. ANNUAL USAGE /UNITS 20.0 Cals 1900 238225 Gals INDIVID.
TANK
CAPACITY NO. OF
/UNITS TANKS
[5] [6] That creeply thought them. SUBMERGED
FILL PIPE
[7] TANK ABOVE OR
BELOW GROUND?
(A=ABOVE,B=BELOW)
[8]

		FUEL BURNING SOURCES:		PAGE	9
(7.) COMPANY NAME: Veterans Memorial Medical Ctr	emorial Medical Ctr.	``	DAIA OFDAIRD TO.		
	SOURCE 1	SOURCE 2	SOURCE 3	SOURCE 4	
BUILDING	Main Plant	Main Plant	Main Plant	Main Plant	3
SOURCE DESCRIPTION DEP REGISTRATION/PERMIT NUMBER	Bell Detroit Generator	CB Oil Heater	Fulton Thermopac N 0	York Shipley P 20	ا کار کار کار کار کار کار کار کار کار کا
DATE INSTALLED DATE SHUT DOWN (DISMANTLED)	01/01/67	01/01/67 4/1/95	1/1/84 4/1/95	۱۱۳	
MAX FUEL BURNING DESIGN (INCLUDE UNITS) DESIGN CAPACITY (MMBTU/HR)	300 KW			11.7 SM OF	
FUEL 1 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	Diesel 996450 BTU 9723 Gals Ct Refinery		A/N/A	Natural Gas 14670 Kas CCE 1500000000000000000000000000000000000	(4.69)
FUEL 2 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER			Not Have		S. C. A. C. C.
FUEL 3 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER					
FUEL TYPE NUMBER - SOLID FUEL PERCENT ASH					
PRIMARY CONTROL SYSTEM SECONDARY CONTROL SYSTEM					·
OPACITY MANUFACTURER OPACITY MODEL					/
LAST STACK TEST DATE					

(7.) COMPANY NAME: Veterans	Veterans Memorial Medical Ctr.	FUEL BURNING SOU	SOURCES: DATA UPDATED TO:	O: PAGE OF
	SOURCE 5	SOURCE 6	SOURCE 7	SOURCE 8
BUILDING	Main Plant		Main Plant	
SOURCE DESCRIPTION DEP REGISTRATION/PERMIT NUMBER	Catapillar #3512 #240200549 Keeler 900HP DS_10_6(1) P21	1	Keeler 900HP DS-10-6(2)	
DATE INSTALLED DATE SHUT DOWN (DISMANTLED)	1/1/83	1/1/67	1/1/67	
MAX FUEL BURNING DESIGN (INCLUDE UNITS) DESIGN CAPACITY (MMBTU/HR)	1000 KW	300_1b/H	1,330 <u>1</u> b/H	
FUEL 1 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	Diesel 2.2 MBTU 926 Gals Ct. Refinery	Natural Gas CUF 14050 CCF Yankee Gas	Natural Gas	
FUEL 2 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER		#6 011 1.00 140 GPH 119112 Gal & w. ch Buckley	#6 011 1.00 140 GPH 119113 Gal & Artho Buckley	
FUEL 3 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) MAX BURNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER				
FUEL TYPE NUMBER - SOLID FUEL PERCENT ASH			F	
PRIMARY CONTROL SYSTEM SECONDARY CONTROL SYSTEM				
OPACITY MANUFACTURER OPACITY MODEL				

LAST STACK TEST DATE

Programme Constitution	C mode	39-90	HANDON	A College	2
		TEART 9:30 END //: 4	U une 11/2		7-20
	NO EQUIPMENT REGISTERED			DATES SENT 100 TOK	r
	GEONTHE ONLE	TITLE, OIR.	PERCET NOS. ON PRO . NEW		
MAIL	1014	-		cor: Same	
ADDRE	so Meriperis	UNIVERSE TO C	O Walling feet How		Service and the service and th
	•		ack Ave	RETURN BY: 49-90	
4.	Burn Waste Oll/che /d/au		Den त ००५%		
	22.1 G 011/G BEI/ 013 E	ill.bottoms. Type of was	te: 100NE		
5 5	Sample (s) of materials t	taken/type: None	_		
6. Check	ALL control equipment ar	nd found: ALL ARE OF	ERATING PER REGULATION, S	OME ARE NOT OPPRATITUE DECISION	
				trol equipment	
7. Organi.	c Disposal-max, daily= _			1 Method:	
0.	Vented hazardous materia	le, and misses total	le) Asb. Se Cd Pb Hg . Ou	heri	
9. ACTION	(22,710	r.)		None	
3. ALIIUM.	NV NO.	7		OTHER:	
		Reg. Subsection	Equipment Descripti	.on	
10. RECOMME	Parisis		<u> </u>		
IV. RECEPTE	reduces Ne - 1115	pect in 2	years		
11. OBSTRUM	mas. This hose	2.41	J. 10 (1		
	0		its pathological	incinerator on 1/18/	90.
		is now handle	d by Safe way in	Middletown.	
#/-	1/ 1	ers and one Joh	inston Boiler (York-Sh.	ipley) are each dual-	fired
	nat gas, and	each has a prog	per registration (two k	ievers) or permit (Johnst	m).
	T TEETER DOIL	er was operating	during the inspects		•
po VI	sible emissions we	ere observed			
/	wo 3M) Steri-	Vac 400 Steriliz	ention use ethylene	oxide (137grem cartridge	ट्य
		tors are used to	purge the EtO 1	\(\text{\tin}\\ \text{\tert{\text{\text{\text{\text{\text{\text{\text{\text{\texi}\text{\tin}\text{\text{\text{\text{\text{\texi}\text{\text{\texi}\tint{\text{\texi}\tinz{\text{\texi}\tint{\text{\texi}\text{\texi}\tin}\tint{\text{\texi}\tint{\texitint{\texi{\texi}\texit{\tex{	he
<u>aera</u>	tors are then v	vented directly	to the atmosphere		
		/	· · · · · · · · · · · · · · · · · · ·		
	urce is in comp	diance with all a	applicable regulations	at this time.	
	· · · · · · · · · · · · · · · · · · ·		<i>,</i> , ,		
					
2.OTHER	•	241	0010		
REPORT TIME:	1/2 hra. INSPECTOR'S	S SIGNATURE KILLY CO	Should	124 DATE: 5/2/90	
SUPERVI SORY	COMPONIA	Le. done (Inde	the done	*************	****
Supervisor's	Comments:			Priority	
•		(1			
		agge	rec	· · · · · · · · · · · · · · · · · · ·	
Soor-Light s	for next inspections	=//1 + -1	0 / / / /	-	
10		10 milemes 2	-71. Vehich fuel	2 mgmles &	
- Commy	ACV	Q-18-91000	11/2 //		
7nana		The state of the s	SIGATURE: WEichler	5/3/90 Ma	
	mervel: <u>AT Nos.</u> T	ine 1 'C itre. Cer	000 1 North	NESSAN COS -	
Tab poli	led Ores		7		
			÷	R	
				/)	

J

FUEL BURNING SOURCES: DATA UPDATED TO:	SOUNCE 5	Main Plant Mai	• • •			#5.011 #5.011 1.00 1.00 1.60 CPH 1.9112 Call 1.9113 Ca				
0EP COOE: 01157 DOL'100-1-0020	(7.) COMPANY MAME: Veterans Memorial Medical Cr. SOURCE 5		SOURCE DESCRIPTION DEP RESISTRATION/PERMIT NUMBER 1/1/63 1/1/63	MAX FUEL BUXNING DESIGN (INCLUDE UNITS) 1000, 9ESIGN CAPACITY (MBIU/NR)	FUEL 1 TYPE SULPIR CONTENT (FERCENT BY MEIGHT) SULPIR CONTENT (FERCENT BY MEIGHT) SULPIR CONTENT (FERCENT BY MEIGHT) AMMAN USAGE (INCLUDE UNITS) FUEL SUPPLIER	FUEL 2 TYPE SULTUE CONTENT (PERCENT BY NEIGHT) NAX BUTHER RATING (INCLUDE UNITS) ABBUAL YSAGE (INCLUDE UNITS) FUEL SUPPLIER	FIEL 3 TYPE SYN PUR CONTENT (PERCENT BY WEJEHT) MAX SYNORE BATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	FUEL TIPE NUMBER - SOLIO FUEL PERCENT AND PRIMER PRIMER SOLIO FUEL PERCENT AND PRIMER SOLIO FUEL PERCENT P	SECONDARY CONTROL. CPACITY MANUFACTURER - DRACITY HOUSE.	

_	FRO	M : UM	1C ENG	INCERI	ING DEP	PARTME	PHONE	NO. : 283 634	7499	Mar.	30 199	98 Ø9:	16AM I	P1
•	- o		Ì		0	x'5	Jul 92,500				. 1 .			
	PAGE	SOUTCE 4	Main Flant Fork Shipley	1/1/83	11.1 AMSE		14670 BCE 141,825.00F Yaukee Gas							SAL TO STATE
	RCES: DATA UPDATED TO:	SOURCE 3	Main Plant	0 1	411/95		R1A R1A							·
	FUEL BURNING SOURCES:	SOURCE 2	Nain Plant	CB 011 Beater	4/1/95		M/A							
	. <u>100 - 201 -</u>	source 1	Main Plant	Bell Detroit Generator	01/01/67	300 00	Diesel 996450 Ellis C. Refinery							
	050 - 001 - 100 - 25110 - 300	(7.) COMPANY NAME: Vererans Memorial Medical Cressing	BUILDING	SOURCE DESCRIPTION REP REGISTRATION/PEDALT HUNBER	DATE THSTALLED DATE SHUT GOIN (DISSMATLED)	MAX FLEL BURNING DESIGN (INCLUDE UNITS) NESIGN CAPACITY (PORTUPN)	FUEL 1 TTPE SULENR CONTENT (PERCENT BY WEIGHT) MAX BLIBHER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	FIREL 2 TYPE SULFUR CONTENT (PERCENT BY WEIGHT) HAX BURNER RATING (INCLUDE UNITS) ARRUAL USAGE (INCLUDE UNITS) FIEL SUPPLIER	FUEL 3 TYPE SULFUR CORTENT (PERCENT BY NETGHT) NAX BUDNER RATING (INCLUDE UNITS) ANNUAL USAGE (INCLUDE UNITS) FUEL SUPPLIER	FLEL TYPE MANGEL - SOLID FUEL PERCENT ASH	PRIMARY CONTROL SYSTEM SECONDARY CONTROL SYSTEM	DEACTTY HANDEACTURET OPICITY HOUSE.	LAST STACE TEST DATE	

The MSDS envir be stached or sape will the Experite product with which it is associated.

SA CALL HAST

STREETS TO VOCAMONATA SWITSHIRL

STREETS TO VOCAMONATA SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECULATION: A COMMONATARY SWITSHIRL

SECUL INTERNATIONAL INTORNATION ARLON

INTERNATIONAL : IATA : AIR SHIPPENTS DOT SHIP NAME: PRINCISCH DISTILLATE, NOS NAS CLACE 1 2 UN IN 8 0 0W 1148 / PACKING CHOUP: III

PLANNALE LIQUID CAMPE COMMENTS:

DYTERMATIONAL DICC HATER EXTREMITS OUT BELT MANE: PETROLEUM SISTILLATE, NOS

MAE CLAME ON 10 A NORTHO GROUP: LANK TLANGUELE LIQUID CONSTRUCTOR | STOROGE PEOPLE |

-/352

CRAYWILL'S COMPONATION -HATHRIAL SAFETY DATA SHEET

COMPONIE TO OBUS PORM NO. 1818-0012 COMPLIES WITH GRAM MARAND COMMENCATION TEMPORARD, SPCTH1910.1200

MATA MALASO SATING PLANTABILITY REACTIVITY

IDENTITY: SOVER ACTIONS CONSCION (COMMONTINUE LIGHTS)

SECTION I

MUTACIDEE'S MADE: GRAYNILLS CORPORATION
GREEG: 1745 MORNE LINGOLM AVE.
GRICHGO, ILLIBOUS 60413

PHINDEROY 6: 1-804-424-9304 (CHE TRIEPHONE 9: 1-313-477-4100 pr-- PREFAIRD: JANUARY 11, 1904. 'ME'E SIGNATURE: E.C. SATEL

LABORATION COMPONENTS (SPECIFIC COMM. ACQUIR CASE AAACS & COMPONENTS COMPONENTS (SPECIFIC COMM. ACQUIR CASE AAACS & AA PIN (DIF 106 PM 106 PM 14556-84-8

SECTION FIF - PHTSICAL/CORNIGAL COMPACTEMENTOS

SOCIAMO RAMAGO (PALMAGONICAL COMPACTEMENTOS

SOCIAMO RAMAGONE (ON NO 0 350;) 10.0

WANGON ROMENTOW (AIR-1): 4.0

VALON ROMENTO (AIR-1): 4.0

VALON ROMENTO (AIR-1): 4.0

VISCOSTRET: 780 Q/L

VISCOSTRETY (0 350;) 12 GPS

PHI N/A

APPEARANCE 4 GOOR: CLEAR CREEN LIQUID, NILD MEMBRAL STRIPS GOOR.

ANCTION IV - FIRE AND EXPLOSION MALADD DATA

FLACES NOTION (NATIONAL MARKE): 1187 (TAM DO ASTM 254)

FLACES NOTION (NATIONAL MARKE): 1187 (TAM DO ASTM 254)

FLACES NOTIONAL MARKET (NATIONAL MARKET M

PARTS CLEANER IN
BOILER ROOM

MATE DISPOSAL METEOD. ANGLAIM ST DISPILLATION OR MAVE DISPOSAL PERPONNES BY A BECKENSON-MATE MINIST. MATE DISPOSAL SHOPL.

PRECAUTIONS TO BE TAKEN IN HAMELING & STORING: STOKE IN COSE AREA AWAY FROM MARY OR STOM FLANCES. ALL PRECAUTIONS APPLY TO ENTRY CONTAINER.

OTHER PERCENTIONS: NOT SECONGRADURE, SUFFICIENT VENTILATION OF VOLCING AND NATION TO THE BOOK AREA CONCENTRATION SELON APPLICABLE SAFSTY LEVELS.

SECTION VIII - CONTROL HEAFTRING EMPIRATORY PROTECTION (SPECIFY TYPE): MORE.

THE SAME PARTY HOUSE HOUSENESS TO CONTRACT HOUSE SAME PARTY HOUSE PAR

PROTECTIVE GLOVES: HATRILE

BYS PROTECTION: CHINICAL EPLANN SCORES

OTHER PROPERTY ELOTHER OR ROUTPIERT: FOR CONSTRUCT USE, NETHELS GLOVES AND FOLVEST RESISTRAT AFRON ALE RECOMMENDED. MAKE GOODLES AN APPROPRIATE.

NORK/HYSIGHIC PRACTICES: THE SKIR LOTTER OR CAMPA IF GLOVES AND NOT WORK

BECTION IX - TRANSPORTATION IMPORTATION

DOMASTIC (DOT)

BOOMS, COMMONTALE LIGHT, N.C.S., COMMONTALE LIGHTS, NA1993, III

AIR: VSE INTERCRITORAL REGULATIONS

INTERMINYOMA, (ICRO/INTA) 8.0.0., 3, UNISS, III, CLASS 66, SECRETORS, E.S. QUARTE, III, CLASS 66, SECRETORS, LINITED, BURNITITY OF TO SL. (FOR PLASTIC, METAL AND ALIMINESS CONTAINEDS) 2.5L FOR CLASS:

THE DATA PRESENTED IS THOSE AND CORRECT TO THE SOOF OF OUR DOUGLEDGE AND SOLIES. MITTERS RELIEF NOW PREPARED NOUTH ANY MARRANTIES, EXPERIENCE ON DOUGLES, CONCENTION FOR EXPONENTS, HERCAUTISELY OF PETRESE OF

SPECIAL FIRS FIGHTING PROCESSINGS: ORGER SPACES ENGINE MITTER TO LEGISLATE ORGERS OF REPTORS. MEAR RELF-CONTRIBUTE RESTRICTED GRAD. MICHINES BARRISTED OF TRANS. MILPON OR SECONDOSIVION PRODUCTS.

KBA, PIRS AMB EXPLOSION MARADS: CONSUSTIBLE LIQUID, URBNE COOLS MARÝFORS MARGO. APPOISSITION ISMNERATURE APPROXIMATELY 454F (7270).

TABLETT: DEFENDING | PLANE | |

PRACTICAL DESCRIPTION OF STANES | PRACTICAL DESCRIPTIONS OF STANES |

DESCRIPTIONS TO AVOID: THEY MANY PROF MAY, STANES AND OPEN FILMS.

DECORPORTISTICAL DESCRIPTION, STANES OF STANES

OR AI - MENTAL DESTRAINS NY SYLD (E) RESPONDED (E)

LTE BALANCE (ACVIES & COMMITCE):

Pope 3 (Lust Pore)

DOWNER THE TENTH NATER FOR IS MINUTED.

SELIN CONTROT: PROLUNCED & REPEATED EXPOSORS HAY DRY THE SELIN. VASH EXPOSED AREA SITE MAYOR & APPLY SELIN LOTICAL OR LANGLIN CREAM. INDUATION: EXCUSEIVE INSALATION NAY RESULT IN TRAINATION TO MOSS, THOSE & BERFERITORY TRACE. VERY RIGH VAPOR CONCENTRATION CAN CROSS MEASURED & DISSUMBLE.

, priestica: DO MOT INDUCE VONITING. CALL DOCTOR: IF MORE THAN 3.0 FE/RS IS TRION. KEEP MEAD BLOW MIT TO PREVENT ASPERATION.

SECTION VIE - PRICADTIONS FOR SAFE MANN-LING AND USE STREET TO BE TAKED TO CASE MATERIAL IS RELEASED ON SPILLED. BUE ADDRESS. MATERIAL OR SAMO. SMOVEL LITTO MASTE CONTAINER. DISPOSE OF PROPRIETA.


Appendix C: Environmental Data Resources, Inc. (EDR) FirstSearch Report

1 King Place1 King PlaceMeriden, CT 06451

Inquiry Number: 3915976.2s

April 17, 2014

FirstSearch Report

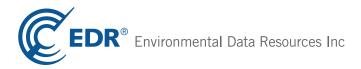

Search Summary Report

TARGET SITE 1 KING PLACE MERIDEN, CT 06451

Category	Sel	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
NPL	Υ	0	0	0	0	0	0	0
NPL Delisted	Υ	0	0	0	0	0	0	0
CERCLIS	Υ	0	0	1	0	-	0	1
NFRAP	Υ	0	0	0	0	-	0	0
RCRA COR ACT	Υ	0	0	0	0	2	0	2
RCRA TSD	Υ	0	0	0	0	-	0	0
RCRA GEN	Υ	0	0	0	-	-	0	0
Federal IC / EC	Υ	0	0	0	0	-	0	0
ERNS	Υ	0	-	-	-	-	0	0
State/Tribal CERCLIS	Υ	0	0	4	6	14	6	30
State/Tribal SWL	Υ	0	0	0	0	-	0	0
State/Tribal LTANKS	Υ	0	0	3	9	-	4	16
State/Tribal Tanks	Υ	1	0	8	-	-	1	10
State/Tribal IC / EC	Υ	0	0	0	0	-	0	0
State/Tribal VCP	Υ	0	1	2	0	-	1	4
ST/Tribal Brownfields	Υ	1	0	1	0	-	0	2
US Brownfields	Υ	0	2	2	3	-	1	8
Other Haz Sites	Υ	0	-	-	-	-	0	0
Local Land Records	Υ	0	0	4	-	-	0	4
Spills	Υ	1	-	-	-	-	0	1
Other	Υ	4	3	19	-	-	11	37
	- Totals	7	6	44	18	16	24	115

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Search Summary Report

TARGET SITE: 1 KING PLACE MERIDEN, CT 06451

Category	Database	Update	Radius	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
NPL	NPL	10/25/2013	1.000	0	0	0	0	0	0	0
	Proposed NPL	10/25/2013	1.000	0	0	0	0	0	0	0
NPL Delisted	Delisted NPL	10/25/2013	1.000	0	0	0	0	0	0	0
CERCLIS	CERCLIS	10/25/2013	0.500	0	0	1	0	-	0	1
NFRAP	CERC-NFRAP	10/25/2013	0.500	0	0	0	0	-	0	0
RCRA COR ACT	CORRACTS	03/11/2014	1.000	0	0	0	0	2	0	2
RCRA TSD	RCRA-TSDF	03/11/2014	0.500	0	0	0	0	-	0	0
RCRA GEN	RCRA-LQG	03/11/2014	0.250	0	0	0	-	-	0	0
	RCRA-SQG	03/11/2014	0.250	0	0	0	-	-	0	0
	RCRA-CESQG	03/11/2014	0.250	0	0	0	-	-	0	0
Federal IC / EC	US ENG CONTROLS	12/17/2013	0.500	0	0	0	0	-	0	0
	US INST CONTROL	12/17/2013	0.500	0	0	0	0	-	0	0
ERNS	ERNS	09/30/2013	TP	0	-	-	-	-	0	0
State/Tribal CERCLIS	SHWS	04/23/2010	1.000	0	0	0	0	1	0	1
	SDADB	04/23/2010	1.000	0	0	4	6	13	6	29
State/Tribal SWL	SWF/LF	08/14/2013	0.500	0	0	0	0	-	0	0
State/Tribal LTANKS	LUST	02/11/2014	0.500	0	0	3	9	_	4	16
	INDIAN LUST	02/01/2013	0.500	0	0	0	0	-	0	0
State/Tribal Tanks	UST	03/03/2014	0.250	1	0	8	_	_	1	10
	AST	07/01/2013	0.250	0	0	0	-	-	0	0
	INDIAN UST	02/01/2013	0.250	0	0	0	-	-	0	0
State/Tribal IC / EC	AUL	02/11/2014	0.500	0	0	0	0	-	0	0
State/Tribal VCP	VCP	02/11/2014	0.500	0	1	2	0	-	1	4
ST/Tribal Brownfields	BROWNFIELDS	10/22/2013	0.500	1	0	1	0	-	0	2

Search Summary Report

TARGET SITE: 1 KING PLACE MERIDEN, CT 06451

Category	Database	Update	Radius	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
US Brownfields	US BROWNFIELDS	03/20/2014	0.500	0	2	2	3	-	1	8
Other Haz Sites	US CDL	12/04/2013	TP	0	-	-	-	-	0	0
Local Land Records	CT PROPERTY	02/11/2014	0.250	0	0	4	-	-	0	4
Spills	HMIRS	12/31/2013	TP	0	-	-	-	-	0	0
	SPILLS SPILLS 90	01/28/2014 10/15/2012	TP TP	1 0	-	-	-	-	0 0	1 0
Other	RCRA NonGen / NLR	03/11/2014	TP	0	-	-	-	-	0	0
	TRIS TSCA	12/31/2011 12/31/2006	TP TP	0 0	-	-	-	-	0 0	0 0
	FTTS	04/09/2009	TP	0	-	-	-	-	0	0
	SSTS	12/31/2009	TP	0	_	_	_	_	0	0
	ICIS	07/20/2011	TP	0	_	_	_	_	0	0
	PADS	06/01/2013	TP	0	_	-	_	_	0	0
	MLTS	07/22/2013	TP	0	-	-	_	-	0	0
	RADINFO	01/09/2014	TP	0	-	-	-	-	0	0
	FINDS	11/18/2013	TP	2	-	-	-	-	0	2
	RAATS	04/17/1995	TP	0	-	-	-	-	0	0
	LWDS	07/17/2009	0.250	0	1	1	-	-	0	2
	MANIFEST	07/30/2013	0.250	0	1	17	-	-	6	24
	INDIAN RESERV	12/31/2005	1.000	0	0	0	0	0	0	0
	US AIRS	10/23/2013	TP	2	-	-	-	-	0	2
	PRP	04/15/2013	TP	0	-	-	-	-	0	0
	CPCS	01/30/2014	0.250	0	1	1	-	-	5	7
	- Totals			7	6	44	18	16	24	115

Site Information Report

Request Date:APRIL 17, 2014Search Type:COORDRequest Name:SHELBY MILLERJob Number:NA

Target Site: 1 KING PLACE

MERIDEN, CT 06451

Site Location

 Degrees (Decimal)
 Degrees (Min/Sec)
 UTMs

 Longitude:
 72.809200
 72.8092000 - 72° 48′ 33.12″
 Easting: 682765.3

 Latitude:
 41.533900
 41.5339000 - 41° 32′ 2.04″
 Northing: 4600132.5

 Elevation:
 153 ft. above sea level
 Zone: Zone 18

Demographics

Sites: 91 Non-Geocoded: 24 Population: N/A

RADON

Federal EPA Radon Zone for NEW HAVEN County: 1

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for NEW HAVEN COUNTY, CT

Number of sites tested: 1286

 Area
 Average Activity
 % <4 pCi/L</th>
 % 4-20 pCi/L
 % >20 pCi/L

 Living Area
 1.070 pCi/L
 89%
 10%
 1%

 Basement
 1.900 pCi/L
 78%
 20%
 2%

Federal Area Radon Information for NEW HAVEN COUNTY, CT

Number of sites tested: 158

% <4 pCi/L % 4-20 pCi/L % >20 pCi/L Area Average Activity 0% Living Area - 1st Floor 2.083 pCi/L 83% 17% 1.200 pCi/L Living Area - 2nd Floor 100% 0% 0% Basement 2.470 pCi/L 0% 84% 16%

Site Information Report RADON State Database: CT Radon Radon Test Results < 4 Pci/L # Sites 4 < 10 Pci/L 10 < 20 Pci/L 20 < 50 Pci/L > 100 Pci/L City 50 < 100 Pci/L Wallingford 100 90 (90) 10 (10) 0(0)0(0)0(0)0(0)0 (0) 19 (95) 0 (0) 0(0)0 (0) Waterbury 20 1 (5) West Haven 14 (93.3) 1 (6.7) 0 (0) 0 (0) 0 (0) 0 (0) 14 7 3 (42.9) 4 (57.1) 0 (0) 0 (0) 0 (0) 0 (0) Wolcott Woodbridge 126 79 (62.7) 32 (25.4) 9 (7.1) 4 (3.2) 1 (.8) 0(0)Yalesville 3 3 (100) 0 (0) 0(0)0 (0) 0(0)0(0)8 (7.3) 1 (9) Ansonia 110 62 (56.4) 29 (26.4) 10 (1) 0(0)Beacon Falls 4 1 (25) 0 (0) 0 (0) 0 (0) 0 (0) 3 (75) 2 (66.7) 1 (33.3) 0 (0) 0 (0) Bethany 3 0(0)0(0)126 (64.3) 14 (7.1) Branford 196 40 (20.4) 13 (6.6) 13 (1.5) 0(0)Cheshire 16 10 (62.5) 4 (25) 2 (12.5) 0(0)0 (0) 0 (0) 4 (36.4) 6 (54.6) 0 (0) Derby 1 (9) 0(0)0 (0) 11 4 (14.8) 1 (3.7) 0 (0) 0 (0) 0 (0) East Haven 27 22 (81.5) Guilford 138 95 (68.8) 22 (15.9) 13 (9.4) 7 (5.1) 0 (0) 1 (.7) Hamden 39 29 (74.4) 10 (25.6) 0(0)0 (0) 0(0)0(0)9 (6.8) Madison 133 84 (63.2) 32 (24) 6 (4.5) 2 (1.5) 0 (0) Meriden 97 76 (78.4) 19 (19.6) 0 (0) 0 (0) 1 (1) 1 (1) 5 (100) 0 (0) Middlebury 5 0 (0) 0(0)0(0)0(0)Milford 20 15 (.75) 4 (20) 1 (5) 0(0)0(0)0(0)8 (88.9) 1 (11.1) 0 (0) 0 (0) Naugatuck 9 0(0)0(0)16 (76.2) 0 (0) 0 (0) New Haven 21 5 (23.8) 0(0)0(0)0 (0) 0 (0) North Branford 13 11 (84.6) 2 (15.4) 0(0)0(0)North Haven 3 (0) 2 (0) 0 (0) 0(0)0(0)0(0)5 Northford 7 5 (71.4) 0(0)1 (14.2) 0(0)0(0)1 (14.2) Orange 16 14 (87.5) 2 (12.5) 0(0)0(0)0(0)0(0)0 (0) 0 (0) 3 0 (0) 0(0)Oxford 2 (0) 1 (0) Prospect 3 3 (100) 0 (0) 0 (0) 0 (0) 0 (0) 0 (0) Seymour 9 5 (55.6) 3 (33.3) 1 (11.1) 0(0)0(0)0(0)Southbury 21 10 (47.6) 8 (38.1) 3 (14.3) 0(0)0(0)0(0)

Target Site Summary Report

Target Property: 1 KING PLACE JOB: NA MERIDEN, CT 06451

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
A1	US AIRS	VETERANS MEMORIAL MEDICAL CENT	1 KING PLACE MERIDEN, CT 06450	0.00	+ 0	1
A1	FINDS	VETERANS MEMORIAL MEDICAL CENT	1 KING PLACE MERIDEN, CT 06450	0.00	+ 0	4
A2	US AIRS	J.E.M., INC	1 KING PLACE MERIDEN, CT 06450	0.00	+ 0	5
А3	SPILLS 9701017 CLOSED		1 KING PLACE VETERAN MEMO MERIDEN, CT	0.00	+ 0	9
A4	UST 80-7086 Permanently Closed Temporarily Closed	VETERANS MEMORIAL MEDICAL CENT	1 KING PL MERIDEN, CT 06451	0.00	+ 0	10
A5	BROWNFIELDS	GENERAL HOSPITAL	1 KING PL MERIDEN, CT	0.00	+ 0	13
A6	FINDS	BRADLEY RESEARCH CENTER, LLC	1 KING PLACE MERIDEN, CT	0.00	+ 0	14

Target Property: 1 KING PLACE JOB: NA MERIDEN, CT 06451

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
7	CPCS Cleanup Initiated	VETERNS MEMORIAL MEDICAL CENTE	LEWIS AVE ACROSS FROM MER MERIDEN, CT 06450	0.06 South	+ 1	15
8	LWDS	INTERNATIONAL SILVER	MERIDEN, CT	0.10 North	- 20	16
В9	US BROWNFIELDS	85 COOPER STREET	85 COOPER STREET MERIDEN, CT	0.11 ESE	- 6	17
C10	VCP	INSILCO MANUFACTURING (FORMER)	116 COOK AVENUE MERIDEN, CT	0.12 NE	- 18	20
C11	US BROWNFIELDS	FORMER MERIDEN MEDICAL CENTER	116 COOK AVENUE MERIDEN, CT	0.12 NE	- 18	23
C12	MANIFEST	INSILCO CORP	116 COOK ST MERIDEN, CT 06450	0.12 NE	- 19	26
D13	UST 80-7125 Currently In Use	MERIDEN MEDICAL CENTER	COOK AVE MERIDEN, CT	0.13 NNE	- 23	28
D14	MANIFEST	SOUTH END GARAGE	181 HANOVER ST MERIDEN, CT 06450	0.13 NNE	- 23	29
D15	MANIFEST	EXPERT AUTO	181 HANOVER ST MERIDEN, CT 06451	0.13 NNE	- 23	34
B16	CERCLIS CTN000105724	FACTORY H	77 COOPER STREET MERIDAN, CT 06451	0.13 ESE	- 8	37
B17	US BROWNFIELDS	FACTORY H - 77 COOPER STREET	77 COOPER STREET MERIDEN, CT 06451	0.13 ESE	- 8	42
B18	BROWNFIELDS	FORMER FACTORY H-INTERNATIONAL	77 COOPER STREET MERIDEN, CT 06451	0.13 ESE	- 8	62
B18	VCP	FORMER FACTORY H-INTERNATIONAL	77 COOPER STREET MERIDEN, CT 06451	0.13 ESE	- 8	63
E19	CT PROPERTY	PERSONAL EXPRESSIONS	35 MERIDIAN STREET MERIDEN, CT	0.14 SE	+ 0	66
E19	SDADB 4461	PERSONAL EXPRESSIONS	35 MERIDIAN STREET MERIDEN, CT	0.14 SE	+ 0	69
E20	UST 80-10709 Permanently Closed	VACANT	35 MERIDIAN ST MERIDEN, CT 06451	0.14 SE	+ 0	71

Target Property: 1 KING PLACE JOB: NA MERIDEN, CT 06451

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No
21	MANIFEST	OAKLAND MECHANICALS	224 COOK AVE MERIDEN, CT 06450	0.14 SSE	- 18	72
F22	MANIFEST	YANKEE GAS (C L&P MERIDEN AREA	56 COOPER ST MERIDEN, CT 06450	0.14 ESE	- 10	74
F23	CT PROPERTY	YANKEE GAS MERIDEN SERVICE CEN	56 COOPER STREET MERIDEN, CT	0.14 ESE	- 10	81
F24	UST 170-8368 80-9955 Permanently Closed	YANKEE GAS MERIDEN AREA WORK C	56 COOPER ST MERIDEN, CT 06451	0.14 ESE	- 10	84
25	UST 80-7214 Permanently Closed	KOGUT FLORIST & GARDEN CENTER	50 YALE AVE MERIDEN, CT 06450	0.15 NNE	- 25	88
G26	UST 80-7103 Permanently Closed Currently In Use	KWIK MART	80 COOK AVE MERIDEN, CT 06451	0.19 NNE	- 10	91
G27	MANIFEST	XTRA MART	80 COOK AVE MERIDEN, CT 06450	0.19 NNE	- 10	94
G27	LUST Cleanup Initiated 59707	XTRA MART	80 COOK AVE MERIDEN, CT 06450	0.19 NNE	- 10	96
G28	MANIFEST	KENYON OIL EXTRA MART	80 COOK ST MERIDEN, CT 06450	0.19 NNE	- 10	100
29	CT PROPERTY	ZIMERMAN, JOSEPH M.D.	319 HANOVER STREET MERIDEN, CT	0.19 West	+ 21	102
29	SDADB 4467	ZIMERMAN, JOSEPH M.D.	319 HANOVER STREET MERIDEN, CT	0.19 West	+ 21	105
30	LWDS	MERIDEN AREA WORK CENTER	COOPER STREET AND MERIDIA MERIDEN, CT	0.20 SE	- 13	107
31	SDADB 1344	INSILCO FACTORY	COOPER STREET AND CHERRY MERIDEN, CT	0.20 ESE	- 12	108
G32	MANIFEST	FIRESTONE STORE 7056	72 COOK AVE MERIDEN, CT 06450	0.20 NNE	- 4	111

JOB:

NA

1 KING PLACE MERIDEN, CT 06451 Target Property:

GEOCODED: 91 NON GEOCODED: 24 TOTAL: 115

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
G33	MANIFEST	FIRESTONE INC	72 COOK AVE MERIDEN, CT 06450	0.20 NNE	- 4	112
G34	UST 80-3656 Permanently Closed	FIRESTONE STORE #7056	72 COOK AVE MERIDEN, CT 06451	0.20 NNE	- 4	114
G35	MANIFEST	FIRESTONE 00582	72 COOK AVE MERIDEN, CT 06451	0.20 NNE	- 4	115
G36	MANIFEST	FIRESTONE STORE 7056	72 COOK AVE MERIDEN, CT 06450	0.20 NNE	- 4	122
H37	MANIFEST	CT STATE OF DOT	270-74 COOK AVE MERIDEN, CT 06451	0.23 South	- 30	128
138	US BROWNFIELDS	FACTORY H - 104 BUTLER STREET	104 BUTLER STREET MERIDEN, CT 06451	0.23 NE	- 12	130
139	VCP	INTERNATIONAL SILVER COMPANY,	104 BUTLER STREET MERIDEN, CT	0.23 NE	- 12	147
J40	MANIFEST	CITY OF MERIDEN	77 COOPER ST MERIDEN, CT 06450	0.23 ESE	- 5	150
J41	MANIFEST	INTERNATIONAL SILVER	55 COOPER ST MERIDEN, CT 06450	0.23 ESE	- 5	167
J42	MANIFEST	MERIDEN AREA WORK CENTER (C L&	56 COOPER ST MERIDEN, CT 06450	0.23 ESE	- 5	169
J43	MANIFEST	MERIDEN AREA WORK CENTER (C L	56 COOPER ST MERIDEN, CT 06450	0.23 ESE	- 5	175
J44	MANIFEST	YANKEE GAS (C L & P MERIDEN AR	56 COOPER ST MERIDEN, CT 06450	0.23 ESE	- 5	177
J45	MANIFEST	MERIDEN SERVICE CENTER	56 COOPER ST MERIDEN, CT 06450	0.23 ESE	- 5	195
H46	CT PROPERTY	SPENCER'S GARAGE	274 COOK AVENUE MERIDEN, CT	0.24 South	- 30	203
H46	SDADB 4465	SPENCER'S GARAGE	274 COOK AVENUE MERIDEN, CT	0.24 South	- 30	206
H47	LUST Pending 59683	CT DOT	265 COOK AVENUE MERIDEN, CT	0.24 South	- 30	208
148	UST 80-3879 Permanently Closed Currently In Use	HANOVER TOWERS REALTY	76 BUTLER ST MERIDEN, CT 06451	0.24 NE	- 12	212

JOB:

NA

1 KING PLACE MERIDEN, CT 06451 Target Property:

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
149	CPCS LUST Completed ([HANOVER TOWERS DEP's significant hazard definition)	76 BUTLER STREET MERIDEN, CT 06450	0.24 NE	- 12	215
149	LUST Lust Completed 28629	HANOVER TOWERS	76 BUTLER STREET MERIDEN, CT 06450	0.24 NE	- 12	216
150	UST 80-7050 Permanently Closed	MOTOR VEHICLE DEPT. (BUTLER ST	47 BUTLER ST MERIDEN, CT 06451	0.25 NE	- 10	220
51	LUST RSRs Reached 60226	TRI CORNER AUTO SERVICE, INC.	350 HANOVER STREET MERIDEN, CT 06451	0.27 West	+ 2	221
K52	LUST Cleanup Initiated 28437	GETTY STATION	213 COLONY RD. MERIDEN, CT 06450	0.27 ESE	+ 9	225
K53	SDADB 4457	GETTY PETROLEUM	213 COLONY STREET MERIDEN, CT 06450	0.27 ESE	+ 9	229
L54	LUST Investigation 49338	SOUTHERN NEW ENGLAND TELE	27 BUTLER ST MERIDEN, CT 06450	0.29 NE	- 6	231
L55	SDADB 4464	SNET	25 BUTLER STREET MERIDEN, CT	0.29 NE	- 5	235
56	SDADB 937 944	COLONIAL CUSTOM CLEANERS	9 BUTLER ST MERIDEN, CT	0.32 NNE	+ 0	237
57	LUST Pending 48546	LOCKHART RESIDENCE	48 LAUREL HEIGHTS MERIDEN, CT	0.40 SW	+ 50	241
M58	US BROWNFIELDS	51-53 SOUTH COLONY ST	51-53 SOUTH COLONY ST MERIDEN, CT 06450	0.41 ENE	- 2	245

JOB:

NA

1 KING PLACE MERIDEN, CT 06451 Target Property:

GEOCODED: 91 NON GEOCODED: 24 TOTAL: 115

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No
M59	SDADB 877	THE MERIDEN RECORD CO.	11 CROWN STREET MERIDEN, CT	0.42 ENE	+ 6	250
60	LUST Lust Completed 48734	H.C.S. ENTERPRISES, LLC	293 WEST MAIN STREET MERIDEN, CT	0.43 NNW	- 9	252
61	SDADB 2991	DUFFY PROPERTY	382 COOK AVENUE MERIDEN, CT	0.43 South	+ 10	256
62	US BROWNFIELDS	FORMER CHURCH AND MORSE	33 SOUTH COLONY ST MERIDEN, CT 06450	0.44 ENE	- 1	258
63	LUST Lust Completed 28433	CT. NATIONAL BANK	1 WEST MAIN ST. MERIDEN, CT 06450	0.45 NE	+ 3	263
N64	SDADB 1555	HENNY PENNY (FORMERLY VINNIE'S	2 MAIN STREET MERIDEN, CT 06450	0.47 NE	- 13	267
N65	LUST Cleanup Initiated 31697	HENNY PENNY (FORMERLY VINNIE'S	2 MAIN STREET MERIDEN, CT 06450	0.47 NE	- 13	270
66	LUST Lust Completed 34263	SALVATION ARMY	23 ST.CASIMER ST SALVATIO MERIDEN, CT 06450	0.47 ENE	+ 11	274
N67	LUST Investigation 28428	MERIDEN SENIOR CENTER	22 WEST MAIN ST. MERIDEN, CT 06450	0.48 NE	- 12	278
68	US BROWNFIELDS	33 COLONY STREET	15-31 CHURCH ST MERIDEN, CT 06451	0.49 NE	+ 6	282
69	SDADB 4446	AMERICAN OIL CHANGE CORP.	321-327 WEST MAIN STREET MERIDEN, CT	0.51 NNW	- 20	285
70	SDADB 740	MERIDEN FOUNDRY DUMP SITE	COE AVENUE AND HANOVER RO MERIDEN, CT	0.58 WSW	- 23	287

JOB:

NA

Target Property: 1 KING PLACE MERIDEN, CT 06451

GEOCODED: 91 NON GEOCODED: 24 TOTAL: 115

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
071	SDADB 4453	DAVELLA MOTORS, INC.	41 CAPITOL AVENUE MERIDEN, CT	0.61 NW	- 20	289
72	SDADB 4458	GUEST COMPANY INC.	49 ELM STREET MERIDEN, CT	0.63 East	+ 126	291
O73	SDADB 1947	MAGNAKLEEN	54 CAPITOL AVENUE MERIDEN, CT	0.63 NW	- 26	293
74	SDADB 762	RAGEDINO	4-10 AMES AVENUE MERIDEN, CT	0.69 NNW	- 21	295
75	SDADB 875	THE EUREKA PRESS INC.	264 BROAD STREET MERIDEN, CT	0.73 ESE	+ 150	297
P76	CORRACTS	QUINLAN RUSSELL (J. B. COGGINS	5 CROSS ST MERIDEN, CT	0.74 NE	- 3	299
P77	SDADB 228	J. B. COGGINS CO.	5 CROSS STREET MERIDEN, CT 06450	0.74 NE	- 3	300
P77	SHWS	J. B. COGGINS CO.	5 CROSS STREET MERIDEN, CT 06450	0.74 NE	- 3	302
78	SDADB 4451	CITY OF MERIDEN	41 HIGH STREET MERIDEN, CT	0.75 East	+ 125	303
79	SDADB 753	SILVER CITY GLASS	122 CHARLES STREET MERIDEN, CT	0.84 ESE	+ 122	305
80	CORRACTS	MILLER CO THE	99 CENTER ST MERIDEN, CT 06450	0.92 ENE	+ 5	307
81	SDADB 757	DUMP #3	JOHNSON AVENUE AND SYLVAN MERIDEN, CT	0.94 WNW	- 16	309
82	SDADB 4448	AS YOU LIKE IT CLEANERS	367 E MAIN ST MERIDEN, CT 06450	0.96 East	+ 125	311

Target Property: 1 KING PLACE

1 KING PLACE MERIDEN, CT 06451

JOB: NA

TOTAL: 115 GEOCODED: 91

NON GEOCODED: 24

DB Type

Map ID	ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
83	SDADB 3169	VALERIO ALBARELLO, INC.	41-45 PARKER AVENUE MERIDEN, CT 06450	0.97 East	+ 131	313

Target Property: 1 KING PLACE

1 KING PLACE MERIDEN, CT 06451

JOB: NA

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
	UST 80-7206 Permanently Closed Currently In Use	MERIDEN MAINT. GARAGE (BLDG 81	ROUTE 15 W. C. PARKWAY MERIDEN, CT	NON GC	N/A	N/A
	MANIFEST	CT STATE OF DOT	RTE 15 OVER I 91 MERIDEN, CT 06450	NON GC	N/A	N/A
	MANIFEST	STATE OF CT DOT	RTE 15 MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB 763	DUMP #9	ROUTE 66 MERIDEN, CT	NON GC	N/A	N/A
	VCP	MERIDEN HUB	1 & 77 STATE STREET & 30 MERIDEN, CT	NON GC	N/A	N/A
	MANIFEST	KERI CORP	RTE 91 NORTHBOUND MERIDEN, CT	NON GC	N/A	N/A
	CPCS LUST Completed (E	EYELET SPECIALTIES DEP's significant hazard definition)	NORTH BROWN ST. MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST Lust Completed 29533	EYELET SPECIALTIES	NORTH BROWN ST. MERIDEN, CT 06450	NON GC	N/A	N/A
	MANIFEST	TARGET	3474 CHAIMBERLAIN HWY MERIDEN, CT 06451	NON GC	N/A	N/A
	MANIFEST	CITGO PETROLEUM	CHAMBERLAIN HWY MERIDEN, CT 06451	NON GC	N/A	N/A
	CPCS Cleanup Initiated	CABIN RESTAURANT / ANTHONY PAG	COLONY STREET, BROOKS STR MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST Cleanup Initiated 31542	CABIN RESTAURANT / ANTHONY PAG	COLONY STREET, BROOKS STR MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB 765	DUMP #11	NORTH COLONY STREET MERIDEN, CT	NON GC	N/A	N/A
	SDADB 734	HANOVER POND	HANOVER POND MERIDEN, CT	NON GC	N/A	N/A

JOB:

NA

Target Property: 1 KING PLACE

TOTAL: 115

1 KING PLACE MERIDEN, CT 06451

GEOCODED: 91 NON GEOCODED: 24

Map ID	DB Type ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
	SDADB 755	DUMP #1	HANOVER STREET MERIDEN, CT	NON GC	N/A	N/A
	CPCS Pending	INTERSECTION OF W. MAIN & CENT	INTERSECTION OF W. MAIN & MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST Pending 45333	INTERSECTION OF W. MAIN & CENT	INTERSECTION OF W. MAIN & MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB 756	DUMP #2	WEST SIDE HANOVER POND MERIDEN, CT	NON GC	N/A	N/A
	CPCS LUST Completed (I	CITY OF MERIDEN, BOB MERCALDI DEP's significant hazard definition)	SILVER LAKE PUMP STATION, MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST Lust Completed 36487	CITY OF MERIDEN, BOB MERCALDI	SILVER LAKE PUMP STATION, MERIDEN, CT 06450	NON GC	N/A	N/A
	US BROWNFIELDS	MERIDEN HUB	1-77 STATE STREET 30 EAST MERIDEN, CT 06450	NON GC	N/A	N/A
	MANIFEST	MERIDEN MANUFACTURING	230 STATE STREET EXTENTIO MERIDEN, CT 06450	NON GC	N/A	N/A
	CPCSLUST Completed (E	CITY OF MERIDEN, WILMA PIETRA DEP's significant hazard definition)	THOMAS EDISON MIDDLE SCHO MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB 736	CUNO ENGINEERING	SOUTH VINE STREET MERIDEN, CT	NON GC	N/A	N/A

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1004454997 **DIST/DIR:** 0.000 **ELEVATION:** 153 **MAP ID:** A1

NAME: VETERANS MEMORIAL MEDICAL CENTER (W) Rev: 10/23/2013

ADDRESS: 1 KING PLACE MERIDEN, CT 06450

NEW HAVEN

AIRS (AFS):

Airs Minor Details:

SOURCE: US EPA

EPA plant ID: 110001730039

Plant name: VETERANS MEMORIAL MEDICAL CENTER (W)

Plant address: 1 KING PLACE MERIDEN, CT 06450 County: NEW HAVEN

Region code: 01

Dunn & Bradst #: 069256618 Air quality cntrl region: 042

Sic code: 8062

Sic code desc: Not reported North Am. industrial classf: 622110

NAIC code description: General Medical and Surgical Hospitals Default compliance status: IN COMPLIANCE - INSPECTION

Default classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR

Govt facility: ALL OTHER FACILITIES NOT OWNED OR OPERATED BY A FEDERAL, STATE, OR

LOCAL GOVERNMENT Current HPV: Not reported

Compliance and Enforcement Major Issues:

Air program: SIP SOURCE National action type: Not reported

Date achieved: 00000
Penalty amount: Not reported

Historical Compliance Minor Sources:

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1004

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1103

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1201

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1203

- Continued on next page -

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1004454997 DIST/DIR: 0.000 **ELEVATION:** 153 MAP ID: A1

10/23/2013 VETERANS MEMORIAL MEDICAL CENTER (W) NAME: Rev:

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450 **NEW HAVEN**

SOURCE: US EPA

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1302

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1101

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1102

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1104

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1202

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1204

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1301

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1303

Air prog code hist file: SIP SOURCE

Compliance & Violation Data by Minor Sources:

Air program code: SIP SOURCE

Plant air program pollutant: SULFUR DIOXIDE

Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR

Def. poll. compliance status: IN COMPLIANCE - INSPECTION
Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT

Repeat violator date: Not reported Turnover compliance: Not reported

Air program code: SIP SOURCE

- Continued on next page -

1 KING PLACE JOB: Target Property: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1004454997 DIST/DIR: 0.000 **ELEVATION:** 153 MAP ID: A1

VETERANS MEMORIAL MEDICAL CENTER (W) 10/23/2013 NAME: Rev:

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

Plant air program pollutant: FINE PARTICULATES: HIGH PROBABILITY OF NON-ATTAINMENT Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR

Def. poli. compliance status: IN COMPLIANCE - INSPECTION

Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT

Repeat violator date: Not reported Turnover compliance: Not reported

Air program code: SIP SOURCE

Plant air program pollutant: TOTAL PARTICULATE MATTER

Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR Def. poll. compliance status: IN COMPLIANCE - INSPECTION
Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT

Repeat violator date: Not reported Turnover compliance: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

FINDS

EDR ID: 1004454997 **DIST/DIR:** 0.000 **ELEVATION:** 153 **MAP ID:** A1

NAME: VETERANS MEMORIAL MEDICAL CENTER (W) Rev: 11/18/2013

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

FINDS:

Registry ID: 110001730039

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1005676328 **DIST/DIR:** 0.000 **ELEVATION:** 153 **MAP ID:** A2

NAME: J.E.M., INC Rev: 10/23/2013

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

AIRS (AFS):

Airs Minor Details:

EPA plant ID: 110002351749 Plant name: J.E.M., INC Plant address: 1 KING PLACE MERIDEN, CT 06450 County: NEW HAVEN

Region code: 01

Dunn & Bradst #: Not reported Air quality cntrl region: 042

Sic code: 8062

Sic code desc: Not reported North Am. industrial classf: 622110

NAIC code description: General Medical and Surgical Hospitals Default compliance status: IN COMPLIANCE - INSPECTION

Default classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR

Govt facility: ALL OTHER FACILITIES NOT OWNED OR OPERATED BY A FEDERAL, STATE, OR

LOCAL GOVERNMENT Current HPV: Not reported

Compliance and Enforcement Major Issues:

Air program: SIP SOURCE
National action type: Not reported

Date achieved: 00000 Penalty amount: Not reported

Air program: SIP SOURCE National action type: Not reported

Date achieved: 00000 Penalty amount: Not reported

Air program: Not reported National action type: Not reported Date achieved: Not reported Penalty amount: Not reported

Air program: Not reported National action type: Not reported Date achieved: Not reported Penalty amount: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1005676328 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A2

NAME: J.E.M., INC Rev: 10/23/2013

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

Air program: Not reported National action type: Not reported Date achieved: Not reported Penalty amount: Not reported

Air program: Not reported National action type: Not reported Date achieved: Not reported Penalty amount: Not reported

Historical Compliance Minor Sources:

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1004

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1101

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1102 Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1103

Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1201

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1202

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1203
Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1204 Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1005676328 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A2

NAME: J.E.M., INC Rev: 10/23/2013

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

Hist compliance date: 1302

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1303

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1004

Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1101

Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1102

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1103

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1104

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1104
Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1201

Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1202

Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1203

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1204

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US AIRS

EDR ID: 1005676328 **DIST/DIR:** 0.000 **ELEVATION:** 153 **MAP ID:** A2

NAME: J.E.M., INC Rev: 10/23/2013

ADDRESS: 1 KING PLACE

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1301

Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1301 Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1302 Air prog code hist file: Not reported

State compliance status: IN COMPLIANCE - INSPECTION

Hist compliance date: 1303

Air prog code hist file: Not reported

Compliance & Violation Data by Minor Sources:

Air program code: SIP SOURCE
Plant air program pollutant: Not reported
Default pollutant classification: Not reported

Def. poll. compliance status: PRESENT, SEE OTHER PROGRAM(S)

Def. attainment/non attnmnt: Not reported

Repeat violator date: Not reported Turnover compliance: Not reported

Air program code: SIP SOURCE

Plant air program pollutant: SULFUR DIOXIDE

Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR

Def. poll. compliance status: IN COMPLIANCE - INSPECTION

Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT

Repeat violator date: Not reported Turnover compliance: Not reported

Air program code: Not reported

Plant air program pollutant: Not reported

Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR

Def. poll. compliance status: IN COMPLIANCE - INSPECTION

Def. attainment/non attnmnt: Not reported Repeat violator date: Not reported

Turnover compliance: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SPILLS

EDR ID: \$106500684 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A3

NAME: Rev: 01/28/2014

ADDRESS: 1 KING PLACE VETERAN MEMORIAL MEDICAL CENTER ID/Status: 9701017 ID/Status: CLOSED

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

SPILLS:

Year of Database: 1997 Case Number: 9701017 Who Took Spill: 205 Assigned To: 936 Report Date: 02/26/1997 Report Time: 22:24:00 Date Release: 02/26/1997 Time Responded: 21:00:00 Reported By: JIM HAMELILN Phone: 203 2388686

Representing: VETERENS MEMORIAL MEDICAL CENTER

Terminated: YES Recovd (Total): 0 Total (Water): 0 Facility Status: CLOSED

Continuous Spill: False

Released Substance: #6 FUEL OIL

Qty: 100 (Gallons)

Emergency Measure: CONTRACTED TO UNITED RECOVERY

Water Body: NONE
Discharger: Not reported
Telephone: Not reported
Responsible Party: Not reported
RP Address 1: Not reported

RP City,St,Zip: CT Historic: False Waterbody: False

Time Stamp: 1997-03-10 13:07:04 Sr Inspector: SAMORAJCZYK,JEFF

At Inspctor: Wofford, Ron User Stamp: Not reported Comments: Not reported Action: Contained

Other Action: Not reported Action: Contracted Other Action: Not reported

Cause ID: Overfill

Other Cause: Not reported Media ID: Ground Surface Other Media: Not reported Release Type: petroleum Other Release: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002175273 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A4

NAME: VETERANS MEMORIAL MEDICAL CENTER Rev: 03/03/2014

ADDRESS: 1 KING PL ID/Status: 80-7086

MERIDEN, CT 06451

ID/Status: Permanently Closed
ID/Status: Temporarily Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-7086 Latitude: Not reported Longitude: Not reported

Owner: BRADLEY RESEARCH CENTER, LLC

Owner Address: 23 1/2 1ST ST Owner Address 2: Not reported

Owner City, St, Zip: NORWALK, CT 068552310

Tank ID: 7086-1 Compartment ID: 7086-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 20000 Substance: Heating Oil Date Installed: 01/01/1954 Date Last Used: 03/01/1984

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7086-2

Compartment ID: 7086-2 Compartment Num: 1 Alt. Tank ID: A1R1

Tank Status: Temporarily Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Cathodically Protected

Capacity: 15000 Substance: Heating Oil Date Installed: 10/01/1990 Date Last Used: 06/17/2010 Closure Status: Not reported

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002175273 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A4

NAME: VETERANS MEMORIAL MEDICAL CENTER Rev: 03/03/2014

ADDRESS: 1 KING PL ID/Status: 80-7086

MERIDEN, CT 06451

ID/Status: Permanently Closed
ID/Status: Temporarily Closed

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 7086-3

Compartment ID: 7086-3 Compartment Num: 1 Alt. Tank ID: A2

Tank Status: Temporarily Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 2000 Substance: Heating Oil Date Installed: 02/01/1982 Date Last Used: 06/17/2010 Closure Status: Not reported

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7086-4 Compartment ID: 7086-4 Compartment Num: 1 Alt. Tank ID: A2R1

Tank Status: Temporarily Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 2000 Substance: Heating Oil Date Installed: 02/01/1982 Date Last Used: 06/17/2010 Closure Status: Not reported

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7086-5

Compartment ID: 7086-5 Compartment Num: 1 Alt. Tank ID: A3

Tank Status: Temporarily Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 5000

Substance: Heating Oil

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002175273 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A4

NAME: VETERANS MEMORIAL MEDICAL CENTER Rev: 03/03/2014

ADDRESS: 1 KING PL ID/Status: 80-7086

MERIDEN, CT 06451

ID/Status: Permanently Closed
ID/Status: Temporarily Closed

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 02/01/1982 Date Last Used: 06/17/2010 Closure Status: Not reported

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7086-6

Compartment ID: 7086-6 Compartment Num: 1 Alt. Tank ID: B2

Tank Status: Permanently Closed

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Not reported

Capacity: 10000
Substance: Heating Oil
Date Installed: 03/01/1984
Date Last Used: 06/17/2010
Closure Status: Not reported

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

BROWNFIELDS

EDR ID: \$109591344 **DIST/DIR:** 0.000 **ELEVATION:** 153 **MAP ID:** A5

NAME: GENERAL HOSPITAL Rev: 10/22/2013

ADDRESS: 1 KING PL

MERIDEN, CT NEW HAVEN

SOURCE: CT Connecticut Brownfields Redevelopment Authority

BROWNFIELDS 2:

Region: 2 Acreage: 2.7 Past Use: Hospital Contact Party: CBRA

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

FINDS

EDR ID: 1016185695 DIST/DIR: 0.000 ELEVATION: 153 MAP ID: A6

NAME: BRADLEY RESEARCH CENTER, LLC Rev: 11/18/2013

ADDRESS: 1 KING PLACE

MERIDEN, CT NEW HAVEN

SOURCE: US EPA

FINDS:

Registry ID: 110002351749

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

CRITERIA AND HAZARDOUS AIR POLLUTANT INVENTORY

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CPCS

EDR ID: S107454694 **DIST/DIR:** 0.059 South **ELEVATION:** 154 **MAP ID:** 7

NAME: VETERNS MEMORIAL MEDICAL CENTER Rev: 01/30/2014

ADDRESS: LEWIS AVE ACROSS FROM MERIDAN SOLIARE

ID/Status: Cleanup Initiated

ADDRESS: LEWIS AVE ACROSS FROM MERIDAN SQUARE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CPCS:

Site Type: LUST

Lust Status: Cleanup Initiated PTP Form: Not reported Program: Not reported

Program: Not reported Comments: #2 Heating Oil, , Tank Removed By Centrex Excavating Mystic Air Called

Not Reported For 6 Days

Site Type Definition: Leaking Underground Storage Tanks Rem. Started

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LWDS

EDR ID: \$109937705 **DIST/DIR:** 0.099 North **ELEVATION:** 133 **MAP ID:** 8

NAME: INTERNATIONAL SILVER Rev: 07/17/2009

ADDRESS:

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

LWDS:

Leachate and Wastewater Number: 5206012 Status of the Discharge Activity: Inactive Leachate and Waste Flow: Surface

Alias: Not reported Alias2: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016356303 DIST/DIR: 0.115 ESE ELEVATION: 147 MAP ID: B9

NAME: 85 COOPER STREET Rev: 03/20/2014

ADDRESS: 85 COOPER STREET

MERIDEN, CT NEW HAVEN

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: 85 COOPER STREET

Property #: Not reported

Parcel size: .33

Property Description: The Site consists of one lot totaling approximately 0.33 acres. It is

a vacant lot primarily surrounded by a chain linked fence and is entirely paved, however the pavement is in poor condition and overgrown with vegetation. There are no structures present on the Site. The Site was previously used as a parking lot by the former Meriden Medical Center located at 116 Cook Avenue and it has been vacant since the former Meriden Medical Center became unoccupied in approximately 2000. Prior to that, A former house and outbuilding were present on the Site from at least the 1940s to the late 1960s. The Site has been owned by Cook Avenue Realty, Inc. since 2004. The Site directly adjoins the former INSILCO, Factory H property to the east. According to FEMA Flood Map No. 090081 0004C, dated November 20, 2000, the Site is located within the 100-year flood plain. In 1987 an environmental investigation on this property and the adjacent 116 Cook Avenue property showed lead present in soil. Lead concentrations in soils exceeded Extraction Procedure Toxicity E.P. Tox Lead United States Environmental Protection Agency USEPA Resource Conservation and Recovery Act RCRA regulations. The lead impacts were reportedly identified to four feet below the pavement. In August 1988 excavation activities were conducted. A total of 404 cubic yards of non-hazardous soil was excavated from the Site. In addition, twenty truck loads of hazardous material was generated and transported off-Site. Remediation activities were complete by January 1989 pursuant to a clean-up plan designed by ERL and approved by the Connecticut Department of Environmental Protection CTDEP. In a 2003 GeoQuest Investigation VOCs and metals were reported in groundwater.

however the concentrations did not exceed the applicable criteria.

Latitude: 41.5333729 Longitude: -72.8072474 HCM label: Interpolation-Map Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: World Geodetic System of 1984

ACRES property ID: 111786 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016356303 DIST/DIR: 0.115 ESE **ELEVATION:** MAP ID: B9 147

03/20/2014 NAME: **85 COOPER STREET** Rev:

ADDRESS: 85 COOPER STREET

MERIDEN, CT **NEW HAVEN**

SOURCE: US Environmental Protection Agency

Cleanup funding source: Not reported

Assessment funding: 1610

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: USEPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden, CT

Did owner change: N Cleanup required: Unknown Video available: No

Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported Groundwater affected: Y

Groundwater cleaned: Not reported Lead contaminant found: Y Lead cleaned up: Not reported No media affected: Not reported Unknown media affected: Not reported Other cleaned up: Not reported Other metals found: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016356303 DIST/DIR: 0.115 ESE **ELEVATION:** 147 MAP ID: B9

85 COOPER STREET 03/20/2014 NAME: Rev:

ADDRESS: 85 COOPER STREET

MERIDEN, CT **NEW HAVEN**

SOURCE: US Environmental Protection Agency

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Not reported Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: .33

Past use industrial acreage: Not reported Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: \$104183860 DIST/DIR: 0.117 NE ELEVATION: 135 MAP ID: C10

NAME: INSILCO MANUFACTURING (FORMER) Rev: 02/11/2014

ADDRESS: 116 COOK AVENUE

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

VCP:

Transferor (seller): Not reported Transfee (buyer): Not reported Certifying Party: City of Meriden

Certifying Party Attn: Lawrence J. Kendz Certifying Party Title: City Manager

Certifying Party Address: 142 East Main Street Certifying Party City, St, Zip: Meriden, CT 06450

Voluntary Remediation Site: Yes Date Received: 03/10/2014
Acknowledge Date: Not reported Determination Date: Not reported LEP Verified/DEP: Not reported

Rem Id: 11688

Remediation Location Id: 9190 Date Entered: 03/18/2014 Program: Vol_Rem_X GAO Site: False

Staff Full Name: Not reported Super/Date: Not reported Stage Of Project: Not reported

RP Level Of Activity: Not reported RP Needed Level Of Activity: Not reported

Staff Level Of Activity: Not reported Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False Staff Prefrence: Not reported

Readiness For Transfer: Not reported Project Transfer Time: Not reported Transfer Comments: Not reported Staff As Of July 2000: Not reported

Initial Staff: Not reported

Type Of Transfer: Voluntary Remediation

Salutation: Mr. Kendz

Relationship To Transfer: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: \$104183860 DIST/DIR: 0.117 NE ELEVATION: 135 MAP ID: C10

NAME: INSILCO MANUFACTURING (FORMER) Rev: 02/11/2014

ADDRESS: 116 COOK AVENUE

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: Not reported Basin: Not reported 1st Payment: 3250 Pay Tag1: 225594 2nd Payment: Not reported

2nd Payment: Not reported
Pay Tag2: Not reported
Rtn: Not reported
Revised: Not reported
ECAF Received: Not reported

ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported

Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: Not reported
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported Priority Or Work-Load: Not reported

Status: Not reported Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported

Pt Counter: 0

Project Complete: False Project Inactive: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: \$104183860 **DIST/DIR:** 0.117 NE **ELEVATION:** 135 **MAP ID:** C10

NAME: INSILCO MANUFACTURING (FORMER) Rev: 02/11/2014

ADDRESS: 116 COOK AVENUE

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Intl Deposit #: Not reported Deposit #: Not reported Spill Case #: Not reported

Diversion Id: 0

Public Notice: Not reported
Rap Received: Not reported
Rap Approved: Not reported
Compliance Category: Not reported

Delete Record: False

ECAF Reviewed By: Not reported

Notlocatable: False Primaryaddress: False Aka_sitename: False Primarysitename: False Aka_siteaddress: False Lead: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016356302 DIST/DIR: 0.117 NE ELEVATION: 135 MAP ID: C11

NAME: FORMER MERIDEN MEDICAL CENTER Rev: 03/20/2014

ADDRESS: 116 COOK AVENUE

MERIDEN, CT NEW HAVEN

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FORMER MERIDEN MEDICAL CENTER

Property #: Not reported Parcel size: 2.79

Property Description: This Site is comprised of 2.79-acres and consists of a vacant,

approximately 72,473 square foot, brick office building as well as paved areas for parking. The building is a four story structure with no basement. The City of Meriden acquired the property in December of 2009. The most recent active former Site occupant was the Meriden Medical Center. The Site has been vacant since approximately 2000 and was previously occupied by several health care offices since the late

1970s. Prior to that time the Site was part of the former International Silver Company INSILCO, Factory H property, that

directly adjoins the Site to the east and was reportedly used as

offices. According to FEMA Flood Map No. 090081 0004C, dated November

20, 2000, the Site is located within the 100-year flood plain. In

1987 an environmental investigation on this property and the adjacent 85 Cooper Street property showed petroleum hydrocarbons, volatile organic compounds VOCs and lead present in soil. Lead concentrations

in soils exceeded Extraction Procedure Toxicity E.P. Tox Lead United States Environmental Protection Agency USEPA Resource Conservation and Recovery Act RCRA regulations. The lead impacts were reportedly

confined to two feet below the pavement. In August 1988 excavation activities were conducted. 1,204 cubic yards of non-hazardous soil and thirty-two truck loads of hazardous soil were removed. Of the

1,204 cubic yards of material, approximately ten cubic yards from Area 2 was impacted with petroleum. Confirmation samples were taken from each excavation area. Remediation activities were complete by

January 1989 pursuant to a clean-up plan designed by ERL and approved by the Connecticut Department of Environmental Protection CTDEP. A

10,000 gallon underground heating oil UST is located outside the building, south of Wing C.

Latitude: 41.535085 Longitude: -72.807338 HCM label: Interpolation-Map Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: World Geodetic System of 1984

ACRES property ID: 111768
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

135 EDR ID: 1016356302 DIST/DIR: 0.117 NE **ELEVATION:** MAP ID: C11

FORMER MERIDEN MEDICAL CENTER 03/20/2014 NAME: Rev:

ADDRESS: 116 COOK AVENUE

MERIDEN, CT **NEW HAVEN**

SOURCE: US Environmental Protection Agency

Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 4800

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: USEPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden, CT

Did owner change: N Cleanup required: Unknown Video available: No

Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y Lead cleaned up: Not reported No media affected: Not reported Unknown media affected: Not reported

Other cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016356302 DIST/DIR: 0.117 NE ELEVATION: 135 MAP ID: C11

NAME: FORMER MERIDEN MEDICAL CENTER Rev: 03/20/2014

ADDRESS: 116 COOK AVENUE

MERIDEN, CT NEW HAVEN

SOURCE: US Environmental Protection Agency

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported Cleanup other description: Not reported

Superfund Fed. landowner flag: N

Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported Past use industrial acreage: 2.79 Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Future use industrial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

3915976.2s Site Details Page - 25

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109740763 DIST/DIR: 0.121 NE **ELEVATION:** MAP ID: C12 134

INSILCO CORP 07/30/2013 NAME: Rev:

ADDRESS: 116 COOK ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: NJA0779451

Year: 1991

Waste Occurence: 1 UNNA: 9189

Hazard Class: ORM-E

US Dot Description: HAZARDOUS WASTE SOLID, NOS

No of Containers: 016 Container Type: DM Quantity: 4800 Weight/Volume: P Additional Description: Y Handling Code: T03

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: NJA0779451

Year: 1991

Waste Occurence: 1 EPA Waste Code: F002 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1991

Manifest ID: NJA0779451 TSDF EPA ID: NJD053288239

TSDF Name: ROLLINS ENV SVS (NJ) INC

TSDF Address: ROUTE 322

TSDF City, St, Zip: BRIDGEPORT, NJ 08014

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 06/17/1991 Transporter EPA ID: MID982606287

Transporter Name: INLAND WATERS POLLUTION CONTROL

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

S109740763 DIST/DIR: 0.121 NE EDR ID: **ELEVATION:** 134 MAP ID: C12

NAME: **INSILCO CORP** 07/30/2013 Rev:

ADDRESS: 116 COOK ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTP000011659

Generator Phone: 2036342028 Generator Mailing Addr: 116 COOK ST Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Yes

Discrepancies: Yes
Date Shipped: 06/17/1991 Date Received: 06/18/1991 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002029620 **DIST/DIR:** 0.126 NNE **ELEVATION:** 130 **MAP ID:** D13

NAME: MERIDEN MEDICAL CENTER Rev: 03/03/2014

ADDRESS: COOK AVE ID/Status: 80-7125 ID/Status: Currently In Use

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-7125 Latitude: 41.534620 Longitude: -72.807050

Owner: MERIDEN MEDICAL CENTER ASSOC. LIM.

Owner Address: PO BOX 724 Owner Address 2: Not reported

Owner City, St, Zip: MERIDEN, CT 064500724

Tank ID: 7125-1 Compartment ID: 7125-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Currently In Use

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 10000
Substance: Heating Oil
Date Installed: 08/01/1977
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Other (Specify)
Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

130 EDR ID: S109745200 DIST/DIR: 0.128 NNE **ELEVATION:** MAP ID: D14

SOUTH END GARAGE 07/30/2013 NAME: Rev:

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: ctf1065827

Year: 2004 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: PETROLEUM DISTILLATES, N.O.S. OR PETROLEUM PRODUCTS, N.O.S.

No of Containers: 1 Container Type: DM Quantity: 10 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2005-01-10 00:00:00

DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: ctf1065827

Year: 2004 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: True

Date Record Was Last Modified: 2005-01-10 00:00:00

DEO Who Last Modified Record: JEB

Detail: Year: 2004

Manifest ID: ctf1065827 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC TSDF Address: 14 WEST MAIN ST TSDF City, St, Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: (203)238-6745 Transport Date: 05/24/2004 Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA Transporter Phone: (203)238-6745 Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109745200 **DIST/DIR:** 0.128 NNE **ELEVATION:** 130 **MAP ID:** D14

NAME: SOUTH END GARAGE Rev: 07/30/2013

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: ctp000025837

Generator Phone: Not reported

Generator Mailing Addr: 181 HANOVER ST

Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06451 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 05/24/2004 Date Received: 05/24/2004 Last modified date: 01/10/2005

Last modified by: JEB Comments: Not reported

Waste:

Manifest No: CTF0744191

Year: 1998 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: petroleum distillates nos

No of Containers: 001 Container Type: DM Quantity: 8 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0744191

Year: 1998

Waste Occurence: 1
EPA Waste Code: D001
Recycled Waste?: True

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

130 EDR ID: S109745200 DIST/DIR: 0.128 NNE **ELEVATION:** MAP ID: D14

SOUTH END GARAGE NAME: Rev: 07/30/2013

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 1998

Manifest ID: CTF0744191 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City, St, Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 11/17/1998

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY DBA ADVANCED LIQ REC

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported

EPA ID: CTP000016786 Generator Phone: 2032384321

Generator Mailing Addr: 181 HANOVER ST Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: No

Date Shipped: 11/17/1998 Date Received: 11/18/1998 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0363210

Year: 1994

Waste Occurence: 1 UNNA: 3082 Hazard Class: 9

US Dot Description: HAZARDOUS WASTE LIQUID, NOS

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109745200 **DIST/DIR:** 0.128 NNE **ELEVATION:** 130 **MAP ID:** D14

NAME: SOUTH END GARAGE Rev: 07/30/2013

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 001 Container Type: TT Quantity: 129 Weight/Volume: G Additional Description: Y Handling Code: T50

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0363210

Year: 1994

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail:

Year: 1994

Manifest ID: CTF0363210 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY UIS DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 07/13/1994

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY UIS DBA ADV LIQ REC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000016786

Generator Phone: 2032384321 Generator Mailing Addr: 181 HANOVER ST

Generator Mailing Town: MERIDEN

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109745200 **DIST/DIR:** 0.128 NNE **ELEVATION:** 130 **MAP ID:** D14

NAME: SOUTH END GARAGE Rev: 07/30/2013

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Yes

Discrepancies: No
Date Shipped: 07/13/1994
Date Received: 07/13/1994
Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

130 EDR ID: S109752132 DIST/DIR: 0.128 NNE **ELEVATION:** MAP ID: D15

EXPERT AUTO 07/30/2013 NAME: Rev:

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: ctf1281485

Year: 2006 Waste Occurence: 1 UNNA: 1268

Hazard Class: 3

US Dot Description: PETROLEUM DISTILLATES, N.O.S. OR PETROLEUM PRODUCTS, N.O.S.

No of Containers: 1 Container Type: DM Quantity: 8 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2007-07-03 00:00:00

DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: ctf1281485

Year: 2006 Waste Occurence: 1 EPA Waste Code: D001

Recycled Waste?: True

Date Record Was Last Modified: 2007-07-03 00:00:00

DEO Who Last Modified Record: JEB

Detail: Year: 2006

Manifest ID: ctf1281485 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC TSDF Address: 136 GRACEY AVE TSDF City, St, Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: (203)238-6745 Transport Date: 05/08/2006 Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA Transporter Phone: (203)238-6745 Trans 2 Date: Not reported

Trans 2 EPA ID: Not reported Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109752132 **DIST/DIR:** 0.128 NNE **ELEVATION:** 130 **MAP ID:** D15

NAME: EXPERT AUTO Rev: 07/30/2013

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTP000025837 Generator Phone: Not reported

Generator Mailing Addr: 181 HANOVER ST

Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06451 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 05/08/2006 Date Received: 05/08/2006 Last modified date: 07/03/2007

Last modified by: JEB Comments: Not reported

Waste:

Manifest No: CTF0997376

Year: 2001 Waste Occurence: 1 UNNA: 1993 Hazard Class: 3

US Dot Description: FLAMMABLE LIQUID N.O.S.

No of Containers: 001 Container Type: TT Quantity: 550 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0997376

Year: 2001

Waste Occurence: 1 EPA Waste Code: F005 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109752132 **DIST/DIR:** 0.128 NNE **ELEVATION:** 130 **MAP ID:** D15

NAME: EXPERT AUTO Rev: 07/30/2013

ADDRESS: 181 HANOVER ST

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 2001

Manifest ID: CTF0997376 TSDF EPA ID: CTD002593887

TSDF Name: BRIDGEPORT UNITED RECYCLE (HITCHCOCK)

TSDF Address: 50 CROSS ST

TSDF City, St, Zip: BRIDGEPORT, CT 06608

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 07/12/2001

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 Citv.St.Zip: CT

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000025837
Generator Phone: Not reported

Generator Mailing Addr: 181 HANOVER ST Generator Mailing Town: MERIDEN

Generator Mailing Town: METRIDE Generator Mailing State: CT Generator Mailing Zip: 06451 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: No

Date Shipped: 07/12/2001
Date Received: 07/12/2001
Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CERCLIS

EDR ID: 1010417165 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B16

NAME: FACTORY H Rev: 10/25/2013

ADDRESS: 77 COOPER STREET ID/Status: CTN000105724

MERIDAN, CT 06451 NEW HAVEN

SOURCE: US EPA

CERCLIS: Site ID: 0105724

EPA ID: CTN000105724
Facility County: NEW HAVEN
Short Name: FACTORY H
Congressional District: 05

IFMŠ ID: 01EE

SMSA Number: Not reported USGC Hydro Unit: Not reported Federal Facility: Not a Federal Facility

DMNSN Number: 0.00000 Site Orphan Flag: Not reported RCRA ID: Not reported USGS Quadrangle: Not reported

Site Init By Prog: R
NFRAP Flag: Not reported
Parent ID: Not reported
RST Code: Not reported

EPA Region: 01

Classification: Not reported Site Settings Code: Not reported NPL Status: Not on the NPL DMNSN Unit Code: Not reported RBRAC Code: Not reported

RResp Fed Agency Code: Not reported

Non NPL Status: Removal Only Site (No Site Assessment Work Needed)

Non NPL Status Date: 08/16/07
Site Fips Code: 09009
CC Concurrence Date: / /
CC Concurrence FY: Not reported
Alias EPA ID: Not reported
Site FUDS Flag: Not reported

CERCLIS Site Contact Name(s): Contact ID: 1000100.00000

Contact Name: TOM HATZOPOULOS

Contact Tel: (617) 918-1284

Contact Title: On-Scene Coordinator (OSC)
Contact Email: hatzopoulos.tom@epamail.epa.gov

Contact ID: 13004278.00000 Contact Name: Margaret Morris Contact Tel: Not reported

Contact Title: Site Assessment Manager (SAM)

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.130 ESE **ELEVATION:** 145 **MAP ID:** B16

NAME: FACTORY H Rev: 10/25/2013

ADDRESS: 77 COOPER STREET

ID/Status: CTN000105724

MERIDAN, CT 06451

NEW HAVEN SOURCE: US EPA

Contact Email: Not reported

Alias Comments: Not reported Site Description: Not reported CERCLIS Assessment History:

Action Code: 001

Action: REMOVAL ASSESSMENT

Date Started: 07/25/07 Date Completed: 08/27/07 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: EPA Fund-Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: INFORMATION REPOSITORY ESTABLISHED

Date Started: / /

Date Completed: 12/19/07 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: EPA Fund-Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: Public Notice Published

Date Started: / /

Date Completed: 01/07/08
Priority Level: Not reported
Operable Unit: SITEWIDE

Primary Responsibility: EPA Fund-Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CERCLIS

EDR ID: 1010417165 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B16 145

FACTORY H NAME: Rev: 10/25/2013

ID/Status: CTN000105724 ADDRESS: 77 COOPER STREET

MERIDAN, CT 06451 **NEW HAVEN**

SOURCE: US EPA

Action Code: 001 Action: REMOVAL Date Started: 09/28/07 Date Completed: 03/12/08 Priority Level: Cleaned up Operable Unit: SITEWIDE

Primary Responsibility: EPA Fund-Financed

Planning Status: Primary Urgency Indicator: Time Critical Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 002

Action: ISSUE REQUEST LETTERS (104E)

Date Started: / /

Date Completed: 12/21/10 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: Federal Enforcement

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 003

Action: ISSUE REQUEST LETTERS (104E)

Date Started: / /

Date Completed: 12/21/10 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: Federal Enforcement

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: ISSUE REQUEST LETTERS (104E)

Date Started: / /

Date Completed: 01/20/11 Priority Level: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CERCLIS

EDR ID: 1010417165 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B16

NAME: FACTORY H

Rev: 10/25/2013

ADDRESS: 77 COOPER STREET

ID/Status: CTN000105724

MERIDAN, CT 06451

NEW HAVEN SOURCE: US EPA

Operable Unit: SITEWIDE

Primary Responsibility: Federal Enforcement

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: Notice Letters Issued

Date Started: / /

Date Completed: 02/07/11 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: Federal Enforcement

Planning Status: Not reported

Urgency Indicator: Comb Notice/104(e)

Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: UNILATERAL ADMIN ORDER

Date Started: / /

Date Completed: 09/28/11 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: Federal Enforcement

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: Notice of Intent by All Parties

Date Started: / /

Date Completed: 10/10/11 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: Not reported Planning Status: Not reported Urgency Indicator: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.130 ESE **ELEVATION:** 145 **MAP ID:** B16

NAME: FACTORY H

Rev: 10/25/2013

ADDRESS: 77 COOPER STREET ID/Status: CTN000105724

MERIDAN, CT 06451 NEW HAVEN

SOURCE: US EPA

Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001

Action: CONSENT AGREEMENT (ADMINISTRATIVE)

Date Started: / /

Date Completed: 12/19/12 Priority Level: Not reported Operable Unit: SITEWIDE

Primary Responsibility: Federal Enforcement

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Click this hyperlink while viewing on your computer to access 90 additional US CERCLIS Financial: record(s) in the EDR Site Report.

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B17 145

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer

building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The

International Silver Co. was in operation at the site in 1939.

Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory

building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported Assessment funding: 67262

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Supplemental Assessment

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.130 ESE **ELEVATION:** 145 **MAP ID:** B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Accomplishment count: 0

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939.

Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory

building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Datum: World Geodetic System of 1984

ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 17325

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Supplemental Assessment

Accomplishment count: 0

Cooperative agreement #: 97114801 Ownership entity: Government Current owner: City of Meriden Did owner change: N

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Ashestos found: Y

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 52125

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase II Environmental Assessment

Accomplishment count: 0

Cooperative agreement #: 97114801 Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.130 ESE **ELEVATION:** 145 **MAP ID:** B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Ashostos found: V

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported

Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer

building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory

building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 2200

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97114801 Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported

PAHs found: Not reported PAHs cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Cleanup

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121 Start date: 01-DEC-08 Completed date: Not reported

Acres cleaned up: .1 Cleanup funding: 1757

Cleanup funding source: US EPA - Brownfields Cleanup Cooperative Agreement

Assessment funding: Not reported
Assessment funding source: Not reported
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: Not reported
Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Not reported

Accomplishment count: 0

Cooperative agreement #: 97182201
Ownership entity: Government
Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

Asbestos cleaned: Y

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported Lead contaminant found: Y Lead cleaned up: Not reported No media affected: Not reported Unknown media affected: Not reported Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported

Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 77 COOPER STREET

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.130 ESE **ELEVATION:** 145 **MAP ID:** B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer

building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The

International Silver Co. was in operation at the site in 1939.

Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory

building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 8908

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: USEPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Supplemental Assessment

Accomplishment count: 0

Cooperative agreement #: 96110701 Ownership entity: Government Current owner: City of Meriden

Did owner change: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE **ELEVATION:** 145 MAP ID: B17

FACTORY H - 77 COOPER STREET 03/20/2014 NAME: Rev:

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported Groundwater affected: Y Groundwater cleaned: Not reported Lead contaminant found: Y Lead cleaned up: Not reported

No media affected: Not reported Unknown media affected: Not reported Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported

Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B17 145

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)

Grant type: TBA

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939.

Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in

early 2008 to address asbestos contamination within the factory

building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B17 145

FACTORY H - 77 COOPER STREET 03/20/2014 NAME: Rev:

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 5000

Assessment funding source: US EPA - TBA Funding

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 0 Cooperative agreement #: n/a Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported Groundwater affected: Y

Groundwater cleaned: Not reported Lead contaminant found: Y Lead cleaned up: Not reported

No media affected: Not reported Unknown media affected: Not reported

Other cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported

Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported Past use industrial acreage: 3.46 Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported

Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)

Grant type: TBA

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer

building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B17 145

FACTORY H - 77 COOPER STREET NAME: Rev: 03/20/2014

ADDRESS: 77 COOPER STREET MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545 Longitude: -72.8068704 HCM label: Unknown Map scale: Not reported

Point of reference: Other Point

Datum: World Geodetic System of 1984 ACRES property ID: 73121

Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported Assessment funding: 35000

Assessment funding source: US EPA - TBA Funding

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase II Environmental Assessment

Accomplishment count: 0 Cooperative agreement #: n/a Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: No

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B17

NAME: FACTORY H - 77 COOPER STREET Rev: 03/20/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported

Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.46

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1012126908 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B17 145

FACTORY H - 77 COOPER STREET NAME: 03/20/2014 Rev:

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Greenspace acreage and type: Not reported Superfund Fed. landowner flag: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

BROWNFIELDS

EDR ID: S109591345 DIST/DIR: 0.130 ESE MAP ID: B18 **ELEVATION:** 145

FORMER FACTORY H-INTERNATIONAL SILVER NAME: 10/22/2013 Rev:

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

NEW HAVEN

SOURCE: CT Connecticut Brownfields Redevelopment Authority

CT BROWNFIELD:

Acres: 7

Past Use: Manufacturing/Silver Road Access: Rte 15 /I- 691

BROWNFIELDS 2:

Region: 2 Acreage: 7

Past Use: Silver manufacturing Contact Party: CBRA

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: S109591345 DIST/DIR: 0.130 ESE **ELEVATION:** MAP ID: B18 145

FORMER FACTORY H-INTERNATIONAL SILVER NAME: Rev: 02/11/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

VCP:

Transferor (seller): n/a Transfee (buyer): n/a

Certifying Party: City of Meriden

Certifying Party Attn: Lawrence J. Kendzior Certifying Party Title: City Manager

Certifying Party Address: 142 East Main Street Certifying Party City, St, Zip: Meriden, CT 06450

Voluntary Remediation Site: Yes Date Received: 10/27/2011 Acknowledge Date: 12/20/2011 Determination Date: 12/20/2011 LEP Verified/DEP: Not reported

Rem Id: 10704

Remediation Location Id: 8777 Date Entered: 11/02/2011 Program: Vol_Rem_X GAŎ Site: False

Staff Full Name: Jing Chen Super/Date: 12/21/2011 Stage Of Project: Not reported RP Level Of Activity: Not reported

RP Needed Level Of Activity: Not reported Staff Level Of Activity: Not reported

Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported PRP Cooperation: Not reported Enforcement Status: Not reported Level Of Complexity: Not reported Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False Staff Prefrence: Not reported

Readiness For Transfer: Not reported Project Transfer Time: Not reported Transfer Comments: Not reported Staff As Of July 2000: Not reported

Initial Staff: Not reported Type Of Transfer: Not reported Salutation: Mr. Kendzior

Relationship To Transfer: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: \$109591345 DIST/DIR: 0.130 ESE ELEVATION: 145 MAP ID: B18

NAME: FORMER FACTORY H-INTERNATIONAL SILVER Rev: 02/11/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: GB

Basin: Not reported 1st Payment: 0

Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
Rtn: Not reported
Revised: Not reported
FCAF Received: Not reporte

ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported

Yr 2 Report: Not reported Report Overdue: Not reported Ext Aprvl Sched: Not reported License #: Not reported Project Phase: Not reported

PT Comments: one of parcels for thesite, see all info in REM10705

EPA Id Number: Not reported GW Class: Not reported SW Class: Not reported AO/C0: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported Priority Or Work-Load: Not reported

Status: Not reported Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported

Pt Counter: 0

Project Complete: False Project Inactive: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: S109591345 **DIST/DIR:** 0.130 ESE **ELEVATION:** 145 **MAP ID:** B18

NAME: FORMER FACTORY H-INTERNATIONAL SILVER Rev: 02/11/2014

ADDRESS: 77 COOPER STREET

MERIDEN, CT 06451

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Intl Deposit #: Not reported Deposit #: Not reported Spill Case #: Not reported

Diversion Id: 0

Public Notice: Not reported Rap Received: Not reported Rap Approved: Not reported Compliance Category: Not reported

Delete Record: False

ECAF Reviewed By: Jing Chen

Notlocatable: False Primaryaddress: False Aka_sitename: False Primarysitename: False Aka_siteaddress: False

Lead: LEP

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104188022 DIST/DIR: 0.137 SE ELEVATION: 153 MAP ID: E19

NAME: PERSONAL EXPRESSIONS Rev: 02/11/2014

ADDRESS: 35 MERIDIAN STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: Southington Savings Bank

Buyer Name: Roger Ahlquist Certifying Party: Not reported

Certifying Attention Person: Not reported Title Of Certifying Person: Not reported Certifying Person Address: Not reported Certifying Person City, St, Zip: Not reported

Property Transfer Forms: Form I (DEP-PERD-PTP-201) when no release of hazardous waste has

occurred at the parcel being transferred.

Date Recieved: 03/24/1992 Ackn Date: 05/05/1992

Determination Date: Not reported

LEP Verified/DEP Approval Date: Not reported

Rem Id: 2094

Remediation Location Id: 3487 Date Entered: Not reported

Program: Property Transfer Program

GAO Site: False

Staff Full Name: Not reported Super/Date: Not reported Stage Of Project: Not reported RP Level Of Activity: Not reported RP Needed Level Of Activity: Not reported

Staff Level Of Activity: Not reported Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported

Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False Staff Prefrence: Not reported

Readiness For Transfer: Not reported Project Transfer Time: Not reported Transfer Comments: Not reported Staff As Of July 2000: Not reported

Initial Staff: Not reported Type Of Transfer: Not reported Salutation: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104188022 DIST/DIR: 0.137 SE ELEVATION: 153 MAP ID: E19

NAME: PERSONAL EXPRESSIONS Rev: 02/11/2014

ADDRESS: 35 MERIDIAN STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Relationship To Transfer: Not reported

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: Not reported
Basin: Not reported
1st Payment: 200
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
RTN: Not reported
Revised: Not reported
ECAF Received: Not reporte

Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported

Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: Not reported
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/CO: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported Priority Or Work-Load: Not reported Status: Not reported

Status: Not reported Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported Pt Counter: Not reported Project Complete: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: S104188022 DIST/DIR: 0.137 SE **ELEVATION:** 153 MAP ID: E19

NAME: PERSONAL EXPRESSIONS 02/11/2014 Rev:

ADDRESS: 35 MERIDIAN STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Project Inactive: False Int Deposit #: Not reported Deposit #: Not reported Spill Case #: Not reported Diversion Id: Not reported Public Notice: Not reported RAP Received: Not reported RAP Approved: Not reported Compliance Category: Not reported

Delete Record: False ECAF Reviewed By: Not reported

Not Locatable: False Primary Address: True AKA Site Name: False Primary Site Name: True AKA Site Address: False Lead: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188022 DIST/DIR: 0.137 SE ELEVATION: 153 MAP ID: E19

NAME: PERSONAL EXPRESSIONS Rev: 04/23/2010

ADDRESS: 35 MERIDIAN STREET ID/Status: 4461

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4461 Rem Master ID: 4543

PTP Id: 960

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4620 Source of referral: PTP Date Received: 3/24/1992 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 3/24/1992

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188022 DIST/DIR: 0.137 SE ELEVATION: 153 MAP ID: E19

NAME: PERSONAL EXPRESSIONS Rev: 04/23/2010

ADDRESS: 35 MERIDIAN STREET ID/Status: 4461

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

U000846972 EDR ID: DIST/DIR: 0.137 SE **ELEVATION:** 153 MAP ID: E20

NAME: **VACANT** 03/03/2014 Rev:

ID/Status: 80-10709 ADDRESS: 35 MERIDIAN ST

ID/Status: Permanently Closed MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-10709 Latitude: Not reported Longitude: Not reported

Owner: SOUTHINGTON SAVINGS BANK

Owner Address: 121 MAIN ST Owner Address 2: Not reported

Owner City, St, Zip: SOUTHINGTON, CT 064892505

Tank ID: 10709-1 Compartment ID: 10709-1 Compartment Num: 1

Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 1000 Substance: Heating Oil Date Installed: 01/01/1950 Date Last Used: 01/01/1992

Closure Status: Tank was Removed From Ground Pipe Material: Not reported

Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109755104 DIST/DIR: 0.137 SSE ELEVATION: 135 MAP ID: 21

NAME: OAKLAND MECHANICALS Rev: 07/30/2013

ADDRESS: 224 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: 000024347gbf

Year: 2007 Waste Occurence: 1 UNNA: 1993 Hazard Class: 3

US Dot Description: FLAMMABLE LIQUIDS, N.O.S.

No of Containers: 1 Container Type: TT Quantity: 1000 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2008-10-27 00:00:00

DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: 000024347gbf

Year: 2007 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2008-10-27 00:00:00

DEO Who Last Modified Record: JEB

Manifest No: 000024347gbf

Year: 2007

Waste Occurence: 1 EPA Waste Code: D018 Recycled Waste?: False

Date Record Was Last Modified: 2008-10-27 00:00:00

DEO Who Last Modified Record: JEB

Detail: Year: 2007

Manifest ID: 000024347gbf TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: (203)238-6745

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109755104 DIST/DIR: 0.137 SSE ELEVATION: 135 MAP ID: 21

NAME: OAKLAND MECHANICALS Rev: 07/30/2013

ADDRESS: 224 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Transport Date: 01/31/2007

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA

Transporter Phone: (203)238-6745
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City St Zin: CT

Trans 2 City, St, Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000029745
Congretor Phone: (860)589.1

Generator Phone: (860)589-1234
Generator Mailing Addr: PO BOX 531
Generator Mailing Town: BRISTOL
Generator Mailing State: CT
Generator Mailing Zip: 06010Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 01/31/2007
Date Received: 01/31/2007
Last modified date: 10/27/2008

Last modified by: JEB Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730658 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F22

NAME: YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: NYB6783012

Year: 1998

Waste Occurence: 1 UNNA: 3090 Hazard Class: 9

US Dot Description: WASTE LITHIUM BATTERIES LIQUID CATHODE

No of Containers: 001 Container Type: DM Quantity: 55 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: NYB6783012

Year: 1998 Waste Occurence: 1 EPA Waste Code: D003 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1998

Manifest ID: NYB6783012 TSDF EPA ID: NYD000632372

TSDF Name: LAIDLAW ENVIRONMENTAL SVS BDT INC

TSDF Address: 4255 RESEARCH PKWY TSDF City, St, Zip: CLARENCE, NY 14031

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 02/09/1998

Transporter EPA ID: NYD982792814

Transporter Name: FRANKS VACUUM TRUCK SVC INC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730658 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F22

NAME: YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing State. C1 Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: Yes
Date Shipped: 02/09/1998
Date Received: 02/18/1998
Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: MAK200222

Year: 1997 Waste Occurence: 1 UNNA: 1993 Hazard Class: 3

US Dot Description: WASTE COMBUSTIBLE LIQUID, N.O.S.

No of Containers: 001 Container Type: DF Quantity: 4 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Manifest No: MAK200222

Year: 1997 Waste Occurence: 2 UNNA: 1993 Hazard Class: 3

US Dot Description: RQ WASTE COMBUSTIBLE LIQUID, N.O.S.

No of Containers: 002 Container Type: DM

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730658 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F22

NAME: YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Quantity: 27 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: MAK200222

Year: 1997

Waste Occurence: 1 EPA Waste Code: D006 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Manifest No: MAK200222

Year: 1997 Waste Occurence

Waste Occurence: 2 EPA Waste Code: D006 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1997

Manifest ID: MAK200222 TSDF EPA ID: CTD980667927 TSDF Name: SAFETY-KLEEN CORP TSDF Address: 11 TIPPING DR

TSDF City, St, Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 06/30/1997 Transporter EPA ID: ILD984908202 Transporter Name: SAFETY-KLEEN CORP

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT

Trans 2 City, St, Zip: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730658 DIST/DIR: 0.143 ESE **ELEVATION:** 143 MAP ID: F22

YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) NAME: Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2036342410

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450

Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 06/30/1997 Date Received: 06/30/1997 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0458862

Year: 1995 Waste Occurence: 1 UNNA: 1203 Hazard Class: 3

US Dot Description: WASTE GASOLINE MIXTURE

No of Containers: 001 Container Type: DM Quantity: 55 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0458862

Year: 1995 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail:

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730658 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F22

NAME: YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Year: 1995

Manifest ID: CTF0458862 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES

TSDF Address: 130 FREIGHT ST

TSDF City, St, Zip: WATERBURY, CT 06725

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 08/31/1995

Transporter EPA ID: CT5000001685
Transporter Name: D TOX INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City, St, Zip: CT

Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No Date Shipped: 08/31/1995 Date Received: 09/05/1995 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0048794

Year: 1992 Waste Occurence: 1 UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETROLEUM NAPHTHA

No of Containers: 003

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730658 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F22

NAME: YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Container Type: DM Quantity: 258 Weight/Volume: P Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF0048794

Year: 1992 Waste Occurence: 2 UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETROLEUM NAPHTHA

No of Containers: 001 Container Type: DF Quantity: 27 Weight/Volume: P Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0048794

Year: 1992 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF0048794

Year: 1992

Waste Occurence: 2 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1992

Manifest ID: CTF0048794 TSDF EPA ID: CTD980667927

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730658 DIST/DIR: 0.143 ESE **ELEVATION:** 143 MAP ID: F22

YANKEE GAS (C L&P MERIDEN AREA WORK CENTER) 07/30/2013 NAME: Rev:

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDF Name: SAFETY KLEEN CORP 2-112-01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City, St, Zip: BRANFORD, CT 06405

TSDF Country: USA
TSDF Telephone: Not reported Transport Date: 07/14/1992

Transporter EPA ID: ILD051060408

Transporter Name: SAFETY KLEEN CORP (TRANSP)

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: Yes Discrepancies: No Date Shipped: 07/14/1992 Date Received: 07/14/1992 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: S108304803 DIST/DIR: 0.143 ESE **ELEVATION:** MAP ID: F23 143

YANKEE GAS MERIDEN SERVICE CENTER NAME: Rev: 02/11/2014

ADDRESS: 56 COOPER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: CL&P

Buyer Name: Yankee Gas Services Co. Certifying Party: Yankee Gas Services Certifying Attention Person: Not reported Title Of Certifying Person: Not reported Certifying Person Address: Not reported Certifying Person City, St, Zip: Not reported

Property Transfer Forms: Form III (DEP-PERD-PTP-203) when a discharge, spillage, uncontrolled

loss, seepage or filtration of hazardous waste has occurred at the parcel that has not been fully remediated or the environmental conditions at the parcel are unknown. The person signing the Form III certification agrees to investigate and remediate the site in

accordance with the remediation standards. The statute does not require completion of remediation before the parcel is transferred. Any person submitting a Form III shall simultaneously submit a

completed Environmental Condition Assessment Form

(ECAF)(DEP-PERD-PTP-200).

Date Recieved: 06/14/1989 Ackn Date: 12/19/1989 Determination Date: 03/21/2007

LEP Verified/DEP Approval Date: Not reported

Rem Id: 2075

Remediation Location Id: 2406 Date Entered: Not reported

Program: Property Transfer Program

GAO Site: False

Staff Full Name: Jing Chen Super/Date: 09/25/2006 Stage Of Project: Not reported RP Level Of Activity: Not reported

RP Needed Level Of Activity: Not reported Staff Level Of Activity: Not reported

Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported PRP Cooperation: Not reported Enforcement Status: Not reported Level Of Complexity: Not reported Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$108304803 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F23

NAME: YANKEE GAS MERIDEN SERVICE CENTER Rev: 02/11/2014

ADDRESS: 56 COOPER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Prefrence: Not reported

Readiness For Transfer: Not reported Project Transfer Time: Not reported Transfer Comments: Not reported Staff As Of July 2000: Czeczotka Jan

Initial Staff: JMC

Type Of Transfer: Not reported Salutation: Not reported

Relationship To Transfer: transferee

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: GB

Basin: Not reported 1st Payment: 900 Pay Tag1: Not reported 2nd Payment: Not reported Pay Tag2: Not reported RTN: 09/26/1989 Revised: 10/12/1989 ECAF Received: 8/30/06

Old Determination Date: Not reported Redeterminationdate: Not reported Previous Determination: Not reported Monitoringoption: Not reported Postremedialmonitoring: Not reported Schedule Of I/R: Not reported Schedule Overdue: Not reported Aprvl Sched: Not reported Yr 1 Report: Not reported Yr 2 Report: Not reported Report Overdue: Not reported Ext Aprvl Sched: Not reported License #: Not reported Project Phase: Not reported PT Comments: Not reported EPA Id Number: Not reported GW Class: Not reported SW Class: Not reported AO/C0: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$108304803 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F23

NAME: YANKEE GAS MERIDEN SERVICE CENTER Rev: 02/11/2014

ADDRESS: 56 COOPER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Priority Or Work-Load: Not reported

Status: Not reported Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported
Pt Counter: Not reported
Project Complete: False
Project Inactive: False
Int Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: Not reported
Public Notice: Not reported
RAP Received: Not reported
RAP Approved: Not reported
Compliance Category: Not reported

Delete Record: False

ECAF Reviewed By: Not reported

Not Locatable: False Primary Address: True AKA Site Name: False Primary Site Name: True AKA Site Address: False

Lead: LEP

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002176779 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F24

NAME: YANKEE GAS MERIDEN AREA WORK CENTER Rev: 03/03/2014

ADDRESS: 56 COOPER ST ID/Status: 170-8368 ID/Status: 80-9955

MERIDEN, CT 06451 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 170-8368 Latitude: Not reported Longitude: Not reported

Owner: YANKEE GAS SERVICES COMPANY Owner Address: 599 RESEARCH PKWY

Owner Address 2: Not reported

Owner City, St, Zip: MERIDEN, CT 064508326

Tank ID: 8368-1 Compartment ID: 8368-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 3000 Substance: Gasoline Date Installed: 08/01/1973 Date Last Used: 02/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 8368-2

Compartment ID: 8368-2 Compartment Num: 1 Alt. Tank ID: A2

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 3000 Substance: Gasoline Date Installed: 08/01/1973 Date Last Used: 02/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002176779 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F24

NAME: YANKEE GAS MERIDEN AREA WORK CENTER

Rev: 03/03/2014
ID/Status: 170-8368

COOPER ST ID/Status: 80-9955

MERIDEN, CT 06451 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 8368-3

Compartment ID: 8368-3 Compartment Num: 1 Alt. Tank ID: B1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 08/01/1973 Date Last Used: 04/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 8368-4 Compartment ID: 8368-4 Compartment Num: 1 Alt. Tank ID: B2

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 08/01/1973 Date Last Used: 04/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 9955-1 Compartment ID:

Compartment ID: 9955-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 100 Substance: Used Oil

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002176779 DIST/DIR: 0.143 ESE **ELEVATION:** 143 MAP ID: F24

YANKEE GAS MERIDEN AREA WORK CENTER 03/03/2014 NAME: Rev: ID/Status: 170-8368 ADDRESS: 56 COOPER ST

ID/Status: 80-9955 MERIDEN, CT 06451

ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 01/01/1969 Date Last Used: 01/01/1977

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 9955-2 Compartment ID: 9955-2 Compartment Num: 1 Alt. Tank ID: B2

Tank Status: Permanently Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 3000 Substance: Gasoline Date Installed: 01/01/1973 Date Last Used: 02/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported Spill Installed: Not reported

Overfill Installed: Not reported

Tank ID: 9955-3 Compartment ID: 9955-3 Compartment Num: 1 Alt. Tank ID: B3

Tank Status: Permanently Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 3000 Substance: Gasoline Date Installed: 01/01/1973 Date Last Used: 02/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002176779 DIST/DIR: 0.143 ESE ELEVATION: 143 MAP ID: F24

NAME: YANKEE GAS MERIDEN AREA WORK CENTER

Rev: 03/03/2014

ID/Status: 170-8368

MERIDEN, CT 06451 ID/Status: 80-9955

MERIDEN, CT 06451 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 9955-4

Compartment ID: 9955-4 Compartment Num: 1 Alt. Tank ID: C4

Tank Status: Permanently Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 01/01/1973 Date Last Used: 02/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 9955-5

Compartment ID: 9955-5 Compartment Num: 1 Alt. Tank ID: C5

Tank Status: Permanently Closed

Tank Material: Coated & Cathodically Protected Steel (sti-P3)

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 01/01/1973 Date Last Used: 02/01/1995

Closure Status: Tank Filled with Inert Material Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002029672 DIST/DIR: 0.146 NNE ELEVATION: 128 MAP ID: 25

NAME: KOGUT FLORIST & GARDEN CENTER INC. Rev: 03/03/2014

ADDRESS: 50 YALE AVE ID/Status: 80-7214

MERIDEN, CT 06450 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-7214 Latitude: 41.523517 Longitude: -72.792382 Owner: KOGUT FLORIST Owner Address: 50 YALE AVE Owner Address 2: Not reported

Owner City, St, Zip: MERIDEN, CT 064506709

Tank ID: 7214-1 Compartment ID: 7214-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Not reported

Capacity: 2000 Substance: Diesel Date Installed: 07/01/1987 Date Last Used: Not reported

Closure Status: Tank was Removed From Ground

Pipe Material: Other (Specify)
Pipe Mode Description: Not reported

Spill Installed: None

Overfill Installed: Not reported

Tank ID: 7214-2

Compartment ID: 7214-2 Compartment Num: 1 Alt. Tank ID: B1

Tank Status: Permanently Closed

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 07/01/1987 Date Last Used: 04/12/2010

Closure Status: Tank was Removed From Ground Pipe Material: Rigid Fiberglass Reinforced Plastic

Pipe Mode Description: Not reported

Spill Installed: None

Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002029672 DIST/DIR: 0.146 NNE ELEVATION: 128 MAP ID: 25

NAME: KOGUT FLORIST & GARDEN CENTER INC. Rev: 03/03/2014

ADDRESS: 50 YALE AVE ID/Status: 80-7214

MERIDEN, CT 06450 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 7214-3

Compartment ID: 7214-3 Compartment Num: 1 Alt. Tank ID: F1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 06/01/1978 Date Last Used: 08/01/1987

Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7214-4

Compartment ID: 7214-4 Compartment Num: 1 Alt. Tank ID: GR1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline Date Installed: 09/01/1979 Date Last Used: 08/01/1987

Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7214-5

Compartment ID: 7214-5 Compartment Num: 1 Alt. Tank ID: GU1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 4000 Substance: Gasoline

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002029672 **DIST/DIR:** 0.146 NNE **ELEVATION:** 128 **MAP ID:** 25

NAME: KOGUT FLORIST & GARDEN CENTER INC. Rev: 03/03/2014

ADDRESS: 50 YALE AVE ID/Status: 80-7214

MERIDEN, CT 06450 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 09/01/1982 Date Last Used: 08/01/1987

Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002175283 DIST/DIR: 0.187 NNE ELEVATION: 143 MAP ID: G26

NAME: KWIK MART Rev: 03/03/2014

ADDRESS: 80 COOK AVE

MERIDEN, CT 06451

ID/Status: Permanently Closed ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-7103 Latitude: Not reported Longitude: Not reported Owner: MIC 1 ENT. LLC Owner Address: 80 COOK AVE Owner Address 2: Not reported

Owner City, St, Zip: MERIDEN, CT 064515502

Tank ID: 7103-1 Compartment ID: 7103-1 Compartment Num: 1

Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Not reported

Capacity: 6000 Substance: Gasoline Date Installed: 05/01/1986 Date Last Used: 08/01/1998

Closure Status: Tank was Removed From Ground Pipe Material: Rigid Fiberglass Reinforced Plastic

Pipe Mode Description: Not reported

Spill Installed: Spill Bucket Overfill Installed: Not reported

Tank ID: 7103-2

Compartment ID: 7103-2 Compartment Num: 1 Alt. Tank ID: B2

Tank Status: Permanently Closed

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Not reported

Capacity: 6000 Substance: Gasoline Date Installed: 05/01/1986 Date Last Used: 08/01/1998

Closure Status: Tank was Removed From Ground Pipe Material: Rigid Fiberglass Reinforced Plastic

Pipe Mode Description: Not reported

Spill Installed: Spill Bucket Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002175283 DIST/DIR: 0.187 NNE ELEVATION: 143 MAP ID: G26

NAME: KWIK MART Rev: 03/03/2014

ADDRESS: 80 COOK AVE

MERIDEN, CT 06451

ID/Status: Permanently Closed ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 7103-3

Compartment ID: 7103-3 Compartment Num: 1 Alt. Tank ID: C3

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 6000 Substance: Gasoline Date Installed: 05/01/1986 Date Last Used: 08/01/1998

Closure Status: Tank was Removed From Ground Pipe Material: Rigid Fiberglass Reinforced Plastic

Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 7103-4

Compartment ID: 7103-4
Compartment Num: 1

Alt. Tank ID: T1

Tank Status: Currently In Use

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Double-Walled

Capacity: 6000
Substance: Gasoline
Date Installed: 11/01/1998
Date Last Used: Not reported
Closure Status: Not reported

Pipe Material: Rigid Fiberglass Reinforced Plastic

Pipe Mode Description: Double-Walled

Spill Installed: Spill Bucket Overfill Installed: Ball Float Device

Tank ID: 7103-5

Compartment ID: 7103-5 Compartment Num: 1 Alt. Tank ID: T2

Tank Status: Currently In Use

Tank Material: Fiberglass Reinforced Plastic

Secondary Material: Double-Walled

Capacity: 6000 Substance: Gasoline

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002175283 DIST/DIR: 0.187 NNE **ELEVATION:** MAP ID: G26 143

KWIK MART 03/03/2014 NAME: Rev:

ID/Status: 80-7103 ADDRESS: 80 COOK AVE

ID/Status: Permanently Closed ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 11/01/1998 Date Last Used: Not reported Closure Status: Not reported

Pipe Material: Rigid Fiberglass Reinforced Plastic

Pipe Mode Description: Double-Walled Spill Installed: Spill Bucket

MERIDEN, CT 06451

Overfill Installed: Ball Float Device

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109735597 **DIST/DIR:** 0.187 NNE **ELEVATION:** 143 **MAP ID:** G27

NAME: XTRA MART Rev: 07/30/2013

ADDRESS: 80 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: CTB0047622

Year: 1986

Waste Occurence: 1

UNNA: 1993

Hazard Class: FLAMMABLE

US Dot Description: WASTE FLAMMABLE LIQUID, NOS

No of Containers: 001 Container Type: TT Quantity: 100 Weight/Volume: G Additional Description: Y Handling Code: T50

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTB0047622

Year: 1986 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1986

Manifest ID: CTB0047622 TSDF EPA ID: CTD021816889

TSDF Name: UNITED WASTE OIL CO INC TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06450

TSDF Country: USA

TSDF Telephone: Not reported

Transport Date: 08/09/1986 Transporter EPA ID: CTD981065758

Transporter Name: EVER CLEAR ENVIRONMENTAL SERVICE INC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

S109735597 DIST/DIR: 0.187 NNE EDR ID: **ELEVATION:** 143 MAP ID: G27

NAME: XTRA MART 07/30/2013 Rev:

ADDRESS: 80 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTP000005271 Generator Phone: 2036340461

Generator Mailing Addr: 80 COOK AVE Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: No

Discrepancies: No Date Shipped: 08/09/1986 Date Received: 08/09/1986 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S109735597 DIST/DIR: 0.187 NNE **ELEVATION:** 143 MAP ID: G27

XTRA MART 02/11/2014 NAME: Rev: ID/Status: Cleanup Initiated ADDRESS: 80 COOK AVE

ID/Status: 59707 MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

LUST: LUST Id: 0

UST Facility Id: 7103 LUST Case Id: 59707 Lust Status: Cleanup Initiated

Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 08/24/1998 Entry Date: 01/10/2011 Site Case Id: 0

UST Site Id: 939

Cost Recovery Spill Case #: 0

Old SITS Number: 0 Case Log Id: 0 Monthly Report Id: 0 UST Owner ld: 8285

LUST Owner Id: Not reported

UST Event Id: 0

Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported 2nd Contact EMail: Not reported 2nd Contact Address: Not reported 2nd Contact City, St, Zip: UNKNOWN 2nd Contact Address 2: Not reported 2nd Contact City 2: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109735597 DIST/DIR: 0.187 NNE ELEVATION: 143 MAP ID: G27

NAME: XTRA MART

Rev: 02/11/2014

ID/Status: Cleanup Initiated

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False Responsible EMail: Not reported

Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported

Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 0

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported Drastic: Not reported Geo Setting: Not reported

Ground Water Classification: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109735597 DIST/DIR: 0.187 NNE ELEVATION: 143 MAP ID: G27

NAME: XTRA MART Rev: 02/11/2014
ID/Status: Cleanup Initiated

ADDRESS: 80 COOK AVE ID/Status: Cleanup ini

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported

Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False

Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Stop All NOV Actions: False Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109735597 **DIST/DIR:** 0.187 NNE **ELEVATION:** 143 **MAP ID:** G27

NAME: XTRA MART Rev: 02/11/2014

ADDRESS: 80 COOK AVE ID/Status: Cleanup Initiated

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 0 Lph Wells: 0

User Stamp: allison forrest/ForrestA

Date Stamp: 06/20/2013 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported

Running Comments: UST Enforcement Files and Cleanup Fund Files

Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109736669 **DIST/DIR:** 0.187 NNE **ELEVATION:** 143 **MAP ID:** G28

NAME: KENYON OIL EXTRA MART Rev: 07/30/2013

ADDRESS: 80 COOK ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: CTA0056674

Year: 1987

Waste Occurence: 1

UNNA: 1993

Hazard Class: FLAMMABLE

US Dot Description: WASTE FLAMMABLE LIQUID, NOS

No of Containers: 001 Container Type: TT Quantity: 45 Weight/Volume: G Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTA0056674

Year: 1987

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1987

Manifest ID: CTA0056674 TSDF EPA ID: CTD021816889

TSDF Name: UNITED WASTE OIL CO INC TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06450

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 09/28/1987

Transporter EPA ID: CTD004533063

Transporter Name: KESSLER INSTALLATION CORP

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109736669 **DIST/DIR:** 0.187 NNE **ELEVATION:** 143 **MAP ID:** G28

NAME: KENYON OIL EXTRA MART Rev: 07/30/2013

ADDRESS: 80 COOK ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT

Trans 2 City, St, Zip: C1
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000006679
Generator Phone: 2036340461
Generator Mailing Addr: 80 COOK ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: No

Discrepancies: No
Date Shipped: 09/28/1987
Date Received: 09/28/1987
Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104563192 **DIST/DIR:** 0.195 West **ELEVATION:** 174 **MAP ID:** 29

NAME: ZIMERMAN, JOSEPH M.D. Rev: 02/11/2014

ADDRESS: 319 HANOVER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: Joseph Zimerman, M.D. Buyer Name: Mima Associates Certifying Party: Not reported

Certifying Attention Person: Not reported Title Of Certifying Person: Not reported Certifying Person Address: Not reported Certifying Person City, St, Zip: Not reported

Property Transfer Forms: Form I (DEP-PERD-PTP-201) when no release of hazardous waste has

occurred at the parcel being transferred.

Date Recieved: 01/05/1987 Ackn Date: 01/28/1987 Determination Date: Not reported

LEP Verified/DEP Approval Date: Not reported

Rem Id: 2099

Remediation Location Id: 3493 Date Entered: Not reported

Program: Property Transfer Program

GAO Site: False

Staff Full Name: Not reported
Super/Date: Not reported
Stage Of Project: Not reported
RP Level Of Activity: Not reported
RP Needed Level Of Activity: Not reported
Staff Level Of Activity: Not reported

Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False Staff Prefrence: Not reported Readiness For Transfer: Not reported Project Transfer Time: Not reported Transfer Comments: Not reported

Staff As Of July 2000: Not reported Initial Staff: RAP

Type Of Transfer: Not reported Salutation: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104563192 **DIST/DIR:** 0.195 West **ELEVATION:** 174 **MAP ID:** 29

NAME: ZIMERMAN, JOSEPH M.D. Rev: 02/11/2014

ADDRESS: 319 HANOVER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Relationship To Transfer: Not reported

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: -

Basin: Not reported
1st Payment: Not reported
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
RTN: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported

Monitoringoption: Not reported

Postremedialmonitoring: Not reported Schedule Of I/R: Not reported Schedule Overdue: Not reported Aprvl Sched: Not reported Yr 1 Report: Not reported Yr 2 Report: Not reported Report Overdue: Not reported Ext Aprvl Sched: Not reported Ext Aprvl Sched: Not reported License #: Not reported Project Phase: Not reported PT Comments: Not reported EPA Id Number: Not reported GW Class: Not reported SW Class: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

AO/C0: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported Priority Or Work-Load: Not reported Status: Not reported

Status: Not reported Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported Pt Counter: Not reported Project Complete: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: S104563192 DIST/DIR: 0.195 West 174 **ELEVATION: MAP ID**: 29

NAME: ZIMERMAN, JOSEPH M.D. 02/11/2014 Rev:

ADDRESS: 319 HANOVER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Project Inactive: False Int Deposit #: Not reported Deposit #: Not reported Spill Case #: Not reported Diversion Id: Not reported Public Notice: Not reported RAP Received: Not reported RAP Approved: Not reported Compliance Category: Not reported

Delete Record: False ECAF Reviewed By: Not reported

Not Locatable: False Primary Address: True AKA Site Name: False Primary Site Name: True AKA Site Address: False Lead: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104563192 **DIST/DIR:** 0.195 West **ELEVATION:** 174 **MAP ID:** 29

NAME: ZIMERMAN, JOSEPH M.D. Rev: 04/23/2010

ADDRESS: 319 HANOVER STREET ID/Status: 4467

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4467 Rem Master ID: 4549

PTP Id: 965

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4626 Source of referral: PTP Date Received: 1/5/1987 Staff Assigned: PEASE, R. Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 1/5/1987

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104563192 DIST/DIR: 0.195 West ELEVATION: 174 MAP ID: 29

NAME: ZIMERMAN, JOSEPH M.D. Rev: 04/23/2010

ADDRESS: 319 HANOVER STREET ID/Status: 4467

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LWDS

EDR ID: \$109939016 **DIST/DIR:** 0.196 SE **ELEVATION:** 140 **MAP ID:** 30

NAME: MERIDEN AREA WORK CENTER Rev: 07/17/2009

ADDRESS: COOPER STREET AND MERIDIAN STREET A

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

LWDS:

Leachate and Wastewater Number: 5206017 Status of the Discharge Activity: Inactive Leachate and Waste Flow: Ground

Alias: Northeast Utilities Alias2: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254244 DIST/DIR: 0.197 ESE ELEVATION: 141 MAP ID: 31

NAME: INSILCO FACTORY Rev: 04/23/2010

ADDRESS: COOPER STREET AND CHERRY STREET ID/Status: 1344

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1344
Rem Master ID: 1100
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported Ground Water Quality Classification: GB Surface Water Quality Classification: B Waste Type: CHLR VOC, METALS

Disposal: SPILL/DUMP Sample Data Available: True Updated By: HAMEL, M. Update Program: PTP Updated: 7/27/1992 Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 1270 Source of referral: PTP Date Received: 7/1/1992 Staff Assigned: HAMEL, M. Remediation Program: PTP Date dt assigned: 7/1/1992

Remediation Complete Approved DEP/Verified by LEP: 7/1/1992

Outcome: PTP Remedial Id: 685 PTP Id: 0

Remediation Program: SRP

Remediation Program Entered: 7/24/1992

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254244 DIST/DIR: 0.197 ESE ELEVATION: 141 MAP ID: 31

NAME: INSILCO FACTORY Rev: 04/23/2010

ADDRESS: COOPER STREET AND CHERRY STREET ID/Status: 1344

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: HAMEL, M. Remediation Program: PTP Date dt_assign: 7/1/1992 Project Phase: Not reported Order issued: False

Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: False

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: 137

Order Number: SRD-0081 Date order issued: 5/15/1997 Staff Assigned: HAMEL, M.

Type of Order: O

Order Respondent: BL& A ASSOCIATES, L.P.

Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported

In compliance: False Comments: Not reported

Order Id: 68

Order Number: SRD-0037 Date order issued: 7/24/1992 Staff Assigned: HAMEL, M.

Type of Order: AO

Order Respondent: INSILCO CORP. Admin Appeal Date: 8/25/1992

Date of Admin Appeal Ruling: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254244 DIST/DIR: 0.197 ESE ELEVATION: 141 MAP ID: 31

NAME: INSILCO FACTORY Rev: 04/23/2010

ADDRESS: COOPER STREET AND CHERRY STREET ID/Status: 1344

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported

Penalty assessed: 0

Order Complete: Not reported

In compliance: False

Comments: VETERAN'S MEMORIAL HOSPITAL, MORTGAGE HOLDER, WILL UNDERTAKE

REMEDIATION.(11/94)

SDADB: Waste Id: 5

Waste Type: CHLR VOC

Description: Chlorinated Volatile Organic Compounds

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: 1000495317 **DIST/DIR**: 0.199 NNE **ELEVATION**: 149 **MAP ID**: G32

NAME: FIRESTONE STORE 7056 Rev: 12/31/2012

ADDRESS: 72 COOK AVE MERIDEN, CT 06450

MERIDEN, CT 06450

NEW HAVEN

SOURCE: RI Department of Environmental Management

RI MANIFEST:

GEN Cert Date: 12/12/2007

Transporter Receipt Date: 12/12/2007

Number Of Containers: 1
Container Type: DM
Waste Code1: CR02
Waste Code2: R003
Waste Code3: Not reported
Comment: Not reported
Fee Exempt Code: Not reported
TSDF Name: United Oil Recovery Inc

TSDF ID: RID084802842 TSDF Date: 12/17/2007

Transporter 2 Name: Not reported Transporter 2 ID: Not reported

Manifest Docket Number: 000065678UIS

Waste Description: PETROLEUM DISTILLATES NOS

Quantity: 15 WT/Vol Units: G Item Number: a

Transporter Name: SAFETY-KLEEN SYSTEMS INC

Transporter EPA ID: TXR000050930

GEN Cert Date: 12/12/2007

Transporter Recpt Date: 12/12/2007 Transporter 2 Recpt Date: Not reported

TSDF Recpt Date: 12/17/2007 EPA ID: CTD983894809 Transporter 2 ID: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S104100279 DIST/DIR: 0.199 NNE **ELEVATION:** 149 MAP ID: G33

FIRESTONE INC NAME: Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: MAF240538

Year: 1991

Waste Occurence: 1 UNNA: 9189

Hazard Class: ORM-E

US Dot Description: HAZARDOUS WASTE LIQUID, NOS

No of Containers: 001 Container Type: TT Quantity: 60 Weight/Volume: G Additional Description: Y

Handling Code: T01

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: MAF240538

Year: 1991 Waste Occurence: 1 EPA Waste Code: D008 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1991

Manifest ID: MAF240538 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES INC

TSDF Address: 130 FREIGHT ST

TSDF City, St, Zip: WATERBURY, CT 06702

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 10/23/1991 Transporter EPA ID: ILD051060408

Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

S104100279 DIST/DIR: 0.199 NNE EDR ID: **ELEVATION:** 149 MAP ID: G33

NAME: FIRESTONE INC 07/30/2013 Rev:

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTP000012677 Generator Phone: 2032357921

Generator Mailing Addr: 72 COOK AVE Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Yes

Discrepancies: No Date Shipped: 10/23/1991 Date Received: 10/28/1991 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002027765 DIST/DIR: 0.199 NNE ELEVATION: 149 MAP ID: G34

NAME: FIRESTONE STORE #7056 Rev: 03/03/2014

ADDRESS: 72 COOK AVE ID/Status: 80-3656

MERIDEN, CT 06451 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-3656 Latitude: Not reported Longitude: Not reported

Owner: MODERN HOME CONSTRUCTION Owner Address: 6 SO. GROVE ST. Owner Address 2: Not reported

Owner Address 2: Not reported Owner City,St,Zip: Meriden, CT

Tank ID: 3656-1 Compartment ID: 3656-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 2000 Substance: Heating Oil Date Installed: 01/01/1972 Date Last Used: 09/01/1988

Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 3656-2

Compartment ID: 3656-2 Compartment Num: 1 Alt. Tank ID: B1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 500

Substance: Used Oil Date Installed: 01/01/1972 Date Last Used: 09/01/1988

Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: 003843441fle

Year: 2010 Waste Occurence: 1 UNNA: 3082 Hazard Class: 9

US Dot Description: HAZARDOUS WASTE, LIQUID, N.O.S.

No of Containers: 001 Container Type: DF Quantity: 5 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2011-01-11 00:00:00

DEO Who Last Modified Record: DPW

Manifest No: 003843441fle

Year: 2010

Waste Occurence: 2 UNNA: 0000 Hazard Class: 0

US Dot Description: USED CLEANING COMPOUNDS, N.O.I.B.N.

No of Containers: 001 Container Type: DM Quantity: 15 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2011-01-11 00:00:00

DEO Who Last Modified Record: DPW

Waste CD:

Manifest No: 003843441fle

Year: 2010

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2011-01-11 00:00:00

DEO Who Last Modified Record: DPW

Manifest No: 003843441fle

Year: 2010

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Waste Occurence: 2 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2011-01-11 00:00:00

DEO Who Last Modified Record: DPW

Detail: Year: 2010

Manifest ID: 003843441fle TSDF EPA ID: RID084802842

TSDF Name: SAFETY-KLEEN SYSTEMS, INC.

TSDF Address: 167 MILL STREET TSDF City,St,Zip: CRANSTON, RI 02905

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 10/26/2010

Transporter EPA ID: TXR000050930

Transporter Name: SAFETY-KLEEN SYSTEMS, INC.

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported

EPA ID: CTD983894809 Generator Phone: 2032357921 Generator Mailing Addr: 72 COOK AVE Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06451 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 10/26/2010 Date Received: 10/29/2010 Last modified date: 01/11/2011 Last modified by: DPW Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Waste:

Manifest No: 001269589SKS

Year: 2008 Waste Occurence: 1 UNNA: 1993 Hazard Class: 3

US Dot Description: WASTE COMBUSTIBLE LIQUID, N.O.S.

No of Containers: 001 Container Type: DM Quantity: 15 Weight/Volume: G

Additional Description: Not reported

Handling Code: Not reported

Date Record Was Last Modified: 2008-08-27 00:00:00

DEO Who Last Modified Record: DPW

Waste CD:

Manifest No: 001269589SKS

Year: 2008

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2008-08-27 00:00:00

DEO Who Last Modified Record: DPW

Detail: Year: 2008

Manifest ID: 001269589SKS TSDF EPA ID: RID084802842

TSDF Name: SAFETY-KLEEN SYSTEMS, INC.

TSDF Address: 167 MILL STREET TSDF City,St,Zip: CRANSTON, RI 02905

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 06/23/2008

Transporter EPA ID: TXR000050930

Transporter Name: SAFETY-KLEEN SYSTEMS, INC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE

Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06451 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 06/23/2008 Date Received: 06/30/2008 Last modified date: 09/10/2009

Last modified by: CYF Comments: Not reported

Waste:

Manifest No: CTF0147839

Year: 1993 Waste Occurence: 1 UNNA: 1993

Hazard Class: COMBUSTIBL

US Dot Description: WASTE COMBUSTIBLE LIQUID

No of Containers: 001 Container Type: DM Quantity: 8 Weight/Volume: G Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0147839

Year: 1993 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: True

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 1993

Manifest ID: CTF0147839 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2 112 01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City, St, Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 01/26/1993 Transporter EPA ID: ILD051060408

Transporter Name: SAFETY KLEEN CORP

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported

Trans 2 Address: Not reported
Trans 2 City, St, Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: Yes Discrepancies: No Date Shipped: 01/26/1993 Date Received: 01/26/1993 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0140490

Year: 1992

Waste Occurence: 1

UNNA: 1993

Hazard Class: COMBUSTIBL

US Dot Description: WASTE COMBUSTIBLE LIQUID

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 001 Container Type: DM Quantity: 45 Weight/Volume: P Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0140490

Year: 1992 Waste Occuren

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: True

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1992

Manifest ID: CTF0140490 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2-112-01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City,St,Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported
Transport Date: 12/30/1992
Transporter EPA ID: ILD051060408
Transporter Name: SAFETY-KLEEN CORP

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809

Generator Phone: 2032357921 Generator Mailing Addr: 72 COOK AVE Generator Mailing Town: MERIDEN

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733685 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G35

NAME: FIRESTONE 00582 **Rev:** 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Yes

Discrepancies: No
Date Shipped: 12/30/1992
Date Received: 12/30/1992
Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733686 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G36

NAME: FIRESTONE STORE 7056 Rev: 07/30/2013

ADDRESS: 72 COOK AVE MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: CTF0755874

Year: 1999 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: petroleum distillates nos

No of Containers: 001 Container Type: DM Quantity: 13 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0755874

Year: 1999 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: True

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1999

Manifest ID: CTF0755874 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 02/06/1999

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC/UIS DBA ADVANCED LIQ REC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733686 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G36

NAME: FIRESTONE STORE 7056 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921

Generator Mailing Addr: 72 COOK AVE Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA

Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No Date Shipped: 02/06/1999 Date Received: 02/08/1999 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0696535

Year: 1998 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: petroleum distillates nos

No of Containers: 001 Container Type: DM Quantity: 8 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0696535

Year: 1998

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: True

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109733686 DIST/DIR: 0.199 NNE **ELEVATION:** 149 MAP ID: G36

NAME: FIRESTONE STORE 7056 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 1998

Manifest ID: CTF0696535 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City, St, Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 05/16/1998 Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY DBA ADVANCED LIQ REC

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD983894809 Generator Phone: 2032357921 Generator Mailing Addr: 72 COOK AVE Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: No

Date Shipped: 05/16/1998 Date Received: 05/21/1998 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0676134

Year: 1997

Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: petroleum distillates nos

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733686 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G36

NAME: FIRESTONE STORE 7056 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 001 Container Type: DM Quantity: 8

Quantity: 8
Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0676134

Year: 1997

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1997

Manifest ID: CTF0676134 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 09/11/1997

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY DBA ADV LIQ REC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA

Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109733686 **DIST/DIR:** 0.199 NNE **ELEVATION:** 149 **MAP ID:** G36

NAME: FIRESTONE STORE 7056 Rev: 07/30/2013

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 09/11/1997 Date Received: 09/12/1997 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0385368

Year: 1996 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: petroleum distillates nos

No of Containers: 001 Container Type: DM Quantity: 14 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0385368

Year: 1996 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1996

Manifest ID: CTF0385368 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06451

JOB: **Target Property:** 1 KING PLACE NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109733686 DIST/DIR: 0.199 NNE **ELEVATION:** 149 MAP ID: G36

FIRESTONE STORE 7056 07/30/2013 NAME: Rev:

ADDRESS: 72 COOK AVE

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 10/10/1996

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC DBA ADV LIQ REC

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD983894809 Generator Phone: 2032357921

Generator Mailing Addr: 72 COOK AVE Generator Mailing Town: MERIDEN

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 10/10/1996 Date Received: 10/10/1996 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109755401 **DIST/DIR:** 0.229 South **ELEVATION:** 123 **MAP ID:** H37

NAME: CT STATE OF DOT Rev: 07/30/2013

ADDRESS: 270-74 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported

UNNA: Not reported
Hazard Class: Not reported
US Dot Description: Not reported
No of Containers: Not reported
Container Type: Not reported
Quantity: Not reported
Weight/Volume: Not reported
Additional Description: Not reported
Handling Code: Not reported

Date Record Was Last Modified: Not reported DEO Who Last Modified Record: Not reported

Waste CD:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported EPA Waste Code: Not reported Recycled Waste?: Not reported

Date Record Was Last Modified: Not reported DEO Who Last Modified Record: Not reported

Detail: Year: 2007

Manifest ID: 002908913JJK TSDF EPA ID: RID040098352

TSDF Name: NORTHLAND ENVIRONMENTAL INC

TSDF Address: 275 ALLENS AVE

TSDF City, St, Zip: PROVIDENCE, RI 02905

TSDF Country: USA

TSDF Telephone: 4017816340 Transport Date: 12/30/2007

Transporter EPA ID: CTD018811802

Transporter Name: ENVIRONMENTAL SERVICES INC

Transporter Country: USA Transporter Phone: (860)528-9500

Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109755401 **DIST/DIR:** 0.229 South **ELEVATION:** 123 **MAP ID:** H37

NAME: CT STATE OF DOT Rev: 07/30/2013

ADDRESS: 270-74 COOK AVE

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTP000030177

Generator Phone: (860)298-6256

Generator Mailing Addr: 2800 BERLIN TPK Generator Mailing Town: NEWINGTON Generator Mailing State: CT

Generator Mailing State: CT Generator Mailing Zip: 06111-Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 12/30/2007 Date Received: 12/04/2007 Last modified date: 12/24/2008

Last modified by: CYF Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In

1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site

is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 17325

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: Not reported Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Supplemental Assessment

Accomplishment count: 0

Cooperative agreement #: 97114801

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE **ELEVATION: MAP ID:** 138 141

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Surface water cleaned: Not reported

Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.75

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment
Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook. Approximately half the site is located within the 100-year flood

plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161 Start date: Not reported Completed date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 52125

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: Not reported Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase II Environmental Assessment

Accomplishment count: 0

Cooperative agreement #: 97114801 Ownership entity: Government Current owner: City of Meriden Did owner change: N

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported Lead contaminant found: Y Lead cleaned up: Not reported No media affected: Not reported Unknown media affected: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE **ELEVATION: MAP ID:** 138 141

FACTORY H - 104 BUTLER STREET NAME: Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.75 Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Cleanup

Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in

operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site,

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161 Start date: 01-DEC-08 Completed date: Not reported Acres cleaned up: .1

Cleanup funding: 10300

Cleanup funding source: US EPA - Brownfields Cleanup Cooperative Agreement

Assessment funding: Not reported
Assessment funding source: Not reported
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: Not reported
Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Not reported

Accomplishment count: 0

Cooperative agreement #: 97182301 Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.75

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In

1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site

is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 21250

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Supplemental Assessment

Accomplishment count: 0

Cooperative agreement #: 97182101

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported

Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE **ELEVATION: MAP ID:** 138 141

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Surface water cleaned: Not reported

Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.75

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment
Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook. Approximately half the site is located within the 100-year flood

plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161 Start date: Not reported Completed date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 2200

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97114801 Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported Lead contaminant found: Y Lead cleaned up: Not reported No media affected: Not reported Unknown media affected: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE **ELEVATION: MAP ID:** 138 141

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: 0 Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported Past use industrial acreage: 3.75

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)

Grant type: TBA

Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in

operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site,

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 35000

Assessment funding source: US EPA - TBA Funding

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase II Environmental Assessment

Accomplishment count: 0
Cooperative agreement #: n/a
Ownership entity: Government
Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported Surface water cleaned: Not reported Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.75

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)

Grant type: TBA

Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook. Approximately half the site is located within the 100-year flood

plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance

piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the

property.

Latitude: 41.5365767 Longitude: -72.8060524 HCM label: Unknown Map scale: Not reported Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 5000

Assessment funding source: US EPA - TBA Funding

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 0
Cooperative agreement #: n/a

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1011997022 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 138

NAME: FACTORY H - 104 BUTLER STREET Rev: 03/20/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Ownership entity: Government Current owner: City of Meriden

Did owner change: N Cleanup required: Yes Video available: No Photo available: Yes

Institutional controls required: Y IC Category proprietary controls: Y

IC cat. info. devices: Y IC cat. gov. controls: Y

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: No

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Y

Asbestos found: Y Asbestos cleaned: Y

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported

Groundwater affected: Y

Groundwater cleaned: Not reported

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

Other cleaned up: Not reported

Other metals found: Y

Other metals cleaned: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Y

PAHs cleaned up: Not reported PCBs found: Not reported PCBs cleaned up: Not reported Petro products found: Y

Petro products cleaned: Not reported Sediments found: Not reported Sediments cleaned: Not reported

Soil affected: Y

Soil cleaned up: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

1011997022 EDR ID: DIST/DIR: 0.231 NE **ELEVATION:** 141 **MAP ID:** 138

NAME: FACTORY H - 104 BUTLER STREET 03/20/2014 Rev:

ADDRESS: 104 BUTLER STREET

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Surface water cleaned: Not reported

Unknown found: Not reported

VOCs found: Y

VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: Not reported

Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: S111382847 DIST/DIR: 0.231 NE **ELEVATION:** 141 **MAP ID:** 139

INTERNATIONAL SILVER COMPANY, FACTORY H NAME: Rev: 02/11/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

VCP:

Transferor (seller): n/a Transfee (buyer): n/a

Certifying Party: City of Meriden

Certifying Party Attn: Lawrence J. Kendzior Certifying Party Title: City Manager

Certifying Party Address: 142 East Main Street Certifying Party City, St, Zip: Meriden, CT 06450

Voluntary Remediation Site: Yes Date Received: 10/27/2011 Acknowledge Date: 12/20/2011 Determination Date: 12/20/2011 LEP Verified/DEP: Not reported

Rem Id: 10705

Remediation Location Id: 8778 Date Entered: 11/02/2011 Program: Vol_Rem_X GAŎ Site: False

Staff Full Name: Jing Chen

Super/Date: 12/21/2011 Stage Of Project: Not reported RP Level Of Activity: Not reported RP Needed Level Of Activity: Not reported

Staff Level Of Activity: Not reported Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported PRP Cooperation: Not reported

Enforcement Status: Not reported Level Of Complexity: Not reported Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False Staff Prefrence: Not reported

Readiness For Transfer: Not reported Project Transfer Time: Not reported Transfer Comments: Not reported Staff As Of July 2000: Not reported

Initial Staff: Not reported Type Of Transfer: Not reported Salutation: Mr. Kendzior

Relationship To Transfer: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: \$111382847 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 139

NAME: INTERNATIONAL SILVER COMPANY, FACTORY H Rev: 02/11/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: GB

Basin: Not reported 1st Payment: 0

Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
Rtn: Not reported
Revised: Not reported
FCAF Received: Not reporte

Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported

Ext Aprvl Sched: Not reported License #: Not reported Project Phase: Not reported

PT Comments: one of parcels for the site, include REM10704

EPA Id Number: Not reported GW Class: Not reported SW Class: Not reported AO/C0: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported Priority Or Work-Load: Not reported

Status: Not reported Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported

Pt Counter: 0

Project Complete: False Project Inactive: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

VCP

EDR ID: \$111382847 DIST/DIR: 0.231 NE ELEVATION: 141 MAP ID: 139

NAME: INTERNATIONAL SILVER COMPANY, FACTORY H Rev: 02/11/2014

ADDRESS: 104 BUTLER STREET

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Intl Deposit #: Not reported Deposit #: Not reported Spill Case #: Not reported

Diversion Id: 0

Public Notice: Not reported
Rap Received: Not reported
Rap Approved: Not reported
Compliance Category: Not reported

Delete Record: False

ECAF Reviewed By: Jing Chen

Notlocatable: False Primaryaddress: False Aka_sitename: False Primarysitename: False Aka_siteaddress: False

Lead: LEP

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

NY MANIFEST:

EPA ID: CTP000031707

Country: USA

Mailing Name: CITY OF MERIDEN Mailing Contact: ROBERT BASS Mailing Address: 77 COOPER ST Mailing Address 2: Not reported Mailing City: MERIDEN

Mailing State: CT
Mailing Zip: 06450
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 203-630-4018

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 2012-06-26
Trans1 Recv Date: 2012-06-26
Trans2 Recv Date: Not reported
TSD Site Recv Date: Not reported
TSD Site Recv Date: Not reported
Part B Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 10015.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0 Container Type: DT - Dump trucks Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001669501GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J40

CITY OF MERIDEN 12/31/2013 NAME: Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: PAD987347515 Trans2 State ID: Not reported Generator Ship Date: 2012-06-26 Trans1 Recv Date: 2012-06-26 Trans2 Recv Date: Not reported TSD Site Recy Date: 2012-06-27 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: CTP000031707 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 20321.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0 Container Type: DT - Dump trucks Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001669503GBF

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 2012-06-25
Trans1 Recv Date: 2012-06-25
Trans2 Recv Date: Not reported
TSD Site Recv Date: Not reported
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 21945.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0 Container Type: DT - Dump trucks Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001669505GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not rer

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-20
Trans1 Recv Date: 2012-04-20
Trans2 Recv Date: 2012-04-20
TSD Site Recv Date: 2012-04-23
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$112139174 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 19187.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699570JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not repo

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-20
Trans1 Recv Date: 2012-04-20
Trans2 Recv Date: 2012-04-20
TSD Site Recv Date: 2012-04-23
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679

Quantity: 19822.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Waste Code: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699571JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported

Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-20
Trans1 Recv Date: 2012-04-20
Trans2 Recv Date: 2012-04-26
TSD Site Recv Date: 2012-04-27
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 19260.0 Units: P - Pounds Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699572JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J40

12/31/2013 CITY OF MERIDEN NAME: Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CTR000506410 Trans2 State ID: CTR000506410 Generator Ship Date: 2012-04-20 Trans1 Recv Date: 2012-04-20 Trans2 Recv Date: 2012-04-26 TSD Site Recy Date: 2012-04-27 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: CTP000031707 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 20276.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill. Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699573JJK

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-20
Trans1 Recv Date: 2012-04-27
TSD Site Recv Date: 2012-04-30
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 19042.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699574JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported

Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-20
Trans1 Recv Date: 2012-04-20
Trans2 Recv Date: 2012-04-27
TSD Site Recv Date: 2012-04-30
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$112139174 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 16611.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699575JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not rep

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-30
Trans1 Recv Date: 2012-04-30
Trans2 Recv Date: 2012-04-30
TSD Site Recv Date: 2012-05-01
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679

Quantity: 17000.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Waste Code: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699576JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported

Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-04-20
Trans1 Recv Date: 2012-04-30
Trans2 Recv Date: 2012-04-30
TSD Site Recv Date: 2012-05-01
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 17890.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699577JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J40

12/31/2013 CITY OF MERIDEN NAME: Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CTR000506410 Trans2 State ID: CTR000506410 Generator Ship Date: 2012-05-03 Trans1 Recv Date: 2012-05-03 Trans2 Recv Date: 2012-05-03 TSD Site Recy Date: 2012-05-04 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: CTP000031707 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 19768.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill. Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699578JJK

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$112139174 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-05-08
Trans1 Recv Date: 2012-05-08
Trans2 Recv Date: 2012-05-08
TSD Site Recv Date: 2012-05-09
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 20085.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699579JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Magnifect Ref Number 1985

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: Not reported
Generator Ship Date: 2012-05-08
Trans1 Recv Date: 2012-05-08
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2012-05-09
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J40

CITY OF MERIDEN 12/31/2013 NAME: Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 19305.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699580JJK

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N Manifest Ref Num: Not reported

Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CTR000506410 Trans2 State ID: CTR000506410 Generator Ship Date: 2012-06-03 Trans1 Recv Date: 2012-06-06 Trans2 Recy Date: 2012-06-06 TSD Site Recv Date: 2012-06-07 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: CTP000031707 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679

Quantity: 17182.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Waste Code: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699581JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported

Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-05-09
Trans1 Recv Date: 2012-05-09
Trans2 Recv Date: 2012-05-09
TSD Site Recv Date: 2012-05-10
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 18026.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699582JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J40

12/31/2013 CITY OF MERIDEN NAME: Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CTR000506410 Trans2 State ID: CTR000506410 Generator Ship Date: 2012-05-09 Trans1 Recv Date: 2012-05-09 Trans2 Recv Date: 2012-05-09 TSD Site Recy Date: 2012-05-10 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: CTP000031707 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 18988.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill. Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699583JJK

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J40

NAME: CITY OF MERIDEN Rev: 12/31/2013

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 State ID: CTR000506410
Trans2 State ID: CTR000506410
Generator Ship Date: 2012-05-11
Trans1 Recv Date: 2012-05-11
Trans2 Recv Date: 2012-05-12
TSD Site Recv Date: 2012-05-14
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported

Quantity: 16012.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699584JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: Y
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Monifort Ref Num: Net ron

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTR000506410
Trans2 State ID: Not reported
Generator Ship Date: 2012-06-01
Trans1 Recv Date: 2012-06-01
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2012-06-04
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTP000031707

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S112139174 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J40

12/31/2013 CITY OF MERIDEN NAME: Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 14624.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Specific Gravity: 1.0

Year: 2012

Manifest Tracking Num: 001699586JJK

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H132

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CTR000506410 Trans2 State ID: Not reported Generator Ship Date: 2012-06-01 Trans1 Recv Date: 2012-06-01 Trans2 Recv Date: Not reported TSD Site Recv Date: 2012-06-04 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: CTP000031707 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 17309.0

Units: K - Kilograms (2.2 pounds) Number of Containers: 1.0

Container Type: CM - Metal boxes, cases, roll-offs

Handling Method: L Landfill.

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

DIST/DIR: 0.232 ESE EDR ID: S112139174 **ELEVATION:** 148 MAP ID: J40

NAME: CITY OF MERIDEN 12/31/2013 Rev:

ADDRESS: 77 COOPER ST

MERIDEN, CT 06450

SOURCE: NY Department of Environmental Conservation

Specific Gravity: 1.0 Year: 2012

Manifest Tracking Num: 001699587JJK

Import Ind: N Export Ind: N Discr Quantity Ind: Y Discr Type Ind: N Discr Residue Ind: N Discr Partial Reject Ind: N Discr Full Reject Ind: N Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Mgmt Method Type Code: H132

Click this hyperlink while viewing on your computer to access 38 additional NY_MANIFEST: record(s) in the EDR Site Report.

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109749578 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J41

NAME: INTERNATIONAL SILVER Rev: 07/30/2013

ADDRESS: 55 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: MAK734354

Year: 1998 Waste Occurence: 1

UNNA: 3077 Hazard Class: 9

US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES, SOLID

No of Containers: 008 Container Type: DM Quantity: 4000 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: MAK734354

Year: 1998 Waste Occurence: 1 EPA Waste Code: D007 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1998

Manifest ID: MAK734354 TSDF EPA ID: MAD019371079

TSDF Name: GENERAL CHEMICAL CORP

TSDF Address: 133 LELAND ST

TSDF City, St, Zip: FRAMINGHAM, MA 01701

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 11/24/1998

Transporter EPA ID: MAD019371079

Transporter Name: GENERAL CHEMICAL CORP

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

S109749578 EDR ID: DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J41

NAME: INTERNATIONAL SILVER 07/30/2013 Rev:

ADDRESS: 55 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTP000021971 Generator Phone: Not reported

Generator Mailing Addr: 55 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No Date Shipped: 11/24/1998 Date Received: 12/07/1998 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730655 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J42

NAME: MERIDEN AREA WORK CENTER (C L&P) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported

UNNA: Not reported
Hazard Class: Not reported
US Dot Description: Not reported
No of Containers: Not reported
Container Type: Not reported
Quantity: Not reported
Weight/Volume: Not reported
Additional Description: Not reported

Handling Code: Not reported
Date Record Was Last Modified: Not reported
DEO Who Last Modified Record: Not reported

Waste CD:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported EPA Waste Code: Not reported Recycled Waste?: Not reported

Date Record Was Last Modified: Not reported DEO Who Last Modified Record: Not reported

Detail: Year: 2008

Manifest ID: 001849502FLE TSDF EPA ID: NCD000648451

TSDF Name: CLEAN HARBORS REIDSVILLE LLC TSDF Address: 208 WATLINGTON INDUSTRIAL DR

TSDF City, St, Zip: REIDSVILLE, NC 27320-

TSDF Country: USA

TSDF Telephone: (336)342-6160 Transport Date: 02/28/2008

Transporter EPA ID: MAD039322250

Transporter Name: CLEAN HARBORS ENVIRONMENTAL SERVICES, INC.

Transporter Country: USA

Transporter Phone: (781)792-5764 Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730655 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J42

NAME: MERIDEN AREA WORK CENTER (C L&P) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 8602714749

Generator Mailing Addr: 599 PO BOX 270 Generator Mailing Town: HARTFORD

Generator Mailing State: CT Generator Mailing Zip: 061410270 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 02/28/2008 Date Received: Not reported Last modified date: 07/12/2010

Last modified by: PG Comments: Not reported

Waste:

Manifest No: CTC0302363

Year: 1990 Waste Occurence: 1 UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETROLEUM NAPHTHA LIQUID

No of Containers: 001 Container Type: DM Quantity: 86 Weight/Volume: O Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTC0302363

Year: 1990

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: True

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730655 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J42

NAME: MERIDEN AREA WORK CENTER (C L&P) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 1990

Manifest ID: CTC0302363 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2-112-01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City,St,Zip: BRANFORD, CT 06405

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 03/23/1990

Transporter EPA ID: ILD051060408

Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City, St, Zip: CT
Trans 2 Country: USA
Trans 3 Phone: Not reported

Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: Yes Discrepancies: No Date Shipped: 03/23/1990 Date Received: 03/23/1990 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTC0228084

Year: 1989

Waste Occurence: 1

UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETROLEUM NAPHTHA LIQUID

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730655 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J42

MERIDEN AREA WORK CENTER (C L&P) NAME: Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 002 Container Type: DM Quantity: 90 Weight/Volume: P Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTC0228084

Year: 1989 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1989

Manifest ID: CTC0228084 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2-112-01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City, St, Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 03/09/1989 Transporter EPA ID: ILD051060408

Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180

Generator Phone: 2035342403 Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730655 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J42

NAME: MERIDEN AREA WORK CENTER (C L&P) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: Yes Discrepancies: No Date Shipped: 03/09/1989 Date Received: 03/09/1989 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTB0099576

Year: 1987 Waste Occurence: 1 UNNA: 1225

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETROLEUM NAPHTHA LIQUID

No of Containers: 002 Container Type: DM Quantity: 180 Weight/Volume: P Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTB0099576

Year: 1987 Waste Occurence: 1

EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1987

Manifest ID: CTB0099576 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2-112-01

TSDF Address: 11 TIPPING DR

TSDF City, St, Zip: LOT #4 BRANFORD, CT 06405

JOB: Target Property: 1 KING PLACE NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730655 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J42

MERIDEN AREA WORK CENTER (C L&P) 07/30/2013 NAME: Rev:

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 11/05/1987

Transporter EPA ID: CTD980667927

Transporter Name: SAFETY KLEEN CORP 2-112-01

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: Not reported

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: No Discrepancies: No Date Shipped: 11/05/1987 Date Received: 11/05/1987 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730654 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J43

NAME: MERIDEN AREA WORK CENTER (C L & P) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: CTC0164356

Year: 1988 Waste Occurence: 1

UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETROLEUM NAPHTHA LIQUID

No of Containers: 001 Container Type: DM Quantity: 27 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTC0164356

Year: 1988 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1988

Manifest ID: CTC0164356 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY-KLEEN CORP 2-112-01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City,St,Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 08/12/1988 Transporter EPA ID: ILD051060408

Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730654 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J43

NAME: MERIDEN AREA WORK CENTER (C L & P) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 0000000000

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: No

Special Handling: No Discrepancies: No Date Shipped: 08/12/1988 Date Received: 08/12/1988 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported

UNNA: Not reported
Hazard Class: Not reported
US Dot Description: Not reported
No of Containers: Not reported
Container Type: Not reported
Quantity: Not reported
Weight/Volume: Not reported
Additional Description: Not reported
Handling Code: Not reported

Date Record Was Last Modified: Not reported DEO Who Last Modified Record: Not reported

Waste CD:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported EPA Waste Code: Not reported Recycled Waste?: Not reported

Date Record Was Last Modified: Not reported DEO Who Last Modified Record: Not reported

Detail: Year: 2009

Manifest ID: 001649385SKS TSDF EPA ID: RID084802842

TSDF Name: SAFETY-KLEEN SYSTEMS, INC.

TSDF Address: 167 MILL STREET TSDF City,St,Zip: CRANSTON, RI 02905

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 01/23/2009

Transporter EPA ID: TXR000050930

Transporter Name: SAFETY-KLEEN SYSTEMS, INC.

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2033174437

Generator Mailing Addr: 56 COOPER STREET GARAGE

Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06451 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 01/23/2009 Date Received: 01/29/2009 Last modified date: 04/27/2009 Last modified by: DPW Comments: Not reported

Waste:

Manifest No: ctf1169860

Year: 2004 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: PETROLEUM DISTILLATES, N.O.S. OR PETROLEUM PRODUCTS, N.O.S.

No of Containers: 2 Container Type: DM Quantity: 35 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2005-05-11 00:00:00

DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: ctf1169860

Year: 2004

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2005-05-11 00:00:00

DEO Who Last Modified Record: JEB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 2004

Manifest ID: ctf1169860 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC TSDF Address: 14 WEST MAIN ST TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: (203)238-6745 Transport Date: 10/06/2004 Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA
Transporter Phone: (203)238-6745
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City St Zio: CT

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 2036342403

Generator Mailing Addr: 599 RESEARCH PKY

Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 10/06/2004 Date Received: 10/06/2004 Last modified date: 06/30/2005 Last modified by: JEB Comments: Not reported

Waste:

Manifest No: Not reported Year: Not reported

Waste Occurence: Not reported

UNNA: Not reported Hazard Class: Not reported US Dot Description: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: Not reported Container Type: Not reported Quantity: Not reported Weight/Volume: Not reported Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: Not reported DEO Who Last Modified Record: Not reported

Waste CD:

Manifest No: CTF1138176

Year: 2003

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: True

Date Record Was Last Modified: 2004-05-26 00:00:00

DEO Who Last Modified Record: IG

Detail:

Year: 2003

Manifest ID: CTF1138176 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06450

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 08/06/2003

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA

Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No Date Shipped: 08/06/2003 Date Received: 08/06/2003 Last modified date: 05/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF1105823

Year: 2002 Waste Occurence: 1 UNNA: 2924 Hazard Class: 3

US Dot Description: FLAMMABLE LIQUID CORROSIVE N.O.S.

No of Containers: 001 Container Type: DF Quantity: 10 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF1105823

Year: 2002

Waste Occurence: 2 UNNA: 2809 Hazard Class: 8

US Dot Description: mercury No of Containers: 001 Container Type: DF Quantity: 5 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF1105823

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730657 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J44

YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) NAME: Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Year: 2002

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF1105823

Year: 2002

Waste Occurence: 2 EPA Waste Code: D009 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 2002

Manifest ID: CTF1105823 TSDF EPA ID: RID040098352

TSDF Name: NORTHLAND ENV INC (STABLEX RI)

TSDF Address: 252 - 275 ALLENS AVE TSDF City, St, Zip: PROVIDENCE, RI 02905

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 12/04/2002

Transporter EPA ID: MAR000504928

Transporter Name: FLEET ENVIRONMENTAL SVCSLLC

Transporter Country: USA
Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180

Generator Phone: 2035342403

Special Handling: Not reported

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Discrepancies: No Date Shipped: 12/04/2002 Date Received: 12/06/2002 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF1016111

Year: 2001

Waste Occurence: 1 UNNA: 1993 Hazard Class: 3

US Dot Description: FLAMMABLE LIQUID N.O.S.

No of Containers: 001 Container Type: DM Quantity: 150 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF1016111

Year: 2001 Waste Occurence: 2 UNNA: 3264 Hazard Class: 8

US Dot Description: corrosive liquid acidic, inorganic nos

No of Containers: 001 Container Type: DF Quantity: 50 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF1016111

Year: 2001

Waste Occurence: 3 UNNA: 1950 Hazard Class: 2.1

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

US Dot Description: aerosols No of Containers: 001 Container Type: DM Quantity: 100 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF1016111

Year: 2001

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF1016111

Year: 2001

Waste Occurence: 2 EPA Waste Code: D002 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF1016111

Year: 2001

Waste Occurence: 3 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 2001

Manifest ID: CTF1016111 TSDF EPA ID: RID040098352

TSDF Name: NORTHLAND ENVIRON INC (STABLEX RI)

TSDF Address: 252 - 275 ALLENS AVE TSDF City, St, Zip: PROVIDENCE, RI 02905

TSDF Country: USA

TSDF Telephone: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Transport Date: 11/30/2001

Transporter EPA ID: CTR000500421

Transporter Name: D-TOX
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City, St, Zip: CT

Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No
Date Shipped: 11/30/2001
Date Received: 01/02/2002
Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0905495

Year: 2000

Waste Occurence: 1 UNNA: 1993 Hazard Class: 3

US Dot Description: FLAMMABLE LIQUID N.O.S.

No of Containers: 002 Container Type: DM Quantity: 110 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Waste CD:

Manifest No: CTF0905495

Year: 2000

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 2000

Manifest ID: CTF0905495 TSDF EPA ID: RID040098352

TSDF Name: NORTHLAND ENVIRONMENTAL (STABLEX)

TSDF Address: 252 - 275 ALLENS AVE TSDF City,St,Zip: PROVIDENCE, RI 02905

TSDF Country: USA

TSDF Telephone: Not reported
Transport Date: 01/17/2000
Transporter EPA ID: CT5000001685
Transporter Name: D TOX INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT

Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450

Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No
Date Shipped: 01/17/2000
Date Received: 02/09/2000
Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Waste:

Manifest No: CTF0745814

Year: 1999 Waste Occurence: 1 UNNA: 3082 Hazard Class: 9

US Dot Description: env. Hazardous substance liquid nos

No of Containers: 001 Container Type: DM Quantity: 55 Weight/Volume: G

Additional Description: Not reported

Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0745814

Year: 1999

Waste Occurence: 1 EPA Waste Code: D006 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1999

Manifest ID: CTF0745814 TSDF EPA ID: MAD019371079

TSDF Name: GENERAL CHEMICAL CORP

TSDF Address: 133 LELAND ST

TSDF City, St, Zip: FRAMINGHAM, MA 01701

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 04/19/1999 Transporter EPA ID: CT5000001685

Transporter Name: D TOX INC Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730657 DIST/DIR: 0.232 ESE **ELEVATION:** MAP ID: J44 148

YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) NAME: Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: No Date Shipped: 04/16/1999 Date Received: 04/20/1999 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0489762

Year: 1996 Waste Occurence: 1 UNNA: 3082 Hazard Class: 9

US Dot Description: env. Hazardous substance liquid nos

No of Containers: 001 Container Type: TT Quantity: 1500 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0489762

Year: 1996 Waste Occurence: 1 EPA Waste Code: D018 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 1996

Manifest ID: CTF0489762 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY DBA ADV LIQ REC

TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 04/18/1996

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC DBA ADV LIQ REC

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 04/18/1996 Date Received: Not reported Last modified date: 04/26/2004

Last modified by: IG
Comments: Not reported

Waste:

Manifest No: CTF0102767

Year: 1994

Waste Occurence: 1

UNNA: 1993

Hazard Class: COMBUSTIBL

US Dot Description: WASTE COMBUSTIBLE LIQUID

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 002 Container Type: DM Quantity: 30 Weight/Volume: G Additional Description: Y Handling Code: S02

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0102767

Year: 1994

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-26 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1994

Manifest ID: CTF0102767 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2 112 01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City,St,Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 11/04/1994 Transporter EPA ID: ILD984908202 Transporter Name: SAFETY KLEEN CORP

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180

Generator Phone: 2035342403 Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: Yes Discrepancies: No Date Shipped: 11/04/1994 Date Received: 11/04/1994 Last modified date: 04/26/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0303136

Year: 1993 Waste Occurence: 1 UNNA: 1263

Hazard Class: FLAMMABLE

US Dot Description: WASTE PAINT RELATED MATERIAL

No of Containers: 001 Container Type: DM Quantity: 607 Weight/Volume: P Additional Description: Y Handling Code: T50

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0303136

Year: 1993 Waste Occurence: 1 EPA Waste Code: F003 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1993

Manifest ID: CTF0303136 TSDF EPA ID: CTD001156009 TSDF Name: SAFETY KLEEN CORP TSDF Address: 785 NORWICH AVE TSDF City, St, Zip: PLAINFIELD, CT 06374

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730657 DIST/DIR: 0.232 ESE **ELEVATION:** 148 MAP ID: J44

YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) NAME: Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 09/30/1993 Transporter EPA ID: ILD984908202

Transporter Name: SAFETY KLEEN CORP

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT

Generator Mailing Zip: 06450 Generator Mailing Country: USA Special Handling: Yes

Discrepancies: Yes
Date Shipped: 09/30/1993 Date Received: 09/30/1993 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Waste:

Manifest No: CTF0088624

Year: 1991

Waste Occurence: 1

UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETRO NAPHTHA LIQ

No of Containers: 003 Container Type: DM Quantity: 258 Weight/Volume: P Additional Description: N Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

DEO Who Last Modified Record: IG

Manifest No: CTF0088624

Year: 1991 Waste Occurence: 2

UNNA: 1255

Hazard Class: COMBUSTIBL

US Dot Description: WASTE PETRO NAPHTHA LIQ

No of Containers: 001 Container Type: DF Quantity: 27 Weight/Volume: P Additional Description: N

Handling Code: S02

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0088624

Year: 1991 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Manifest No: CTF0088624

Year: 1991

Waste Occurence: 2 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG

Detail: Year: 1991

Manifest ID: CTF0088624 TSDF EPA ID: CTD980667927

TSDF Name: SAFETY KLEEN CORP 2-112-01 TSDF Address: 11 TIPPING DR LOT #4 TSDF City,St,Zip: BRANFORD, CT 06405

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 10/08/1991

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730657 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J44

NAME: YANKEE GAS (C L & P MERIDEN AREA WORK CENTER) Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Transporter EPA ID: ILD051060408

Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 Address: Not reported

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD981205180
Generator Phone: 2035342403

Generator Mailing Addr: 56 COOPER ST Generator Mailing Town: MERIDEN Generator Mailing State: CT Generator Mailing Zip: 06450 Generator Mailing Country: USA

Special Handling: No Discrepancies: No

Date Shipped: 10/08/1991 Date Received: 10/08/1991 Last modified date: 04/27/2004

Last modified by: IG Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: 000525330FLE

Year: 2007 Waste Occurence: 1 UNNA: 1950 Hazard Class: 2.1

US Dot Description: AEROSOLS, FLAMMABLE

No of Containers: 2 Container Type: DM Quantity: 300 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2008-12-12 00:00:00

DEO Who Last Modified Record: CYF

Waste CD:

Manifest No: 000525330FLE

Year: 2007 Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2008-12-12 00:00:00

DEO Who Last Modified Record: CYF

Manifest No: 000525330FLE

Year: 2007

Waste Occurence: 1 EPA Waste Code: D003 Recycled Waste?: False

Date Record Was Last Modified: 2008-12-12 00:00:00

DEO Who Last Modified Record: CYF

Detail: Year: 2007

Manifest ID: 000525330FLE TSDF EPA ID: ARD069748192

TSDF Name: TERIS LLC (DIVISION TRANSPORT ENSCO)

TSDF Address: 309 AMERICAN CIRCLE TSDF City, St, Zip: EL DORADO, AR 71730-

TSDF Country: USA

TSDF Telephone: (870)864-3662

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Transport Date: 10/11/2007

Transporter EPA ID: MAD039322250

Transporter Name: CLEAN HARBORS ENVIRONMENTAL SERVICES INC

Transporter Country: USA

Transporter Phone: (781)792-5000

Trans 2 Date: 10/15/2007 Trans 2 EPA ID: ALD067138891

Trans 2 Name: ROBBIE D. WOOD, INC.

Trans 2 Address: P.O. BOX 125

Trans 2 City, St, Zip: DOLOMITE, AL 35061

Trans 2 Country: USA

Trans 2 Phone: (205)744-8440 EPA ID: CTD981205180 Generator Phone: 8602714749

Generator Mailing Addr: 599 PO BOX 270 Generator Mailing Town: HARTFORD

Generator Mailing State: CT Generator Mailing Zip: 061410270 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 10/11/2007 Date Received: 10/26/2007 Last modified date: 05/11/2009

Last modified by: CYF Comments: Not reported

Waste:

Manifest No: ctf1287640

Year: 2006

Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: PETROLEUM DISTILLATES, N.O.S. OR PETROLEUM PRODUCTS, N.O.S.

No of Containers: 2 Container Type: DM Quantity: 35 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2007-09-20 00:00:00

DEO Who Last Modified Record: CYF

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Waste CD:

Manifest No: ctf1287640

Year: 2006 Waste Occurence: 1 EPA Waste Code: D001

Recycled Waste?: False

Date Record Was Last Modified: 2007-09-20 00:00:00

DEO Who Last Modified Record: CYF

Manifest No: ctf1287640

Year: 2006

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2007-09-20 00:00:00

DEO Who Last Modified Record: CYF

Detail: Year: 2006

Manifest ID: ctf1287640 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC TSDF Address: 136 GRACEY AVE TSDF City, St, Zip: MERIDEN, CT 06450-

TSDF Country: USA

TSDF Telephone: (203)238-6745 Transport Date: 08/18/2006

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY INC

Transporter Country: USA

Transporter Phone: (203)238-6745 Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 Address: Not reported Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: ctd981205180 Generator Phone: 8602714749

Generator Mailing Addr: 599 PO BOX 270 Generator Mailing Town: HARTFORD

Generator Mailing State: CT Generator Mailing Zip: 061410270

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: S109730656 DIST/DIR: 0.232 ESE **ELEVATION:** MAP ID: J45 148

MERIDEN SERVICE CENTER 07/30/2013 NAME: Rev:

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 08/18/2006 Date Received: 08/18/2006 Last modified date: 09/20/2007 Last modified by: CYF Comments: Not reported

Waste:

Manifest No: CTF1252721

Year: 2006 Waste Occurence: 1 UNNA: 1950 Hazard Class: 2.1

US Dot Description: AEROSOLS, FLAMMABLE

No of Containers: 002 Container Type: DM Quantity: 100 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Manifest No: CTF1252721

Year: 2006 Waste Occurence: 2 UNNA: 1263 Hazard Class: 3

US Dot Description: PAINT OR PAINT RELATED MATERIAL

No of Containers: 001 Container Type: DM Quantity: 75 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Manifest No: CTF1252721

Year: 2006

Waste Occurence: 3

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

UNNA: 3077 Hazard Class: 9

US Dot Description: HAZARDOUS WASTE, SOLID, N.O.S.

No of Containers: 001 Container Type: DF Quantity: 20 Weight/Volume: P

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Waste CD:

Manifest No: CTF1252721

Year: 2006

Waste Occurence: 1 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Manifest No: CTF1252721

Year: 2006 Waste Occurence: 2 EPA Waste Code: D001 Recycled Waste?: False

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Manifest No: CTF1252721

Year: 2006

Waste Occurence: 3 EPA Waste Code: D006 Recycled Waste?: False

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Manifest No: CTF1252721

Year: 2006

Waste Occurence: 3 EPA Waste Code: D008 Recycled Waste?: False

Date Record Was Last Modified: 2007-06-26 00:00:00

DEO Who Last Modified Record: DMG

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail: Year: 2006

Manifest ID: CTF1252721 TSDF EPA ID: RID040098352

TSDF Name: NORTHLAND ENVIRONMENTAL INC

TSDF Address: 275 ALLENS AVE

TSDF City, St, Zip: PROVIDENCE, RI 02905

TSDF Country: USA

TSDF Telephone: 4017816340 Transport Date: 02/28/2006

Transporter EPA ID: MAR000504928

Transporter Name: FLEET ENVIRONMENTAL SERVICES LLC

Transporter Country: USA
Transporter Phone: (781)815-1177
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City St Zin: CT

Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 8602714749

Generator Mailing Addr: 599 PO BOX 270 Generator Mailing Town: HARTFORD Generator Mailing State: CT Generator Mailing Zip: 061410270 Generator Mailing Country: USA

Special Handling: Not reported Discrepancies: Not reported Date Shipped: 02/28/2006 Date Received: 03/02/2006 Last modified date: 07/20/2007 Last modified by: DMG Comments: Not reported

Waste:

Manifest No: ctf1231438

Year: 2005 Waste Occurence: 1 UNNA: 1268 Hazard Class: 3

US Dot Description: PETROLEUM DISTILLATES, N.O.S. OR PETROLEUM PRODUCTS, N.O.S.

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 DIST/DIR: 0.232 ESE ELEVATION: 148 MAP ID: J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 1 Container Type: DM Quantity: 25 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported

Date Record Was Last Modified: 2006-05-15 00:00:00

DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: ctf1231438

Year: 2005

Waste Occurence: 1 EPA Waste Code: D039 Recycled Waste?: False

Date Record Was Last Modified: 2006-05-15 00:00:00

DEO Who Last Modified Record: JEB

Detail:

Year: 2005

Manifest ID: ctf1231438 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY, INC. TSDF Address: 136 GRACEY AVENUE TSDF City, St, Zip: MERIDEN, CT 06451

TSDF Country: USA

TSDF Telephone: (203)238-6745 Transport Date: 03/24/2005

Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY, INC.

Transporter Country: USA

Transporter Phone: (203)238-6745
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT

Trans 2 City,St,Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: CTD981205180 Generator Phone: 8602714749

Generator Mailing Addr: 599 PO BOX 270 Generator Mailing Town: HARTFORD

Generator Mailing State: CT

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

MANIFEST

EDR ID: \$109730656 **DIST/DIR:** 0.232 ESE **ELEVATION:** 148 **MAP ID:** J45

NAME: MERIDEN SERVICE CENTER Rev: 07/30/2013

ADDRESS: 56 COOPER ST

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 061410270 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 03/24/2005 Date Received: 03/24/2005 Last modified date: 05/23/2006 Last modified by: CYF

Last modified by: CYF Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104188011 **DIST/DIR:** 0.236 South **ELEVATION:** 123 **MAP ID:** H46

NAME: SPENCER'S GARAGE Rev: 02/11/2014

ADDRESS: 274 COOK AVENUE

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: Elsie Spencer

Buyer Name: Jacques and Yves Roy Certifying Party: Not reported

Certifying Attention Person: Not reported Title Of Certifying Person: Not reported Certifying Person Address: Not reported Certifying Person City, St, Zip: Not reported

Property Transfer Forms: Form II (DEP-PERD-PTP-202) when a discharge, spillage, uncontrolled

loss, seepage or filtration of hazardous waste has occurred, but a

cleanup has been completed and approved in writing by the Commissioner

or has been verified pursuant to section 22a-133x, 22a-133y or

22a-134a of the CGS by a licensed environmental professional (LEP) to have been performed in accordance with the remediation standards. Written documentation of the Commissioner's approval or written LEP

verification must accompany the submission of the Form II.

Date Recieved: 08/22/1988
Ackn Date: Not reported
Determination Date: Not repo

Determination Date: Not reported

LEP Verified/DEP Approval Date: Not reported

Rem Id: 3496

Remediation Location Id: 3491 Date Entered: Not reported

Program: Property Transfer Program

GAO Site: False

Staff Full Name: Not reported Super/Date: Not reported Stage Of Project: Not reported RP Level Of Activity: Not reported RP Needed Level Of Activity: Not reported Staff Level Of Activity: Not reported

Staff Needed Level Of Activity: Not reported

Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False Staff Prefrence: Not reported

Readiness For Transfer: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104188011 **DIST/DIR:** 0.236 South **ELEVATION:** 123 **MAP ID:** H46

NAME: SPENCER'S GARAGE Rev: 02/11/2014

ADDRESS: 274 COOK AVENUE

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Project Transfer Time: Not reported Transfer Comments: Not reported Staff As Of July 2000: Not reported Initial Staff: Not reported

Initial Staff: Not reported Type Of Transfer: Not reported Salutation: Not reported

Relationship To Transfer: Not reported

Audit Date: Not reported Verif Type: Not reported Audit Outcome: Not reported

GW: Not reported
Basin: Not reported
1st Payment: Not reported
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
RTN: Not reported
Revised: Not reported

ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Apryl Sched: Not reported

Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: file per ECP
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported

Water Lead(Y Or N): Not reported

Priority: Not reported

Project Status(A, I Or D): Not reported

Last Updated: Not reported SR Comments: Not reported Priority Or Work-Load: Not reported

Status: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CT PROPERTY

EDR ID: \$104188011 **DIST/DIR:** 0.236 South **ELEVATION:** 123 **MAP ID:** H46

NAME: SPENCER'S GARAGE Rev: 02/11/2014

ADDRESS: 274 COOK AVENUE

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Notes: Not reported

Special Project Name: Not reported Special Project Comments: Not reported

DOT Project: Not reported
Pt Counter: Not reported
Project Complete: False
Project Inactive: False
Int Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: Not reported
Public Notice: Not reported
RAP Received: Not reported
RAP Approved: Not reported
Compliance Category: Not reported

Delete Record: False

ECAF Reviewed By: Not reported

Not Locatable: False Primary Address: True AKA Site Name: False Primary Site Name: True AKA Site Address: False Lead: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188011 **DIST/DIR:** 0.236 South **ELEVATION:** 123 **MAP ID:** H46

NAME: SPENCER'S GARAGE Rev: 04/23/2010

ADDRESS: 274 COOK AVENUE ID/Status: 4465

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4465 Rem Master ID: 4547

PTP Id: 2366

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4624
Source of referral: PTP
Date Received: 8/22/1988
Staff Assigned: Not reported
Remediation Program: PTP
Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 8/22/1988

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported
Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188011 DIST/DIR: 0.236 South ELEVATION: 123 MAP ID: H46

NAME: SPENCER'S GARAGE Rev: 04/23/2010

ADDRESS: 274 COOK AVENUE ID/Status: 4465

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S110700004 DIST/DIR: 0.237 South **ELEVATION:** 123 MAP ID: H47

02/11/2014 CT DOT NAME: Rev:

ID/Status: Pending ADDRESS: 265 COOK AVENUE ID/Status: 59683

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

LUST: LUST Id: 0 UST Facility Id: 0 LUST Case Id: 59683 Lust Status: Pending

Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 01/04/2011 Entry Date: 01/07/2011 Site Case Id: 201100027

UST Site Id: 0

Cost Recovery Spill Case #: 0

Old SITS Number: 0 Case Log Id: 0 Monthly Report Id: 0 UST Owner Id: 0

LUST Owner Id: Not reported

UST Event Id: 0

Contact Info: Not reported Contact EMail: Not reported Site Contact City, St, Zip: UNKNOWN

2nd Contact: Jane Witherell (CDR Maquire)

2nd Contact EMail: Jane.Witherell@CDRMaguire.com 2nd Contact Address: 2080 Silas Deane Highway

2nd Contact City, St, Zip: 119, CT 06067 2nd Contact Address 2: Not reported 2nd Contact City 2: Rocky Hill

2nd Contact Phone Number: 8605633158 2nd Contact Fax Number: 8605633188 2nd Contact Type: Principal Engineer

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$110700004 **DIST/DIR:** 0.237 South **ELEVATION:** 123 **MAP ID:** H47

NAME: CT DOT **Rev**: 02/11/2014

ADDRESS: 265 COOK AVENUE ID/Status: Pending

MERIDEN, CT ID/Status: 59683

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False

Responsible EMail: Felix.Mathieu@ct.gov Resp Party Name: State of Connecticut DOT Resp Party Address: 2800 Berlin Turnpike

Resp Party City, St, Zip: Newington, CT 061114113

Resp Party Town Number: 94
Resp Party Phone: 8605942222
Resp Party Fax: Not reported
Resp Party Name 2: Felix Mathieu, Jr.

Resp Party Name 2: Felix Mathieu, J Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 0

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S110700004 DIST/DIR: 0.237 South **ELEVATION:** MAP ID: H47 123

02/11/2014 CT DOT NAME: Rev:

ID/Status: Pending ADDRESS: 265 COOK AVENUE

ID/Status: 59683 MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported

Free Product Inches: 0 Fund Date: Not reported Fund Planned: No Fund Obligated: No Fund Outlayed: No Fund Judgment: No Fund Recovered: No Cellar Borings: False Install Micro Wells: False Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False Active: True NOV Action: None

NOV Issued: Not reported NOV Due: Not reported NOV Received: Not reported NOV Closed: Not reported NOV Disc Date: Not reported NOV Issued Date: Not reported NOV Compliance Sched: Not reported NOV Admin Order: Not reported NOV Referred To Ag: Not reported

Stop All NOV Actions: False Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Ortly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

S110700004 DIST/DIR: 0.237 South EDR ID: **ELEVATION:** 123 MAP ID: H47

NAME: CT DOT 02/11/2014 Rev:

ID/Status: Pending ADDRESS: 265 COOK AVENUE ID/Status: 59683

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 0 Lph Wells: 0

User Stamp: allison forrest/ForrestA

Date Stamp: 01/23/2013 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Cook Brook is adjacent to the northern boundary of site.
Location Desc: Not reported

NOV Comments: Not reported Release Desc: Not reported

Running Comments: Spills Files, and LUST FilesPossible LUST Cases:2011-00027

Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002027907 DIST/DIR: 0.240 NE ELEVATION: 141 MAP ID: 148

NAME: HANOVER TOWERS REALTY Rev: 03/03/2014

ADDRESS: 76 BUTLER ST ID/Status: 80-3879

MERIDEN, CT 06451

ID/Status: Permanently Closed ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-3879 Latitude: Not reported Longitude: Not reported

Owner: CARABETTA MANAGEMENT COMPANY

Owner Address: 200 PRATT ST Owner Address 2: Not reported

Owner City, St, Zip: MERIDEN, CT 064504220

Tank ID: 3879-1 Compartment ID: 3879-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 20000 Substance: Heating Oil Date Installed: 06/01/1980 Date Last Used: 08/01/1997

Closure Status: Tank was Removed From Ground

Pipe Material: Not reported

Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 3879-2

Compartment ID: 3879-2 Compartment Num: 1 Alt. Tank ID: A2

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 20000 Substance: Heating Oil Date Installed: 06/01/1980 Date Last Used: 08/01/1997

Closure Status: Tank was Removed From Ground

Pipe Material: Not reported

Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002027907 DIST/DIR: 0.240 NE ELEVATION: 141 MAP ID: 148

NAME: HANOVER TOWERS REALTY Rev: 03/03/2014

ADDRESS: 76 BUTLER ST ID/Status: 80-3879

MERIDEN, CT 06451

ID/Status: Permanently Closed ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 3879-3

Compartment ID: 3879-3 Compartment Num: 1 Alt. Tank ID: B1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 1000 Substance: Diesel Date Installed: 01/01/1980 Date Last Used: 08/01/1997

Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Tank ID: 3879-4 Compartment ID: 3879-4 Compartment Num: 1 Alt. Tank ID: A1R1

Tank Status: Currently In Use

Tank Material: Composite - Steel with Fiberglass (ACT 100)

Secondary Material: Double-Walled

Capacity: 20000
Substance: Heating Oil
Date Installed: 08/01/1997
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Not reported

Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Tank ID: 3879-5

Compartment ID: 3879-5 Compartment Num: 1 Alt. Tank ID: B1R1

Tank Status: Currently In Use

Tank Material: Composite - Steel with Fiberglass (ACT 100)

Secondary Material: Double-Walled

Capacity: 1000 Substance: Diesel

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U002027907 **DIST/DIR:** 0.240 NE **ELEVATION:** 141 **MAP ID:** 148

NAME: HANOVER TOWERS REALTY Rev: 03/03/2014

ADDRESS: 76 BUTLER ST ID/Status: 80-3879

MERIDEN, CT 06451

ID/Status: Permanently Closed ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 08/01/1997
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Not reported

Pipe Mode Description: Not reported Spill Installed: Spill Bucket Overfill Installed: Audible Alarm

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CPCS

EDR ID: \$103161449 **DIST/DIR:** 0.240 NE **ELEVATION:** 141 **MAP ID:** 149

NAME: HANOVER TOWERS Rev: 01/30/2014

ADDRESS: 76 BUTLER STREET

ID/Status: LUST Completed (DEP's significant hazard def

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CPCS:

Site Type: LUST

Lust Status: LUST Completed (DEP's significant hazard definition)

PTP Form: Not reported Program: Not reported Comments: Not reported

Site Type Definition: Leaking Underground Storage Tanks Completed

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$103161449 DIST/DIR: 0.240 NE ELEVATION: 141 MAP ID: 149

NAME: HANOVER TOWERS

ADDRESS: 76 BUTLER STREET

Rev: 02/11/2014

ID/Status: Lust Completed

ID/Status: 28620

MERIDEN, CT 06450

MENDEN, CT 00450

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 3391 UST Facility Id: 3879 LUST Case Id: 28629 Lust Status: Lust Completed Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 08/08/1997 Entry Date: Not reported Site Case Id: 9704369 UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: Not reported Case Log Id: Not reported Monthly Report Id: 0 UST Owner Id: 848

LUST Owner Id: Not reported UST Event Id: 3437 Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN, UNKNOWN

2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported 2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Stanley Dynia Site Contact Address: GZA

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$103161449 DIST/DIR: 0.240 NE ELEVATION: 141 MAP ID: 149

NAME: HANOVER TOWERS

ADDRESS: 76 BUTLER STREET

Rev: 02/11/2014

ID/Status: Lust Completed

ID/Status: 28620

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: ZipCode Unknown Site Contact Phone: (860) 875-7655 Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False
Private Heating Fuel: True
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: True Follow Up Flag: False Alternate Water Supply:

Alternate Water Supply: False

Relocation: False

Responsible Party: False

Responsible EMail: Not reported

Resp Party Name: Carabetta Management Company

Resp Party Address: 200 Pratt Street

Resp Party City, St, Zip: Meriden, CT 064504220

Resp Party Town Number: 80 Resp Party Phone: 2032377400 Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported Resp Party Phone 2: 2032380454

Investigator Id: 35

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$103161449 DIST/DIR: 0.240 NE ELEVATION: 141 MAP ID: 149

NAME: HANOVER TOWERS Rev: 02/11/2014

ADDRESS: 76 BUTLER STREET ID/Status: Lust Completed

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported Free Product Inches: Not reported

Fund Date: Not reported Fund Planned: No Fund Obligated: No Fund Outlayed: No Fund Judgment: No Fund Recovered: No Cellar Borings: False Install Micro Wells: False Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported

NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

DIST/DIR: S103161449 0.240 NE EDR ID: **ELEVATION:** 141 **MAP ID**: 149

NAME: HANOVER TOWERS 02/11/2014 Rev: ID/Status: Lust Completed ADDRESS: 76 BUTLER STREET

ID/Status: 28629 MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported No Wells: Not reported Lph Wells: Not reported
User Stamp: Allison Forrest/ForrestA

Date Stamp: 05/16/2012 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Harbor Brook is ~100 ft south-southeast of site.
Location Desc: Not reported

NOV Comments: Not reported Release Desc: Not reported

Running Comments: Spills Files and UST Enforcement Files

Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

UST

EDR ID: U004009595 **DIST/DIR:** 0.248 NE **ELEVATION:** 143 **MAP ID:** 150

NAME: MOTOR VEHICLE DEPT. (BUTLER ST. FIRE) Rev: 03/03/2014

ADDRESS: 47 BUTLER ST

MERIDEN, CT 06451 ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-7050 Latitude: Not reported Longitude: Not reported Owner: CITY OF MERIDEN Owner Address: 142 E MAIN ST Owner Address 2: Not reported

Owner City, St, Zip: MERIDEN, CT 064505605

Tank ID: 7050-1 Compartment ID: 7050-1 Compartment Num: 1 Alt. Tank ID: A1

Tank Status: Permanently Closed

Tank Material: Asphalt Coated or Bare Steel

Secondary Material: Not reported

Capacity: 1000 Substance: Gasoline Date Installed: 12/01/1953 Date Last Used: 11/01/1991

Date Last Used: 11/01/1991 Closure Status: Tank was Removed From Ground

Pipe Material: Bare or Galvonized Steel Pipe Mode Description: Not reported

Spill Installed: Not reported Overfill Installed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$112074752 **DIST/DIR:** 0.274 West **ELEVATION:** 155 **MAP ID:** 51

NAME: TRI CORNER AUTO SERVICE, INC. Rev: 02/11/2014

ADDRESS: 350 HANOVER STREET

ID/Status: RSRs Reached

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

LUST: LUST Id: 0

UST Facility Id: 7000 LUST Case Id: 60226 Lust Status: RSRs Reached Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 11/23/2010 Entry Date: 06/20/2012 Site Case Id: 0

Site Case Id: 0 UST Site Id: 0

Cost Recovery Spill Case #: 0

Old SITS Number: 0 Case Log Id: 0 Monthly Report Id: 0 UST Owner Id: 2400 LUST Owner Id: AXF UST Event Id: 0

Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Robert Poole (Lenard Engineering, Inc.)

2nd Contact EMail: poole@lenard-eng.com 2nd Contact Address: 2210 Main Street 2nd Contact City,St,Zip: 54, CT 06033 2nd Contact Address 2: P.O. Box 1088 2nd Contact City 2: Glastonbury 2nd Contact Phone Number: 8606593100

2nd Contact Phone Number: 8606593100 2nd Contact Fax Number: 8606593103 2nd Contact Type: Project Manager

Facility City Num: 80
Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$112074752 DIST/DIR: 0.274 West ELEVATION: 155 MAP ID: 51

NAME: TRI CORNER AUTO SERVICE, INC. Rev: 02/11/2014

ADDRESS: 350 HANOVER STREET ID/Status: RSRs Reached

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False

Responsible EMail: Not reported Resp Party Name: Frank Peracchio

Resp Party Address: 469 Paddock Avenue Resp Party City, St, Zip: Meriden, CT 064506946

Resp Party Town Number: 80 Resp Party Phone: 2032371188 Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported

Resp Party Phone 2: 2032371045

Investigator Id: 0

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$112074752 DIST/DIR: 0.274 West ELEVATION: 155 MAP ID: 51

NAME: TRI CORNER AUTO SERVICE, INC. Rev: 02/11/2014

ADDRESS: 350 HANOVER STREET ID/Status: RSRs Reached

MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported

Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Ground Water Gauging: False Soil Venting: False

Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported

NOV Referred To Ag: Not reported Stop All NOV Actions: False Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

S112074752 0.274 West EDR ID: DIST/DIR: **ELEVATION:** 155 **MAP ID**: 51

NAME: TRI CORNER AUTO SERVICE, INC. 02/11/2014 Rev:

ID/Status: RSRs Reached ADDRESS: 350 HANOVER STREET

ID/Status: 60226 MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 0 Lph Wells: 0

User Stamp: Allison Forrest/ForrestA

Date Stamp: 06/20/2012 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Harbor Brook is ~200 ft south of site
Location Desc: Not reported

NOV Comments: Not reported Release Desc: Not reported Running Comments: Not reported Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$110775436 DIST/DIR: 0.274 ESE ELEVATION: 162 MAP ID: K52

NAME: GETTY STATION Rev: 02/11/2014
ID/Status: Cleanup Initiated

ADDRESS: 213 COLONY RD. ID/Status: Clearup Initiate
ID/Status: 28437

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 411

UST Facility Id: 7042 LUST Case Id: 28437

Lust Status: Cleanup Initiated Processing Status: Not reported

EPA Reportable: True Motor Fuel: True Diesel: False Gasoline: True Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 06/19/1991 Entry Date: Not reported Site Case Id: Not reported UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: 9102367 Case Log Id: Not reported Monthly Report Id: 0 UST Owner Id: 5266 LUST Owner Id: Not reported

UST Event Id: 410 Contact Info: Not reported

Contact EMail: stevensEES@aol.com Site Contact City,St,Zip: 101, CT 06473 2nd Contact: Matt Roche (Tyree)

2nd Contact EMail: MRoche@tyreeorg.com 2nd Contact Address: 125 Commerce Drive 2nd Contact City,St,Zip: 18, CT 06804 2nd Contact Address 2: Not reported

2nd Contact City 2: Brookfield

2nd Contact Phone Number: 2037400450 2nd Contact Fax Number: 2039485033 2nd Contact Type: Not reported

Facility City Num: 80

Site Contact: Theodore Stevens (Stevens Engineering and Environmental Services, LLC)

Site Contact Address: 10 Carafa Terrace

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$110775436 DIST/DIR: 0.274 ESE ELEVATION: 162 MAP ID: K52

NAME: GETTY STATION Rev: 02/11/2014

ADDRESS: 213 COLONY RD. ID/Status: Cleanup Initiated

MERIDEN, CT 06450 ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: North Haven Site Contact Phone: 2032488222 Site Contact Fax: 2032480444 Site Contact Type: LEP

Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False Responsible EMail: Not reported

Resp Party Name: Power Test Reality Co. LTD Partnership

Resp Party Address: 175 Sunnyside Boulevard Resp Party City, St, Zip: Plainview, NY 118031521

Resp Party Town Number: Not reported Resp Party Phone: 2034672536 Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported

Resp Party Address 2: Not reported

Investigator Id: 24

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$110775436 DIST/DIR: 0.274 ESE ELEVATION: 162 MAP ID: K52

NAME: GETTY STATION Rev: 02/11/2014

ADDRESS: 213 COLONY RD. ID/Status: Cleanup Initiated

MERIDEN, CT 06450 ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported Ground Water Depth: 8.10 to 9.58 ftbg Areas Of Concern: Not reported

Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False

Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$110775436 DIST/DIR: 0.274 ESE ELEVATION: 162 MAP ID: K52

NAME: GETTY STATION Rev: 02/11/2014

ADDRESS: 213 COLONY RD. ID/Status: Cleanup Initiated

MERIDEN, CT 06450 ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 13 Lph Wells: 0

User Stamp: allison forrest/ForrestA

Date Stamp: 01/22/2014 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported

GW Comments: No public water supply wells within 1,000 ft or water supply wells

within 500 ft of site.

Location Desc: Surficial Geology: sand overlying finesBedrock Geology: New Haven

Arkose, a red, pink, and gray coarse-grained, locally conglomeratic arkose interbedded with brick red shaley siltstone and fine-grained

arkosic sandstone.

NOV Comments: Not reported Release Desc: Not reported

Running Comments: Spills Files, UST Enforcement Files, Remediation Files, and LUST

FilesOpen LUST Cases:0091-02367 Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188031 DIST/DIR: 0.274 ESE ELEVATION: 162 MAP ID: K53

NAME: GETTY PETROLEUM Rev: 04/23/2010

ADDRESS: 213 COLONY STREET ID/Status: 4457

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4457 Rem Master ID: 4539

PTP Id: 948

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4615 Source of referral: PTP Date Received: 10/30/1991 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 10/30/1991

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188031 DIST/DIR: 0.274 ESE ELEVATION: 162 MAP ID: K53

NAME: GETTY PETROLEUM Rev: 04/23/2010

ADDRESS: 213 COLONY STREET ID/Status: 4457

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported Judgement: Not reported

Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported

In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109729745 DIST/DIR: 0.285 NE ELEVATION: 147 MAP ID: L54

NAME: SOUTHERN NEW ENGLAND TELE

ADDRESS: 27 BUTLER ST

Rev: 02/11/2014

ID/Status: Investigation

MERIDEN, CT 06450 ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

LUST: LUST Id: 0

UST Facility Id: 3637 LUST Case Id: 49338 Lust Status: Investigation Processing Status: Not reported

EPA Reportable: True Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 08/16/2007 Entry Date: 12/08/2008 Site Case Id: 200705259

UST Site Id: 0

Cost Recovery Spill Case #: 0

Old SITS Number: 0 Case Log Id: 0 Monthly Report Id: 0 UST Owner Id: 8261 LUST Owner Id: DJF UST Event Id: 0

Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109729745 DIST/DIR: 0.285 NE ELEVATION: 147 MAP ID: L54

NAME: SOUTHERN NEW ENGLAND TELE Rev: 02/11/2014
ID/Status: Investigation

ADDRESS: 27 BUTLER ST ID/Status: fivestigation ID/Status: 49338

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False Responsible EMail: Not reported Resp Party Name: AT&T Corp.

Resp Party Address: 308 South Akard Street Resp Party City, St, Zip: Dallas, TX 752025315 Resp Party Town Number: Not reported

Resp Party Phone: 2144641477
Resp Party Fax: 2144641424
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported

Investigator Id: 22

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109729745 DIST/DIR: 0.285 NE ELEVATION: 147 MAP ID: L54

NAME: SOUTHERN NEW ENGLAND TELE

Rev: 02/11/2014

ID/Status: Investigation

ADDRESS: 27 BUTLER ST ID/Status: Investigation ID/Status: 49338 ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported Ground Water Depth: Not reported

Areas Of Concern: Not reported

Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Ground Water Gauging: Fal Soil Venting: False

Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Stop All NOV Actions: False Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$109729745 **DIST/DIR:** 0.285 NE **ELEVATION:** 147 **MAP ID:** L54

NAME: SOUTHERN NEW ENGLAND TELE

ADDRESS: 27 BUTLER ST

Rev: 02/11/2014

ID/Status: Investigation

ID/Obstatus: 10/2020

MERIDEN, CT 06450 ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 0 Lph Wells: 0

User Stamp: allison forrest/ForrestA

Date Stamp: 09/06/2013 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported

Running Comments: Spills Files, UST Enforcement Files, and Remediation FilesOpen LUST

cases:2007-05259

Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$103541249 DIST/DIR: 0.289 NE ELEVATION: 148 MAP ID: L55

NAME: SNET Rev: 04/23/2010

ADDRESS: 25 BUTLER STREET ID/Status: 4464

MERIDEN. CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4464 Rem Master ID: 4546

PTP Id: 3001

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4623 Source of referral: PTP Date Received: 11/4/1998 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 11/4/1998

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$103541249 DIST/DIR: 0.289 NE ELEVATION: 148 MAP ID: L55

NAME: SNET Rev: 04/23/2010

ADDRESS: 25 BUTLER STREET ID/Status: 4464

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: 1000842782 DIST/DIR: 0.321 NNE ELEVATION: 153 MAP ID: 56

NAME: COLONIAL CUSTOM CLEANERS Rev: 04/23/2010

ADDRESS: 9 BUTLER ST ID/Status: 937 ID/Status: 944

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 937
Rem Master ID: 986
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: OIL, PCE

Disposal: SPILL/DUMP, TO GROUND

Sample Data Available: False Updated By: Not reported Update Program: Not reported Updated: Not reported Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported Referral Id: 886 Source of referral: SUPERFUND Date Received: 7/1/1990 Staff Assigned: Not reported Remediation Program: Not reported

Date dt_assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Referral Id: 3593 Source of referral: RCRA Date Received: 8/31/1990 Staff Assigned: BOTTI, T.

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: 1000842782 DIST/DIR: 0.321 NNE ELEVATION: 153 MAP ID: 56

NAME: COLONIAL CUSTOM CLEANERS Rev: 04/23/2010

ADDRESS: 9 BUTLER ST ID/Status: 937 ID/Status: 944

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Remediation Program: D&A Date dt_assigned: 8/31/1990

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: 322 PTP Id: 942

Remediation Program: III

Remediation Program Entered: Not reported

Staff Assigned: HAMEL, M. Remediation Program: PTP Date dt_assign: Not reported

Project Phase: A
Order issued: False
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported

GW monitoring: False

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: 1000842782 DIST/DIR: 0.321 NNE ELEVATION: 153 MAP ID: 56

NAME: COLONIAL CUSTOM CLEANERS Rev: 04/23/2010

ADDRESS: 9 BUTLER ST ID/Status: 937 ID/Status: 944

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Facility ID: 944
Rem Master ID: 993
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: PCE

Disposal: SPILL/DUMP, TO GROUND

Sample Data Available: False Updated By: Not reported Update Program: Not reported Updated: Not reported Date Created: Not reported

Duplicate: True

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: Not reported
Source of referral: Not reported
Date Received: Not reported
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Staff Assigned: Not reported Remediation Program: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: 1000842782 DIST/DIR: 0.321 NNE ELEVATION: 153 MAP ID: 56

NAME: COLONIAL CUSTOM CLEANERS Rev: 04/23/2010

ADDRESS: 9 BUTLER ST ID/Status: 937 ID/Status: 944

MERIDEN, CT

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$106140886 DIST/DIR: 0.403 SW ELEVATION: 203 MAP ID: 57

NAME:LOCKHART RESIDENCERev:02/11/2014ADDRESS:48 LAUREL HEIGHTSID/Status: Pending
ID/Status: 48546

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

LUST: LUST Id: 0 UST Facility Id: 0 LUST Case Id: 48546 Lust Status: Pending

Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: Not reported Entry Date: 07/29/2004

Site Case Id: 0 UST Site Id: 0

Cost Recovery Spill Case #: 0

Old SITS Number: 0 Case Log Id: 981 Monthly Report Id: 0 UST Owner Id: 0 LUST Owner Id: AG UST Event Id: 0

Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported 2nd Contact EMail: Not reported

2nd Contact Address: Aaron Environmental 2nd Contact City, St, Zip: 131, CT 06479 2nd Contact Address 2: 189 Atwater Street

2nd Contact City 2: Plantsville

2nd Contact Phone Number: 8602761201 2nd Contact Fax Number: 8602761233

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

ID/Status: 48546

EDR ID: \$106140886 DIST/DIR: 0.403 SW ELEVATION: 203 MAP ID: 57

NAME: LOCKHART RESIDENCE Rev: 02/11/2014

ADDRESS: 48 LAUREL HEIGHTS ID/Status: Pending

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False
Private Heating Fuel: True
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported

Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 0

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$106140886 DIST/DIR: 0.403 SW ELEVATION: 203 MAP ID: 57

NAME: LOCKHART RESIDENCE Rev: 02/11/2014
ID/Status: Pending

ADDRESS: 48 LAUREL HEIGHTS ID/Status: Pending ID/Status: 48546

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: 2.82 Areas Of Concern: Not reported Free Product Inches: 0

Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False

Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$106140886 DIST/DIR: 0.403 SW ELEVATION: 203 MAP ID: 57

NAME: LOCKHART RESIDENCE Rev: 02/11/2014

ADDRESS: 48 LAUREL HEIGHTS

ID/Status: Pending
ID/Status: 48546

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 0 Lph Wells: 0

User Stamp: Terry Parker/ABassila

Date Stamp: 09/29/2010 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported GW Comments: Not reported Location Desc: Not reported NOV Comments: Not reported

Release Desc: Following discovery of a home HF release to the soil & GW in Dec.

2003, CHES penetrated the concrete basement floor and then hand excavated a pit to create a GW collection sump. The sump enhanced subsequent efforts to recover & remove LNAPL and petroleum

contaminated GW associated with the home HF release. Such activities

continued until the summer of 2004 when decreased system performance

related to low water table elevations led to the removal of the rented GW pumping and recovery system on 8/10/04. Aaron later restored the sump and installed a 4inch diameter recovery well on

1/17/05 to monitor GW for LNAPL.

Running Comments: Residential HF release from transfer line impacts soil & GWFile in

LUST Cabinet

Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.414 ENE **ELEVATION:** 151 **MAP ID:** M58

NAME: 51-53 SOUTH COLONY ST Rev: 03/20/2014

ADDRESS: 51-53 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: 51-53 SOUTH COLONY ST

Property #: Not reported

Parcel size: .33

Property Description: The site was utilized for industrial/commercial purposes from the

late 1800s until the 1990s. This included an electric generating facility, a welding company, and a furniture store. It was later used

as a warehouse. Latitude: 41.5364473 Longitude: -72.8027498

HCM label: Address Matching-House Number

Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: North American Datum of 1983

ACRES property ID: 156322 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 1150

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 0

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden

Did owner change: Y
Cleanup required: Unknown
Video available: No
Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.414 ENE **ELEVATION:** 151 **MAP ID:** M58

NAME: 51-53 SOUTH COLONY ST Rev: 03/20/2014

ADDRESS: 51-53 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported
Controled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported

Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Soil cleaned up: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: .33
Past use industrial acreage: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456472 DIST/DIR: 0.414 ENE ELEVATION: 151 MAP ID: M58

NAME: 51-53 SOUTH COLONY ST Rev: 03/20/2014

ADDRESS: 51-53 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: 51-53 SOUTH COLONY ST

Property #: Not reported

Parcel size: .33

Property Description: The site was utilized for industrial/commercial purposes from the

late 1800s until the 1990s. This included an electric generating facility, a welding company, and a furniture store. It was later used

as a warehouse. Latitude: 41.5364473 Longitude: -72.8027498

HCM label: Address Matching-House Number

Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: North American Datum of 1983

ACRES property ID: 156322
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Assessment funding: 2300

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden

Did owner change: Y Cleanup required: Unknown

Video available: No

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456472 DIST/DIR: 0.414 ENE ELEVATION: 151 MAP ID: M58

NAME: 51-53 SOUTH COLONY ST Rev: 03/20/2014

ADDRESS: 51-53 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported
Controled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contaminants found: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported

VOCs round. Not reported

Cleanup other description: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.414 ENE **ELEVATION:** 151 **MAP ID:** M58

NAME: 51-53 SOUTH COLONY ST Rev: 03/20/2014

ADDRESS: 51-53 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: 33 Past use industrial acreage: Not reported Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

ID/Status: 877

EDR ID: \$104254260 DIST/DIR: 0.424 ENE ELEVATION: 159 MAP ID: M59

NAME: THE MERIDEN RECORD CO. Rev: 04/23/2010

ADDRESS: 11 CROWN STREET

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 877
Rem Master ID: 1295
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported Waste Type: CHEMICAL LIQUID, SLUDGES

Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 829
Source of referral: ISWS
Date Received: 5/18/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

ID/Status: 877

EDR ID: \$104254260 **DIST/DIR:** 0.424 ENE **ELEVATION:** 159 **MAP ID:** M59

NAME: THE MERIDEN RECORD CO. Rev: 04/23/2010

ADDRESS: 11 CROWN STREET

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported

Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S108319524 DIST/DIR: 0.428 NNW **ELEVATION: MAP ID:** 60 144

H.C.S. ENTERPRISES, LLC 02/11/2014 NAME: Rev: ID/Status: Lust Completed ADDRESS: 293 WEST MAIN STREET

ID/Status: 48734

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

LUST: LUST Id: 0

UST Facility Id: 6979 LUST Case Id: 48734 Lust Status: Lust Completed Processing Status: Not reported

EPA Reportable: True Motor Fuel: False Diesel: False Gasoline: True Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 12/13/2006 Entry Date: 04/03/2007 Site Case Id: 200607867 UST Site Id: 1309

Cost Recovery Spill Case #: 0

Old SITS Number: 0 Case Log Id: 0 Monthly Report Id: 0 UST Owner ld: 9283 LUST Owner Id: PCC UST Event Id: 0

Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Bob Poole 2nd Contact EMail: Not reported 2nd Contact Address: Terrasyn Env. 2nd Contact City, St, Zip: UNKNOWN

2nd Contact Address 2: Not reported 2nd Contact City 2: Not reported

2nd Contact Phone Number: 2037561000 2nd Contact Fax Number: Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$108319524 **DIST/DIR:** 0.428 NNW **ELEVATION:** 144 **MAP ID:** 60

NAME: H.C.S. ENTERPRISES, LLC Rev: 02/11/2014

ADDRESS: 293 WEST MAIN STREET ID/Status: Lust Completed

MERIDEN. CT ID/Status: 48734

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Steve Gaura Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: True

Responsible Party. True
Responsible EMail: Not reported
Resp Party Name: Henry Smith - owner
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: 8608296389
Resp Party Fax: Not reported
Resp Party Name 2: Not reported

Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 0

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GA

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$108319524 DIST/DIR: 0.428 NNW ELEVATION: 144 MAP ID: 60

NAME: H.C.S. ENTERPRISES, LLC

ADDRESS: 293 WEST MAIN STREET

Rev: 02/11/2014

ID/Status: Lust Completed

ID/Clarker 40724

DIDEN OF ID/Status: 48734

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: south east Ground Water Depth: Not reported Areas Of Concern: Not reported Free Product Inches: 0

Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: True

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: True Ground Water Gauging: False

Soil Venting: False

Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Closed: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Stop All NOV Actions: False Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$108319524 DIST/DIR: 0.428 NNW ELEVATION: 144 MAP ID: 60

NAME: H.C.S. ENTERPRISES, LLC

ADDRESS: 293 WEST MAIN STREET

Rev: 02/11/2014

ID/Status: Lust Completed

BIDEN OF ID/Status: 48734

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False DEP Closure Letter: False Referred To: Not reported

No Wells: 0 Lph Wells: 0

User Stamp: allison forrest/ForrestA

Date Stamp: 12/26/2012 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported

GW Comments: municipal water, municipal sewer, Harbor Brook 2300 feet southeast,

Sodom Brook ~500 ft west. No potable wells within 500 ft. Location Desc: Site has operated as a gas station since 1926.

NOV Comments: Not reported Release Desc: Not reported Running Comments: Not reported Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254227 DIST/DIR: 0.435 South ELEVATION: 163 MAP ID: 61

NAME: DUFFY PROPERTY Rev: 04/23/2010

ADDRESS: 382 COOK AVENUE ID/Status: 2991

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 2991
Rem Master ID: 2592
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: 41.5256
Longitude: -72.8086

Lat/Long Determined By: UNK

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: CHLR VOC, METALS

Disposal: DRYWELL Sample Data Available: False Updated By: BOBOWICZ, H. A. Update Program: D&A

Update Program: D&A
Updated: 6/28/1997
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral ld: 2804

Source of referral: RCRA
Date Received: 6/16/1997
Staff Assigned: BOBOWICZ, H. A.
Remediation Program: D&A
Date dt assigned: 6/28/1997

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254227 DIST/DIR: 0.435 South ELEVATION: 163 MAP ID: 61

NAME: DUFFY PROPERTY Rev: 04/23/2010

ADDRESS: 382 COOK AVENUE ID/Status: 2991

MERIDEN, CT

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

SDADB: Waste Id: 5

Waste Type: CHLR VOC

Description: Chlorinated Volatile Organic Compounds

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456733 DIST/DIR: 0.437 ENE ELEVATION: 152 MAP ID: 62

NAME: FORMER CHURCH AND MORSE Rev: 03/20/2014

ADDRESS: 33 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FORMER CHURCH AND MORSE

Property #: Not reported

Parcel size: .48

Property Description: The site was utilized for industrial/commercial purposes from the

late 1800 until the late 2000s, primarily occupied by Church and

Morse, a former retail hardware store

Latitude: Not reported Longitude: Not reported HCM label: Not reported Map scale: Not reported Point of reference: Not reported

Datum: North American Datum of 1983

ACRES property ID: 156321 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 1150

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 0

Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: Y

Did owner change: Y Cleanup required: Unknown Video available: No Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

IC cat. enforcement permit tools: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456733 DIST/DIR: 0.437 ENE ELEVATION: 152 MAP ID: 62

NAME: FORMER CHURCH AND MORSE Rev: 03/20/2014

ADDRESS: 33 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC in place date: Not reported IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported Asbestos cleaned: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported
Controled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contaminants found: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Soil cleaned up: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: .48 Past use industrial acreage: Not reported Future use greenspace acreage: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456733 DIST/DIR: 0.437 ENE **ELEVATION: MAP ID:** 62 152

03/20/2014 NAME: FORMER CHURCH AND MORSE Rev:

ADDRESS: 33 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use residential acreage: Not reported Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FORMER CHURCH AND MORSE

Property #: Not reported

Parcel size: .48

Property Description: The site was utilized for industrial/commercial purposes from the

late 1800 until the late 2000s, primarily occupied by Church and

Morse, a former retail hardware store

Latitude: Not reported Longitude: Not reported HCM label: Not reported Map scale: Not reported Point of reference: Not reported

Datum: North American Datum of 1983

ACRES property ID: 156321 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 2100

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden Did owner change: Y

Cleanup required: Unknown Video available: No Photo available: Yes

Institutional controls required: U

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456733 DIST/DIR: 0.437 ENE ELEVATION: 152 MAP ID: 62

NAME: FORMER CHURCH AND MORSE Rev: 03/20/2014

ADDRESS: 33 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported

Asbestos found: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported Groundwater affected: Not reported Groundwater cleaned: Not reported Lead contaminant found: Not reported

Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported

VOCs cleaned: Not reported
Cleanup other description: Not reported

Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1016456733 **DIST/DIR:** 0.437 ENE **ELEVATION:** 152 **MAP ID:** 62

NAME: FORMER CHURCH AND MORSE Rev: 03/20/2014

ADDRESS: 33 SOUTH COLONY ST

MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Past use residential acreage: Not reported Past use commercial acreage: .48 Past use industrial acreage: Not reported Future use greenspace acreage: Not reported Future use residential acreage: Not reported Future use commercial acreage: Not reported

Future use industrial acreage: Not reported Greenspace acreage and type: Not reported

Superfund Fed. landowner flag: N

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$105456150 DIST/DIR: 0.447 NE ELEVATION: 156 MAP ID: 63

NAME: CT. NATIONAL BANK

ADDRESS: 1 WEST MAIN ST.

Rev: 02/11/2014

ID/Status: Lust Completed

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 407 UST Facility Id: 4008 LUST Case Id: 28433 Lust Status: Lust Completed Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 01/31/1990 Entry Date: Not reported Site Case Id: Not reported UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: Not reported Case Log Id: Not reported Monthly Report Id: 0 UST Owner Id: 848

LUST Owner Id: Not reported

UST Event Id: 406 Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported 2nd Contact Types, Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$105456150 DIST/DIR: 0.447 NE ELEVATION: 156 MAP ID: 63

NAME: CT. NATIONAL BANK

ADDRESS: 1 WEST MAIN ST.

Rev: 02/11/2014

ID/Status: Lust Completed

MERIDEN, CT 06450

,

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported

Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 31

Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported Drastic: Not reported Geo Setting: Not reported

Ground Water Classification: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$105456150 DIST/DIR: 0.447 NE ELEVATION: 156 MAP ID: 63

NAME: CT. NATIONAL BANK

ADDRESS: 1 WEST MAIN ST.

Rev: 02/11/2014
ID/Status: Lust Completed

MERIDEN, CT 06450

MENDEN, CT 00430

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported Free Product Inches: Not reported

Fund Date: Not reported Fund Planned: No Fund Obligated: No Fund Outlayed: No Fund Judgment: No Fund Recovered: No Cellar Borings: False Install Micro Wells: False Ground Water Sample: False

Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False Active: False

NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$105456150 DIST/DIR: 0.447 NE ELEVATION: 156 MAP ID: 63

NAME: CT. NATIONAL BANK

ADDRESS: 1 WEST MAIN ST.

Rev: 02/11/2014

ID/Status: Lust Completed

ID/Status: 204/23

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254263 DIST/DIR: 0.468 NE ELEVATION: 140 MAP ID: N64

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) Rev: 04/23/2010

ADDRESS: 2 MAIN STREET ID/Status: 1555

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1555
Rem Master ID: 1566
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported Ground Water Quality Classification: GB/GA Surface Water Quality Classification: C/B Waste Type: CHLR VOC, HYDRO/OIL

Disposal: UST

Sample Data Available: False Updated By: POST, M. Update Program: CORE Updated: 8/16/1994 Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 1435 Source of referral: PTP Date Received: 10/6/1993 Staff Assigned: Not reported Remediation Program: Not reported Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 10/6/1993

Outcome: PTP Referral Id: 3691

Source of referral: REMEDIAL Date Received: 8/18/1994 Staff Assigned: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254263 DIST/DIR: 0.468 NE ELEVATION: 140 MAP ID: N64

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) Rev: 04/23/2010

ADDRESS: 2 MAIN STREET ID/Status: 1555

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Remediation Program: PWP Date dt_assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: 326 PTP Id: 962

Remediation Program: III

Remediation Program Entered: Not reported

Staff Assigned: WILCOX, J. Remediation Program: PTP Date dt assign: Not reported

Project Phase: A
Order issued: False
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported

GW monitoring: False

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254263 **DIST/DIR**: 0.468 NE **ELEVATION**: 140 **MAP ID**: N64

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) Rev: 04/23/2010

ADDRESS: 2 MAIN STREET ID/Status: 1555

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

SDADB: Waste Id: 5

Waste Type: CHLR VOC

Description: Chlorinated Volatile Organic Compounds

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S104100300 DIST/DIR: 0.468 NE **ELEVATION:** 140 MAP ID: N65

HENNY PENNY (FORMERLY VINNIE'S AUTO) 02/11/2014 NAME: Rev:

ID/Status: Cleanup Initiated ADDRESS: 2 MAIN STREET

ID/Status: 31697 MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 3671 UST Facility Id: 3311 LUST Case Id: 31697

Lust Status: Cleanup Initiated Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 04/13/1989 Entry Date: Not reported Site Case Id: Not reported UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: Not reported Case Log Id: Not reported Monthly Report Id: 0 UST Owner Id: 231

LUST Owner Id: Not reported UST Event Id: 3746 Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported 2nd Contact EMail: Not reported 2nd Contact Address: Not reported 2nd Contact City,St,Zip: UNKNOWN 2nd Contact Address 2: Not reported 2nd Contact City 2: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$104100300 DIST/DIR: 0.468 NE ELEVATION: 140 MAP ID: N65

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)

Rev: 02/11/2014

ADDRESS: 2 MAIN STREET

ID/Status: Cleanup Initiated

MERIDEN, CT 06450 ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False
Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False

Responsible EMail: DOUGHENDEL@HENDELSINC.COM

Resp Party Name: American Realty Resp Party Address: 35 Great Neck Road

Resp Party City, St, Zip: Waterford, CT 063853337

Resp Party Town Number: 152
Resp Party Phone: 8604435337
Resp Party Fax: Not reported
Resp Party Name 2: Doug Hendel
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: Not reported
Follow Update: Not reported
Area Leytont: Not reported

Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported

Hydro Basin: Not reported Drastic: Not reported Geo Setting: Not reported

Ground Water Classification: GA (maybe impaired)

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$104100300 DIST/DIR: 0.468 NE ELEVATION: 140 MAP ID: N65

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)

Rev: 02/11/2014

ADDRESS: 2 MAIN STREET

ID/Status: Cleanup Initiated

MERIDEN, CT 06450 ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported Free Product Inches: Not reported

Fund Date: Not reported Fund Planned: No Fund Obligated: No Fund Outlayed: No Fund Judgment: No Fund Recovered: No Cellar Borings: False Install Micro Wells: False Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False Active: False NOV Action: None

NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$104100300 DIST/DIR: 0.468 NE ELEVATION: 140 MAP ID: N65

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)

Rev: 02/11/2014

ADDRESS: 2 MAIN STREET

ID/Status: Cleanup Initiated

MERIDEN, CT 06450 ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported

User Stamp: allison forrest/ForrestA

Date Stamp: 09/06/2013 Correspondence: Not reported Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$104238990 DIST/DIR: 0.473 ENE ELEVATION: 164 MAP ID: 66

NAME: SALVATION ARMY Rev: 02/11/2014

ADDRESS: 23 ST.CASIMER ST SALVATION ARMY

ID/Status: Lust Completed

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 6138

UST Facility Id: Not reported LUST Case Id: 34263 Lust Status: Lust Completed Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 06/24/1998 Entry Date: Not reported Site Case Id: 9804022 UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: Not reported
LUST Owner Id: Not reported
LUST Event Id: 6253

UST Event Id: 6253 Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported 2nd Contact Type: Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

164 EDR ID: S104238990 DIST/DIR: 0.473 ENE **ELEVATION: MAP ID:** 66

NAME: SALVATION ARMY Rev: 02/11/2014

ID/Status: Lust Completed ADDRESS: 23 ST.CASIMER ST SALVATION ARMY

ID/Status: 34263 MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: True Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: True

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: True Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False Responsible EMail: Not reported Resp Party Name: Not reported Resp Party Address: Not reported Resp Party City, St, Zip: Not reported Resp Party Town Number: UNKNOWN

Resp Party Phone: Not reported Resp Party Fax: Not reported Resp Party Name 2: Not reported Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 35

Follow Update: Not reported Area Lextent: Not reported Annual Precipitation: Not reported Affected Population: Not reported Population Setting: Not reported Ground Water Direction: Not reported Ground Water Gradient: Not reported

Hydro Basin: Not reported Drastic: Not reported Geo Setting: Not reported

Ground Water Classification: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$104238990 DIST/DIR: 0.473 ENE ELEVATION: 164 MAP ID: 66

NAME: SALVATION ARMY Rev: 02/11/2014

ADDRESS: 23 ST.CASIMER ST SALVATION ARMY

ID/Status: Lust Completed

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported Free Product Inches: Not reported

Fund Date: Not reported Fund Planned: No Fund Obligated: No Fund Outlayed: No Fund Judgment: No Fund Recovered: No Cellar Borings: False Install Micro Wells: False Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False Active: False NOV Action: None

NOV Action: Notice
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False

Stop All NOV Actions: False Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$104238990 DIST/DIR: 0.473 ENE ELEVATION: 164 MAP ID: 66

NAME: SALVATION ARMY Rev: 02/11/2014

ADDRESS: 23 ST.CASIMER ST SALVATION ARMY

ID/Status: Lust Completed
ID/Status: 24263

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported

Running Comments: #2 FUEL OIL, , TANK AND SOIL REMOVAL

Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S108789027 DIST/DIR: 0.480 NE **ELEVATION:** MAP ID: N67 141

02/11/2014 NAME: MERIDEN SENIOR CENTER Rev: ID/Status: Investigation ADDRESS: 22 WEST MAIN ST.

ID/Status: 28428 MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 402 UST Facility Id: 7058 LUST Case Id: 28428 Lust Status: Investigation Processing Status: Not reported

EPA Reportable: False Motor Fuel: False Diesel: False Gasoline: False Other: False

Other Release: Not reported

No Release: False Leak: False Tank: False Piping: False Overfill: False Removal: False

Incident Date: 01/13/1989 Entry Date: Not reported Site Case Id: Not reported UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: Not reported Case Log Id: Not reported Monthly Report Id: 0 UST Owner ld: 1130 LUST Owner Id: Not reported

UST Event Id: 401 Contact Info: Not reported Contact EMail: Not reported

Site Contact City, St, Zip: UNKNOWN

2nd Contact: Not reported 2nd Contact EMail: Not reported 2nd Contact Address: Not reported 2nd Contact City,St,Zip: UNKNOWN 2nd Contact Address 2: Not reported 2nd Contact City 2: Not reported

2nd Contact Phone Number: Not reported 2nd Contact Fax Number: Not reported

2nd Contact Type: Not reported

Facility City Num: 80 Site Contact: Not reported

Site Contact Address: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: S108789027 DIST/DIR: 0.480 NE **ELEVATION:** MAP ID: N67 141

02/11/2014 NAME: MERIDEN SENIOR CENTER Rev: ID/Status: Investigation

ADDRESS: 22 WEST MAIN ST. ID/Status: 28428 MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported Site Contact City 2: Not reported Site Contact Phone: Not reported Site Contact Fax: Not reported Site Contact Type: Not reported Department Contact 1: Not reported Department Contact 2: Not reported Referral Source: Not reported

Offsite Source: False Date Referred: Not reported

Emergency: False

Private Heating Fuel: False Commercial Heating Fuel: False Commercial HF < 2100 Gal.: False Commercial HF > 2100 Gal.: False Commercial HF - Size Unk: False

No LUST Site: False

Cost Recvry Prgm Candidate: False

OCSRD Complete: False Follow Up Flag: False

Alternate Water Supply: False

Relocation: False

Responsible Party: False Responsible EMail: Not reported Resp Party Name: Not reported Resp Party Address: Not reported Resp Party City, St, Zip: Not reported

Resp Party Town Number: UNKNOWN Resp Party Phone: Not reported Resp Party Fax: Not reported Resp Party Name 2: Not reported

Resp Party Address 2: Not reported Resp Party Phone 2: Not reported

Investigator Id: 14

Follow Update: Not reported Area Lextent: Not reported Annual Precipitation: Not reported Affected Population: Not reported Population Setting: Not reported Ground Water Direction: Not reported Ground Water Gradient: Not reported

Hydro Basin: Not reported Drastic: Not reported Geo Setting: Not reported

Ground Water Classification: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$108789027 DIST/DIR: 0.480 NE ELEVATION: 141 MAP ID: N67

NAME: MERIDEN SENIOR CENTER Rev: 02/11/2014

ADDRESS: 22 WEST MAIN ST. ID/Status: Investigation

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported

Ground Water Flow Direction: Not reported

Ground Water Depth: Not reported Areas Of Concern: Not reported Free Product Inches: Not reported

Fund Date: Not reported Fund Planned: No Fund Obligated: No Fund Outlayed: No Fund Judgment: No Fund Recovered: No Cellar Borings: False Install Micro Wells: False Ground Water Sample: False

Soil Sample: False Soil Gas: False Site Inspect: False Soil Excavate: False Geo Probe: False Survey: False

Potable Well Sample: False Sample MWS: False Ground Water Gauging: False

Soil Venting: False Active: False NOV Action: None

NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False

Release Invest Rpt: False DEP App Letter 1: False Correct Action Plan: False DEP App Letter 2: False Rem Sys Install: False

Rem Sys Install Date: Not reported Closure Date: Not reported Rem Sys Monitoring Rpt: False Qrtly Gwater Mon Rpts: False

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

LUST

EDR ID: \$108789027 DIST/DIR: 0.480 NE ELEVATION: 141 MAP ID: N67

NAME: MERIDEN SENIOR CENTER

ADDRESS: 22 WEST MAIN ST.

Rev: 02/11/2014

ID/Status: Investigation

ID/Status: 20/409

MERIDEN, CT 06450 ID/Status: 28428

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported

FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1015970103 DIST/DIR: 0.489 NE ELEVATION: 159 MAP ID: 68

NAME: 33 COLONY STREET Rev: 03/20/2014

ADDRESS: 15-31 CHURCH ST

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: 33 COLONY STREET

Property #: Not reported

Parcel size: .13

Property Description: Formerly commercial retail and office space owned by David Legere.

Currently a vacant lot owned by the City of Meriden.

Latitude: 41.538978 Longitude: -72.801761

HCM label: Address Matching-House Number

Map scale: Not reported

Point of reference: Center of a Facility or Station

Datum: North American Datum of 1983

ACRES property ID: 147302 Start date: Not reported Completed date: Not reported Acres cleaned up: Not reported Cleanup funding: Not reported Cleanup funding source: Not reported

Assessment funding: 900

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported Redev. funding source: Not reported Redev. funding entity name: Not reported Redevelopment start date: Not reported Assessment funding entity: EPA Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101 Ownership entity: Government Current owner: City of Meriden Did owner change: N Cleanup required: Unknown Video available: Not reported Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported IC cat. gov. controls: Not reported

IC cat. enforcement permit tools: Not reported

IC in place date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1015970103 DIST/DIR: 0.489 NE ELEVATION: 159 MAP ID: 68

NAME: 33 COLONY STREET Rev: 03/20/2014

ADDRESS: 15-31 CHURCH ST

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

IC in place: Not reported

State/tribal program date: Not reported State/tribal program ID: Not reported State/tribal NFA date: Not reported Air contaminated: Not reported Air cleaned: Not reported Asbestos found: Not reported Asbestos cleaned: Not reported

Controled substance found: Not reported

Controled substance cleaned: Not reported Drinking water affected: Not reported Drinking water cleaned: Not reported Groundwater affected: Not reported Groundwater cleaned: Not reported Lead contaminant found: Not reported Lead cleaned up: Not reported No media affected: Not reported Unknown media affected: Not reported Other cleaned up: Not reported Other metals found: Not reported Other metals cleaned: Not reported Other contaminants found: Not reported Other contaminants found: Not reported Other contams found description: Not reported

PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Soil cleaned up: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported

Cleanup other description: Not reported Num. of cleanup and re-dev. jobs: Not reported Past use greenspace acreage: Not reported Past use residential acreage: Not reported Past use commercial acreage: .13
Past use industrial acreage: Not reported Future use greenspace acreage: Not reported Future use residential acreage: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

US BROWNFIELDS

EDR ID: 1015970103 **DIST/DIR**: 0.489 NE **ELEVATION**: 159 **MAP ID**: 68

NAME: 33 COLONY STREET Rev: 03/20/2014

ADDRESS: 15-31 CHURCH ST

MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Future use commercial acreage: Not reported Future use industrial acreage: Not reported Greenspace acreage and type: Not reported Superfund Fed. landowner flag: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104563185 DIST/DIR: 0.509 NNW ELEVATION: 133 MAP ID: 69

NAME: AMERICAN OIL CHANGE CORP. Rev: 04/23/2010

ADDRESS: 321-327 WEST MAIN STREET ID/Status: 4446

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4446 Rem Master ID: 4528

PTP Id: 936

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4604 Source of referral: PTP Date Received: 8/7/1991 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 8/7/1991

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported

Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104563185 DIST/DIR: 0.509 NNW ELEVATION: 133 MAP ID: 69

NAME: AMERICAN OIL CHANGE CORP. Rev: 04/23/2010

ADDRESS: 321-327 WEST MAIN STREET ID/Status: 4446

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254248 DIST/DIR: 0.580 WSW ELEVATION: 130 MAP ID: 70

NAME: MERIDEN FOUNDRY DUMP SITE Rev: 04/23/2010

ADDRESS: COE AVENUE AND HANOVER ROAD ID/Status: 740

MERIDEN, CT

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 740
Rem Master ID: 558
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported Referral Id: 702 Source of referral: COMPLAINT Date Received: 1/31/1990

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254248 DIST/DIR: 0.580 WSW ELEVATION: 130 MAP ID: 70

NAME: MERIDEN FOUNDRY DUMP SITE Rev: 04/23/2010

ADDRESS: COE AVENUE AND HANOVER ROAD ID/Status: 740

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104563188 DIST/DIR: 0.608 NW ELEVATION: 133 MAP ID: O71

NAME: DAVELLA MOTORS, INC. Rev: 04/23/2010

ADDRESS: 41 CAPITOL AVENUE ID/Status: 4453

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4453 Rem Master ID: 4535

PTP Id: 2758

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4611 Source of referral: PTP Date Received: 7/23/1998 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 7/23/1998

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104563188 DIST/DIR: 0.608 NW ELEVATION: 133 MAP ID: O71

NAME: DAVELLA MOTORS, INC. Rev: 04/23/2010

ADDRESS: 41 CAPITOL AVENUE ID/Status: 4453

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188032 **DIST/DIR:** 0.630 East **ELEVATION:** 279 **MAP ID:** 72

NAME: GUEST COMPANY INC. Rev: 04/23/2010

ADDRESS: 49 ELM STREET ID/Status: 4458

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4458 Rem Master ID: 4540

PTP Id: 949

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4616 Source of referral: PTP Date Received: 6/7/1994 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 6/7/1994

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188032 **DIST/DIR:** 0.630 East **ELEVATION:** 279 **MAP ID:** 72

NAME: GUEST COMPANY INC. Rev: 04/23/2010

ADDRESS: 49 ELM STREET ID/Status: 4458

MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

ID/Status: 1947

EDR ID: \$104254247 DIST/DIR: 0.632 NW ELEVATION: 127 MAP ID: O73

NAME: MAGNAKLEEN Rev: 04/23/2010

ADDRESS: 54 CAPITOL AVENUE

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1947
Rem Master ID: 2314
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: CHLR VOC, HYDRO/OIL Disposal: DRYWELL, SPILL/DUMP, UST

Sample Data Available: False Updated By: POST, M. Update Program: CORE Updated: 8/17/1994 Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 1806

Source of referral: REMEDIAL
Date Received: 8/17/1994
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported
Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

ID/Status: 1947

EDR ID: \$104254247 DIST/DIR: 0.632 NW ELEVATION: 127 MAP ID: O73

NAME: MAGNAKLEEN Rev: 04/23/2010

ADDRESS: 54 CAPITOL AVENUE

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported

Comments: Not reported

SDADB: Waste Id: 5

Waste Type: CHLR VOC

Description: Chlorinated Volatile Organic Compounds

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254256 DIST/DIR: 0.688 NNW ELEVATION: 132 MAP ID: 74

NAME: RAGEDINO Rev: 04/23/2010

ADDRESS: 4-10 AMES AVENUE ID/Status: 762

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 762
Rem Master ID: 580
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported Ground Water Quality Classification: GB Surface Water Quality Classification: B

Waste Type: Not reported Disposal: Not reported Sample Data Available: False Updated By: NEVILLE, T. Update Program: D&A Updated: 5/27/1997 Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported Referral Id: 723 Source of referral: COMPLAINT Date Received: 1/31/1990 Staff Assigned: NEVILLE T

Staff Assigned: NEVILLE, T. Remediation Program: D&A Date dt_assigned: 5/9/1997

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254256 DIST/DIR: 0.688 NNW ELEVATION: 132 MAP ID: 74

NAME: RAGEDINO Rev: 04/23/2010

ADDRESS: 4-10 AMES AVENUE ID/Status: 762

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254259 DIST/DIR: 0.733 ESE ELEVATION: 303 MAP ID: 75

NAME: THE EUREKA PRESS INC. Rev: 04/23/2010

ADDRESS: 264 BROAD STREET ID/Status: 875

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 875
Rem Master ID: 1293
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: WW SLUDGES
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 827 Source of referral: ISWS

Date Received: 5/18/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254259 DIST/DIR: 0.733 ESE ELEVATION: 303 MAP ID: 75

NAME: THE EUREKA PRESS INC. Rev: 04/23/2010

ADDRESS: 264 BROAD STREET ID/Status: 875

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CORRACTS

EDR ID: 1000235508 DIST/DIR: 0.744 NE ELEVATION: 150 MAP ID: P76

NAME: QUINLAN RUSSELL (J. B. COGGINS) Rev: 03/11/2014

ADDRESS: 5 CROSS ST

MERIDEN, CT NEW HAVEN

SOURCE: US EPA

CORRACTS:

EPA ID: CTD000842906

EPA Region: 01

Area Name: ENTIRE FACILITY

Actual Date: 19930910

Action: CA075ME - CA Prioritization, Facility or area was assigned a medium

corrective action priority
NAICS Code(s): Not reported
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CTD000842906

EPA Region: 01

Area Name: ENTIRE FACILITY

Actual Date: 19930827

Action: CA050RF - RFA Completed, Assessment was an RFA

NAICS Code(s): Not reported Original schedule date: Not reported Schedule end date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254245 DIST/DIR: 0.744 NE ELEVATION: 150 MAP ID: P77

NAME: J. B. COGGINS CO. Rev: 04/23/2010

ADDRESS: 5 CROSS STREET ID/Status: 228

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 228
Rem Master ID: 328
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: 41.55

Latitude: 41.55 Longitude: -72.7917

Lat/Long Determined By: UNK

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: METALS, MOH SLUDGE Disposal: LAGOON, IMPOUNDMENT

Sample Data Available: False Updated By: Not reported Update Program: Not reported Updated: Not reported Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: True Site Archived from CERCLIS: False Archive Date: Not reported

EPA's Removal at Site: False Deferred to another EPA Program: True

EPA Env Priority Initiative Site: False

Federal Facility: False

Site on EPA's National Priority List: False

Part of an NPL site: False RCRA Generator Status: GEN RCRA Permit Status: Not reported Referral Id: 223 Source of referral: SUPERFUND

Date Received: 7/6/1987 Staff Assigned: DEP

Remediation Program: SUPERFUND

Date dt_assigned: 7/6/1987

Remediation Complete Approved DEP/Verified by LEP: 7/6/1987

Outcome: INVENTORY
Remedial Id: Not reported
PTP Id: Not reported

Remediation Program: Not reported

Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254245 DIST/DIR: 0.744 NE ELEVATION: 150 MAP ID: P77

NAME: J. B. COGGINS CO. Rev: 04/23/2010

ADDRESS: 5 CROSS STREET ID/Status: 228

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

SDADB: Waste Id: 14

Waste Type: METALS Description: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SHWS

EDR ID: \$104254245 **DIST/DIR:** 0.744 NE **ELEVATION:** 150 **MAP ID:** P77

NAME: J. B. COGGINS CO. Rev: 04/23/2010

ADDRESS: 5 CROSS STREET

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

SHWS: State ID: 228

PTP Id Number: Not reported WPC Number: Not reported EPA ID: CTD000842906 PO Office: Not reported Lat/Long: 41.55/-72.7917 Location Method: UNK

Groundwater Class: Not reported

Surface Water Qualification: Not reported Waste Category: METALS, MOH SLUDGE Disposal Method: LAGOON, IMPOUNDMENT

Sample: False

Other Dept of Env. Protection: RCRA

Updated By: Not reported Update Program: Not reported Date Updated: Not reported

Duplicate: False Program: SUPERFUND Inventory Date: 7/6/1987 On Inventory: True Assessed: True 87 Group: RC

87 Origin: INVENTORY

On 87: True

Comments: ALL WASTE REMOVED PURSUANT TO CT HAZARDOUS WASTE MANAGEMENT

REGULATIONS IN 6/12/85. ADDRESS ON TRANSFER FORM 531 CROSS STREET.

5-31 CROSS STREET

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188025 **DIST/DIR:** 0.754 East **ELEVATION:** 278 **MAP ID:** 78

NAME: CITY OF MERIDEN Rev: 04/23/2010

ADDRESS: 41 HIGH STREET ID/Status: 4451

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4451 Rem Master ID: 4533

PTP Id: 940

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4609 Source of referral: PTP Date Received: 11/1/1988 Staff Assigned: Not reported Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 11/1/1988

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104188025 **DIST/DIR:** 0.754 East **ELEVATION:** 278 **MAP ID:** 78

NAME: CITY OF MERIDEN Rev: 04/23/2010

ADDRESS: 41 HIGH STREET ID/Status: 4451

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: S104254257 DIST/DIR: 0.840 ESE **ELEVATION: MAP ID:** 79 275

SILVER CITY GLASS NAME: Rev: 04/23/2010

ID/Status: 753 ADDRESS: 122 CHARLES STREET

MERIDEN, CT

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 753 Rem Master ID: 571 PTP Id: Not reported WPC Number: Not reported Postal District: Not reported Latitude: 41.535

Longitude: -72.7917 Lat/Long Determined By: UNK

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: METALS, CYANIDE

Disposal: SEPTIC Sample Data Available: False Updated By: BOTTI, T. Update Program: D&A Updated: 4/25/1996 Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: True Site Archived from CERCLIS: False Archive Date: Not reported

EPA's Removal at Site: False Deferred to another EPA Program: False EPA Env Priority Initiative Site: False

Federal Facility: False

Site on EPA's National Priority List: False

Part of an NPL site: False

RCRA Generator Status: Not reported RCRA Permit Status: Not reported Referral Id: 714

Source of referral: RCRA Date Received: 3/6/1987 Staff Assigned: BOTTI, T. Remediation Program: D&A Date dt assigned: 2/17/1989

Remediation Complete Approved DEP/Verified by LEP: 1/26/1995

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported

Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254257 DIST/DIR: 0.840 ESE ELEVATION: 275 MAP ID: 79

NAME: SILVER CITY GLASS Rev: 04/23/2010

ADDRESS: 122 CHARLES STREET ID/Status: 753

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported

Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB: Waste Id: 14

Waste Type: METALS Description: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CORRACTS

EDR ID: 1000280297 **DIST/DIR:** 0.919 ENE **ELEVATION:** 158 **MAP ID:** 80

NAME: MILLER CO THE Rev: 03/11/2014

ADDRESS: 99 CENTER ST

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

CORRACTS:

EPA ID: CTD001147974

EPA Region: 01

Area Name: ENTIRE FACILITY

Actual Date: 20091009

Action: CA075LO - CA Prioritization, Facility or area was assigned a low

corrective action priority NAICS Code(s): 331421

Copper Rolling, Drawing, and Extruding Original schedule date: Not reported Schedule end date: Not reported

EPA ID: CTD001147974

EPA Region: 01

Area Name: ENTIRE FACILITY

Actual Date: 20120810

Action: CA400 - Date For Remedy Selection (CM Imposed)

NAICS Code(s): 331421

Copper Rolling, Drawing, and Extruding Original schedule date: 20120810 Schedule end date: Not reported

EPA ID: CTD001147974

EPA Region: 01

Area Name: ENTIRE FACILITY Actual Date: 20120810 Action: CA550RC

NAICS Code(s): 331421

Copper Rolling, Drawing, and Extruding Original schedule date: 20120810 Schedule end date: Not reported

EPA ID: CTD001147974

EPA Region: 01

Area Name: ENTIRE FACILITY

Actual Date: 20121031

Action: CA725YE - Current Human Exposures Under Control, Yes, Current Human

Exposures Under Control has been verified

NAICS Code(s): 331421

Copper Rolling, Drawing, and Extruding Original schedule date: Not reported Schedule end date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

CORRACTS

1000280297 DIST/DIR: 0.919 ENE EDR ID: **ELEVATION:** 158 **MAP ID:** 80

NAME: MILLER CO THE 03/11/2014 Rev:

ADDRESS: 99 CENTER ST

MERIDEN, CT 06450

NEW HAVEN

SOURCE: US EPA

EPA ID: CTD001147974

EPA Region: 01

Area Name: ENTIRE FACILITY

Actual Date: 20121031

Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes, Migration of Contaminated Groundwater Under Control has been verified

NAICS Code(s): 331421 Copper Rolling, Drawing, and Extruding Original schedule date: Not reported Schedule end date: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

ID/Status: 757

EDR ID: \$104254232 DIST/DIR: 0.937 WNW ELEVATION: 137 MAP ID: 81

NAME: DUMP #3 **Rev**: 04/23/2010

ADDRESS: JOHNSON AVENUE AND SYLVAN AVENUE

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 757
Rem Master ID: 575
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported Referral Id: 718 Source of referral: COMPLAINT Date Received: 1/31/1990

Staff Assigned: Not reported Remediation Program: Not reported Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: Not reported

Outcome: Not reported Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported
Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

ID/Status: 757

EDR ID: \$104254232 DIST/DIR: 0.937 WNW ELEVATION: 137 MAP ID: 81

NAME: DUMP #3 **Rev**: 04/23/2010

ADDRESS: JOHNSON AVENUE AND SYLVAN AVENUE

MERIDEN, CT NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported Penalty assessed: Not reported Order Complete: Not reported In compliance: Not reported Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: 1000423902 DIST/DIR: 0.959 East **ELEVATION: MAP ID:** 82 278

AS YOU LIKE IT CLEANERS 04/23/2010 NAME: Rev:

ID/Status: 4448 ADDRESS: 367 E MAIN ST

MERIDEN, CT 06450

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4448 Rem Master ID: 4530 PTP ld: 3172

WPC Number: Not reported Postal District: Not reported Latitude: Not reported Longitude: Not reported

Lat/Long Determined By: Not reported

Ground Water Quality Classification: Not reported Surface Water Quality Classification: Not reported

Waste Type: Not reported Disposal: Not reported Sample Data Available: False Updated By: Not reported Update Program: Not reported Updated: Not reported Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 4606 Source of referral: PTP Date Received: 6/17/1999 Staff Assigned: FRIGON, R. L. Remediation Program: PTP Date dt assigned: Not reported

Remediation Complete Approved DEP/Verified by LEP: 6/17/1999

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported

Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: 1000423902 **DIST/DIR:** 0.959 East **ELEVATION:** 278 **MAP ID:** 82

NAME: AS YOU LIKE IT CLEANERS Rev: 04/23/2010

ADDRESS: 367 E MAIN ST ID/Status: 4448

MERIDEN, CT 06450

NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported

Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254262 DIST/DIR: 0.975 East ELEVATION: 284 MAP ID: 83

NAME: VALERIO ALBARELLO, INC. Rev: 04/23/2010

ADDRESS: 41-45 PARKER AVENUE ID/Status: 3169

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 3169
Rem Master ID: 3211
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported

Latitude: 41.532 Longitude: -72.7908

Lat/Long Determined By: UNK

Ground Water Quality Classification: GB Surface Water Quality Classification: A Waste Type: METALS, HYDRO/OIL Disposal: SPILL/DUMP, UST Sample Data Available: False

Updated By: FRIGON, R. L. Update Program: PTP
Updated: 8/1/1998
Date Created: Not reported

Date Created: Not reported

Duplicate: False

EPA CERCLIS Id: Not reported Number EPA RCRIS Id: Not reported Site on EPA's CERCLIS: Not reported Site Archived from CERCLIS: Not reported

Archive Date: Not reported

EPA's Removal at Site: Not reported

Deferred to another EPA Program: Not reported EPA Env Priority Initiative Site: Not reported

Federal Facility: Not reported

Site on EPA's National Priority List: Not reported

Part of an NPL site: Not reported RCRA Generator Status: Not reported RCRA Permit Status: Not reported

Referral Id: 2973
Source of referral: PTP
Date Received: 5/19/1998
Staff Assigned: FRIGON, R. L.
Remediation Program: PTP
Date dt assigned: 6/6/1998

Remediation Complete Approved DEP/Verified by LEP: 8/31/1998

Outcome: PTP

Remedial Id: Not reported PTP Id: Not reported

Remediation Program: Not reported Remediation Program Entered: Not reported

Target Property: 1 KING PLACE JOB: NA

MERIDEN, CT 06451

SDADB

EDR ID: \$104254262 DIST/DIR: 0.975 East ELEVATION: 284 MAP ID: 83

NAME: VALERIO ALBARELLO, INC. Rev: 04/23/2010

ADDRESS: 41-45 PARKER AVENUE ID/Status: 3169

MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported Remediation Program: Not reported Date dt_assign: Not reported Project Phase: Not reported Order issued: Not reported Order Number: Not reported Date order issued: Not reported

Remedial Investigation Start: Not reported Remedial Investigation Completed: Not reported

Remedial Design Start: Not reported Remedial Design complet: Not reported Remedial Action Start: Not reported Remedial Action Completed: Not reported Date Oper/ maintenance Started: Not reported

GW monitoring: Not reported

Remediation complete Approved DEP/Verified by LEP: Not reported

Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported

Date of Admin Appeal Ruling: Not reported Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported Date of Court Appeal: Not reported Date of Court Ruling: Not reported Date of Court Ruling: Not reported Date Order Modified: Not reported Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported

Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB: Waste Id: 14

Waste Type: METALS Description: Not reported

Database Descriptions

NPL: NPL National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices. NPL - National Priority List Proposed NPL - Proposed National Priority List Sites.

NPL Delisted: DELISTED NPL The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate. DELISTED NPL - National Priority List Deletions

CERCLIS CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL. CERCLIS - Comprehensive Environmental Response, Compensation, and Liability Information System

NFRAP: CERCLIS-NFRAP Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site. CERCLIS-NFRAP - CERCLIS No Further Remedial Action Planned

RCRA COR ACT: CORRACTS CORRACTS identifies hazardous waste handlers with RCRA corrective action activity. CORRACTS - Corrective Action Report

RCRA TSD: RCRA-TSDF RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste. RCRA-TSDF - RCRA - Treatment, Storage and Disposal

RCRA GEN: RCRA-LQG RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. RCRA-LQG - RCRA - Large Quantity Generators RCRA-SQG - RCRA - Small Quantity Generators. RCRA-CESQG - RCRA - Conditionally Exempt Small Quantity Generators.

Federal IC / EC: US ENG CONTROLS A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health. US ENG CONTROLS - Engineering Controls Sites List US INST CONTROL - Sites with Institutional Controls.

ERNS: ERNS Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances. ERNS - Emergency Response Notification System

Database Descriptions

State/Tribal CERCLIS: SHWS State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state. SHWS - Inventory of Hazardous Disposal Sites SDADB - Site Discovery and Assessment Database.

State/Tribal SWL: SWF/LF Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites. SWF/LF - List of Landfills/Transfer Stations

State/Tribal LTANKS: LUST Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state. LUST - Leaking Underground Storage Tank List INDIAN LUST R7 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R5 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R9 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R4 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R6 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R8 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R8 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R10 - Leaking Underground Storage Tanks on Indian Land. India

State/Tribal Tanks: UST Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program. UST - Underground Storage Tank Data AST - Marine Terminals and Tank Information. INDIAN UST R5 - Underground Storage Tanks on Indian Land. INDIAN UST R4 - Underground Storage Tanks on Indian Land. INDIAN UST R10 - Underground Storage Tanks on Indian Land. INDIAN UST R10 - Underground Storage Tanks on Indian Land. INDIAN UST R8 - Underground Storage Tanks on Indian Land. INDIAN UST R8 - Underground Storage Tanks on Indian Land. INDIAN UST R9 - Underground Storage Tanks on Indian Land. INDIAN UST R1 - Underground Storage Tanks on Indian Land. INDIAN UST R1 - Underground Storage Tanks on Indian Land. INDIAN UST R1 - Underground Storage Tanks on Indian Land.

State/Tribal IC / EC: AUL Environmental Land Use Restriction sites. AUL - ELUR Sites

State/Tribal VCP: VCP Sites involved in the Voluntary Remediation Program. VCP - Voluntary Remediation Sites

ST/Tribal Brownfields: BROWNFIELDS BROWNFIELDS 2 - Brownfields Inventory. A brownfield site is generally defined as "real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant or contaminanta?|" BROWNFIELDS 2 - Brownfields Inventory

US Brownfields: US BROWNFIELDS Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs. US BROWNFIELDS - A Listing of Brownfields Sites

Other Haz Sites: US CDL A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments. US CDL - Clandestine Drug Labs

Database Descriptions

Local Land Records: CT PROPERTY A listing of sites that meet the definition of a hazardous waste establishment. They can be generators, dry cleaners, furniture strippers, etc. These sites have been sold to another owner. CT PROPERTY - Property Transfer Filings

Spills: HMIRS Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT. HMIRS - Hazardous Materials Information Reporting System SPILLS - Oil & Chemical Spill Database. SPILLS 90 - SPILLS90 data from FirstSearch.

Other: RCRA NonGen / NLR RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste. RCRA NonGen / NLR - RCRA - Non Generators TRIS - Toxic Chemical Release Inventory System. TSCA - Toxic Substances Control Act. FTTS - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act). FTTS INSP - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act). SSTS - Section 7 Tracking Systems. ICIS - Integrated Compliance Information System. PADS - PCB Activity Database System. MLTS - Material Licensing Tracking System. RADINFO - Radiation Information Database. FINDS - Facility Index System/Facility Registry System. RAATS - RCRA Administrative Action Tracking System. BRS - Biennial Reporting System. LWDS - Connecticut Leachate and Wastewater Discharge Sites. CT MANIFEST - Hazardous Waste Manifest Data. INDIAN RESERV - Indian Reservations. US AIRS (AFS) - Aerometric Information Retrieval System Facility Subsystem (AFS). PRP - Potentially Responsible Parties. CPCS - Contaminated or Potentially Contaminated Sites. FEDLAND - Federal and Indian Lands. US AIRS MINOR - Air Facility System Data.

Database Sources

NPL: EPA					
	Updated Quarterly				
NPL Delisted: EPA					
	Updated Quarterly				
CERCLIS: EPA					
	Updated Quarterly				
NFRAP: EPA					
	Updated Quarterly				
RCRA COR ACT: EPA					
	Updated Quarterly				
RCRA TSD: Environmental Protection Agency					
	Updated Quarterly				
RCRA GEN: Environmental Protection Agency					
	Updated Quarterly				
Federal IC / EC: Environ	mental Protection Agency				
	Varies				
ERNS: National Respon	se Center, United States Coast Guard				
	Updated Annually				
State/Tribal CERCLIS: D	Department of Energy & Environmental Protection				
	No Update Planned				
State/Tribal SWL: Depar	tment of Energy & Environmental Protection				
	Updated Annually				
State/Tribal LTANKS: De	epartment of Energy & Environmental Protection				
	Updated Semi-Annually				
State/Tribal Tanks: Depa	artment of Energy & Environmental Protection				

Updated Semi-Annually

Database Sources

State/Tribal IC / EC: Department of Energy & Environmental Protection

Varies

State/Tribal VCP: Department of Energy & Environmental Protection

Varies

ST/Tribal Brownfields: Department of Energy & Environmental Protection Varies

US Brownfields: Environmental Protection Agency

Updated Semi-Annually

Other Haz Sites: Drug Enforcement Administration

Updated Quarterly

Local Land Records: Department of Energy & Environmental Protection

Updated Semi-Annually

Spills: U.S. Department of Transportation

Updated Annually

Other: Environmental Protection Agency

Varies

Street Name Report for Streets near the Target Property

1 KING PLACE MERIDEN, CT 06451 Target Property: JOB: NA


Street Name	Dist/Dir	Street Name	Dist/Dir
4th St	0.21 West		
Bronson Ave	0.11 South		
Butler St	0.17 ENE		
Carter Ave	0.12 West		
Carter Avenue Ext	0.21 SW		
Cherry St	0.20 ESE		
Cooper St	0.07 ESE		
Hanover St	0.09 NNW		
King PI	0.00 East		
Linsley Ave	0.09 NNW		
Madison Ave	0.18 West		
Meridian St	0.12 ESE		
N 1st St	0.22 NNW		
North Ave	0.24 NNW		
Orange St	0.00 North		
Queen St	0.06 West		
Randolph Ave	0.11 NNE		
S 1st St	0.09 NW		
S 2nd St	0.12 WNW		
S 3rd St	0.16 West		
South Ave	0.25 NNW		
Spring St	0.20 SSW		
State Hwy 71	0.06 East		
Summer PI	0.20 SSW		
Summer St	0.25 South		
Winter St	0.24 SW		

Environmental FirstSearch 1.000 Mile Radius

ASTM MAP: NPL, RCRACOR, STATES Sites



1 KING PLACE MERIDEN, CT 06451

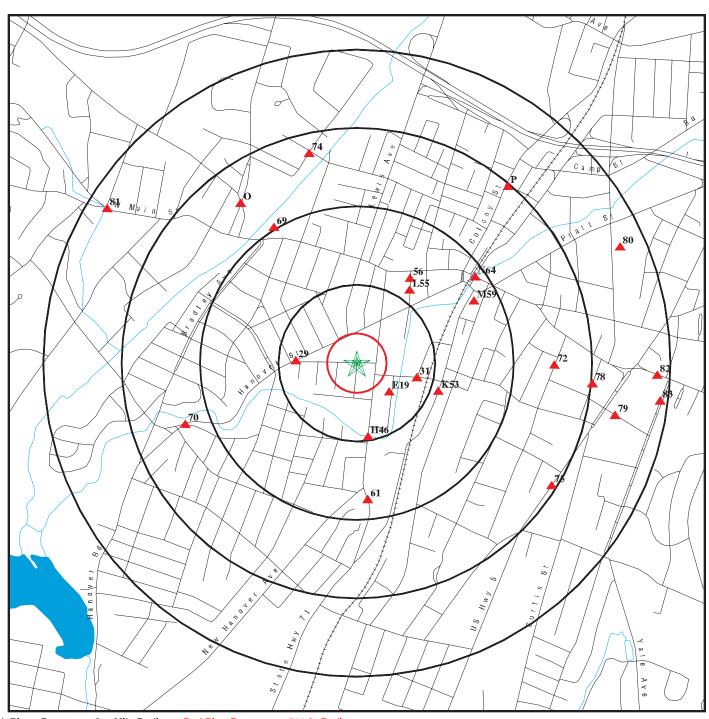

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

Target Property (Latitude: 41.5339 Longitude: 72.8092)


Identified Sites Indian Reservations BIA

Environmental FirstSearch 0.500 Mile Radius

ASTM MAP: CERCLIS, RCRATSD, LUST, SWL



1 KING PLACE MERIDEN, CT 06451

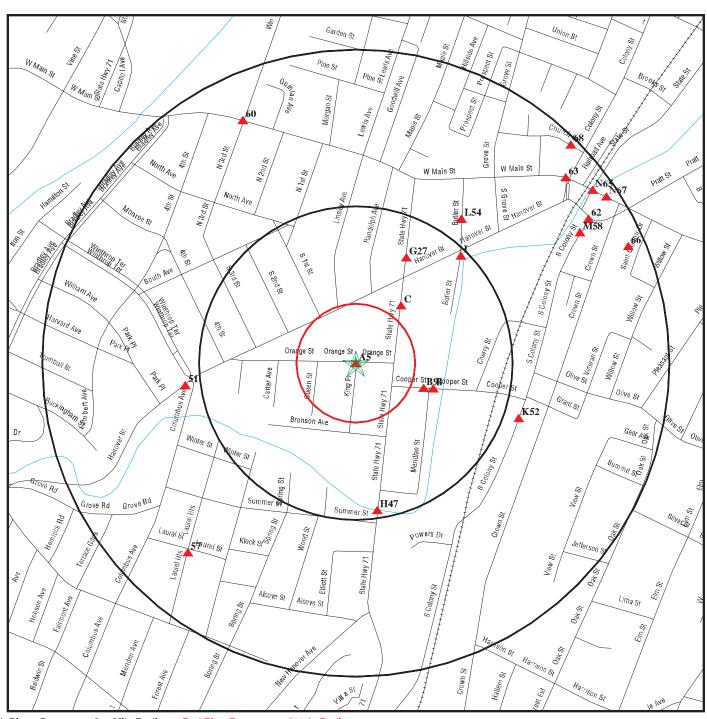

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

Target Property (Latitude: 41.5339 Longitude: 72.8092)

Identified Sites


Indian Reservations BIA

Environmental FirstSearch 0.25 Mile Radius

ASTM MAP: RCRAGEN, ERNS, UST, FED IC/EC, METH LABS



1 KING PLACE MERIDEN, CT 06451

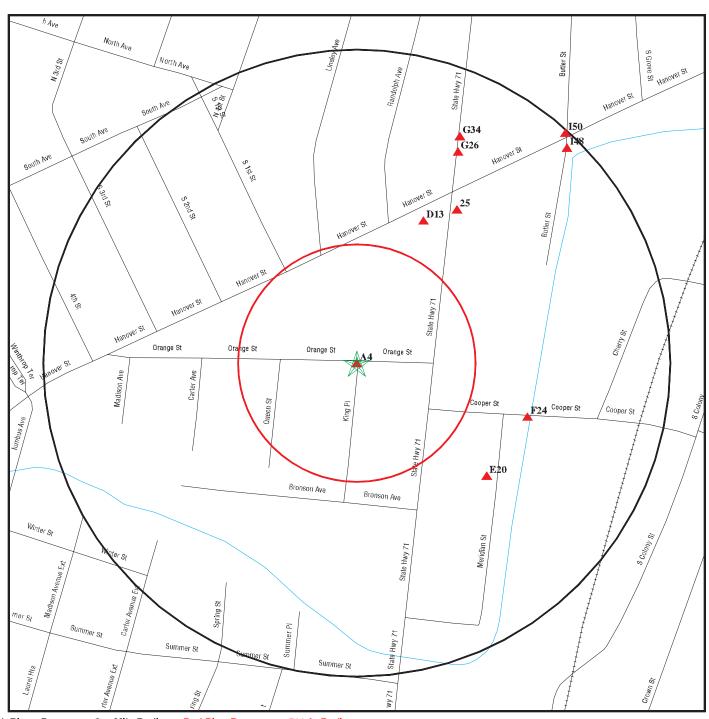

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

Target Property (Latitude: 41.5339 Longitude: 72.8092)

Identified Sites


Indian Reservations BIA

Environmental FirstSearch 0.25 Mile Radius

Non ASTM Map, Spills, FINDS



1 KING PLACE MERIDEN, CT 06451

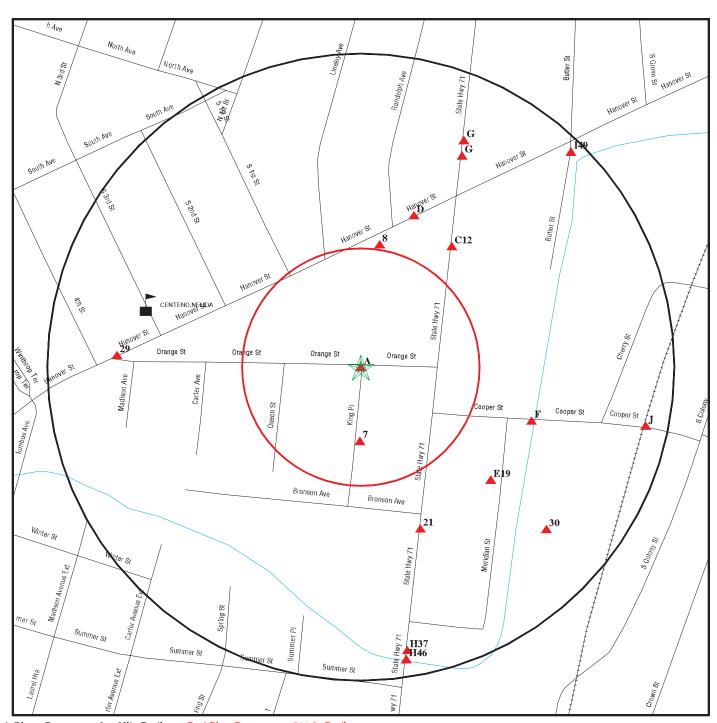

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

- Target Property (Latitude: 41.5339 Longitude: 72.8092)
- **Identified Sites**


Indian Reservations BIA

Sensitive Receptors





1 KING PLACE MERIDEN, CT 06451

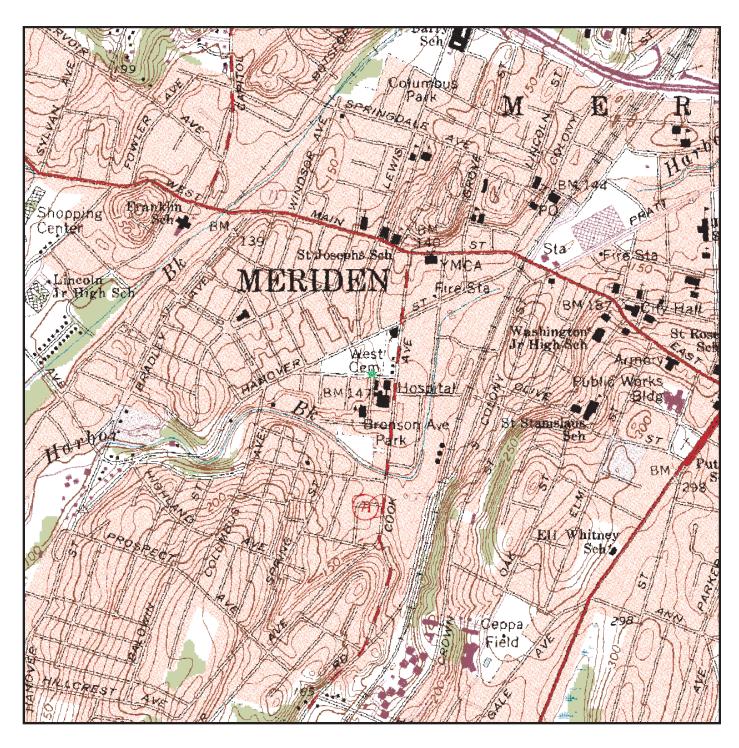

Map Image Position: TP

Map Reference Code & Name: 41072-E7 Meriden

Map State(s): CT Modified Date: 1992

Appendix D: CTD EEP List of Contaminated or Potentially Contaminated Sites

List of Contaminated or Potentially Contaminated Sites

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

Post
Remedial
Investigation Remediation Monitoring Remediation

<u>Name</u>	<u>Address</u>	Site Definition	Started	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
Abs Pumps, Inc.	140 Pond View Drive	Property Transfer – Form III Investigation started	9/19/2011					
Active Auto Exxon (danby's Service Station)	1100 East Main Street	Leaking Underground Storage Tanks – Completed						
Agc Inc.	106 Evansville Ave.	Inventory of Hazardous Waste Disposal Sites						
Agc, Inc.	106 Evansville Avenue	Leaking Underground Storage Tanks – Completed						
Agc, Incorporated	106 Evansville Avenue	Property Transfer – Form III Remediation Started		5/28/2016				
Agc, Incorporated	106 Evansville Avenue	Voluntary Remediation: CGS 22a 133x Investigation started	9/3/2009					
Algonquin Gas Transmission	1401 North Colony Road	Voluntary Remediation: CGS 22a 133x Investigation started	6/11/1996					
Algonquin Gas Transmission Co.	1401 No. Colony Rd.	Leaking Underground Storage Tanks – Rem. Started						
Algonquin Gas Transmission Company	1401 North Colony Road	Property Transfer – Form III Investigation started	10/22/2002					
Amf Cuno	400 Research Parkway	Property Transfer – Form III Investigation started	7/31/2009					
Antonowicz Residence	72 Jerome Avenue	Leaking Underground Storage Tanks – Pending						
Apa Transport Facility	475 Research Parkway	Voluntary Remediation: CGS 22a 133x Investigation started	12/16/2002					
Aplicare, Inc.	550 Research Parkway	Property Transfer – Form III Investigation started	3/15/2012					
As U Like It Cleaners	518 West Main Street	Inventory of Hazardous Waste Disposal Sites						
As U Like It Cleaners	530 West Main St.	Leaking Underground Storage Tanks – Pending						

Monday, February 10, 2014 Page 156 of 219

List of Contaminated or Potentially Contaminated Sites

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

		1 0st	
		<u>Remedial</u>	
Investigation	Remediation	<u>Monitoring</u>	Remediation

N	A 4.4	Cita Dafinitian	<u>Started</u>	<u>Remediation</u> <u>Started</u>	Monitoring Started	<u>Remediation</u>	ELUR	ELUR Type
<u>Name</u>	<u>Address</u>	Site Definition	Startea	Startea	Startea	<u>Completed</u>	ELUK	ELUK Type
As You Like It Cleaners Of Meriden	367 East Main Street	Property Transfer – Form III Investigation started	9/7/1999					
As-u-like-it Cleaners	367 East Main Street	Property Transfer – Form III Investigation started	1/7/2008					
At&t Meriden Wc (#7807)	1441 North Colony Raod	Leaking Underground Storage Tanks – Completed						
At&t Meriden Co #7801	27 Butler Street	Leaking Underground Storage Tanks – Investigation						
Atlas Container Corporation	119 Empire Avenue	CERCLIS						
Atlas-aero Corporation	85 Tremont Street	Property Transfer – Form III Investigation started	6/10/2003					
Bertha Southland	156 Balwin St.	Leaking Underground Storage Tanks – Completed						
Boucher's Service Station	652 W. Main Street	Leaking Underground Storage Tanks – Investigation						
Broad Street Sunoco	143 Broad Street	Leaking Underground Storage Tanks – Completed						
C.n Flagg & Co., Inc. (former Edge-tek)	450 Murdock Avenue	Leaking Underground Storage Tanks – Rem. Started						
Cabin Restaurant / Anthony Paguni	Colony Street, Brooks Street	Leaking Underground Storage Tanks – Rem. Started						
Capital Car Wash	365 South Broad Street	Leaking Underground Storage Tanks – Rem. Started						
Carrabetta Enterprise Apts.	Stoddard Rd.	Leaking Underground Storage Tanks – Completed						
Carrol Kowalski	46 Leslie Drive	Leaking Underground Storage Tanks – Completed						
Central Connecticut Volvo (former Salka And Sons, Inc.)	30 Pomeroy Avenue	Leaking Underground Storage Tanks – Rem. Started						

Monday, February 10, 2014

Page 157 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

Post
Remedial
Investigation Remediation Monitoring Remediation

<u>Name</u>	<u>Address</u>	Site Definition	Started	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
City Of Meriden, Bob Mercaldi	Silver Lake Pump Station, Silver Lake Road	Leaking Underground Storage Tanks – Completed						
Cl&p	56 Cooper Street	Property Transfer – Form III Investigation started	3/21/2007					
Colonial Custom Cleaners	9 Butler Street	Property Transfer – Form III						
Colony Market	640 Old Colony Road	Leaking Underground Storage Tanks – Rem. Started						
Connecticut Color, Inc	127 Pomeroy Avenue	Property Transfer – Form III Investigation started	3/25/2010					
Connecticut Color, Inc.	127 Pomeroy Avenue	Property Transfer – Form III Investigation started	3/10/2010					
Cook Residence	691 Paddock Ave.	Leaking Underground Storage Tanks – Completed						
Coscuna Property	137 Atkins St.	Leaking Underground Storage Tanks – Pending						
Cox Cable	687 East Main Street	Leaking Underground Storage Tanks – Completed						
Crc Chrome Corporation	169-r Pratt Street	Property Transfer – Form III						
Crown Plastics	900 Old Colony Road	Inventory of Hazardous Waste Disposal Sites						
Crown Plastics, Inc.	896 Old Colony Road (aka 900 Old Colony Road)	Property Transfer – Form III Investigation started	3/25/1999					
Ct Dot	265 Cook Avenue	Leaking Underground Storage Tanks – Pending						
Ct Dot	Rte. 5 & Rte. 15	Leaking Underground Storage Tanks – Completed						
Ct. National Bank	1 West Main St.	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 158 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

PostRemedialInvestigationRemediationMonitoringRemediation

<u>Name</u>	<u>Address</u>	Site Definition	<u>Started</u>	<u>Started</u>	<u>Started</u>	Completed	<u>ELUR</u>	ELUR Type
Cumberland Farms #668	937 Broad Street	Leaking Underground Storage Tanks – Completed						_
Cumberland Farms, Inc, Station 649	1087 Old Colony Road	Leaking Underground Storage Tanks – Completed						
Cuno Facility (former)	Carl Ave.	Leaking Underground Storage Tanks – Pending						
Cuno Incorporated	400 Research Parkway	CERCLIS						
Cuno, Inc.	400 Research Parkway	Inventory of Hazardous Waste Disposal Sites						
Cvs - Meriden - Bob Contact	839 East Main Street	Leaking Underground Storage Tanks – Completed						
Danby's A-1 Gulf	872 East Main Street To 882 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
Danby's Gulf	1125 East Main Street	Leaking Underground Storage Tanks – Investigation						
Dcys Altobello Center	1 Undercliff Road	Leaking Underground Storage Tanks – Completed						
Dps Police Academy	285 Preston Ave.	Leaking Underground Storage Tanks – Completed						
Dr Mal Damisuk	111 Hillcrest Terrace	Leaking Underground Storage Tanks – Completed						
Dr. Hamp Pratt	108 Hillcrest Terrace	Leaking Underground Storage Tanks – Completed						
Dry Cleaners & Petrol Plus Gas Station (former Amoco)	885-889, 893, 903 & 927 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
East Main Street Sunoco (former Dry Cleaners)	893 East Main Street To 903 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
Esposito Automotive	394 West Main Street	Property Transfer – Form III Investigation started	9/27/2007					

Monday, February 10, 2014 Page 159 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

PostRemedialInvestigationRemediationMonitoringRemediation

<u>Name</u>	<u>Address</u>	Site Definition	<u>Started</u>	<u>Started</u>	<u>Started</u>	Completed	<u>ELUR</u>	ELUR Type
Eyelet Specialties	North Brown St.	Leaking Underground Storage Tanks – Completed						
E-z Mart (former Petro Plus)	271 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
Fas Mart #314	1101 East Main Street	Voluntary Remediation: CGS 22a 133x						
Fas Mart #314 (former Db #917 And Ct Petroleum Marketers, In		Leaking Underground Storage Tanks – Completed						
Food Bag (citgo)	561 West Main Street	Leaking Underground Storage Tanks – Rem. Started						
Former Gas Station	978 Broad Street	Leaking Underground Storage Tanks – Pending						
Former O'laughlin Property	137 Atkins St	Leaking Underground Storage Tanks – Completed						
Frank Davella, Owner	387 West Main St.	Leaking Underground Storage Tanks – Completed						
G.t Tires	155 Colony Street	Leaking Underground Storage Tanks – Completed						
Geer Residence	126 Atkins St	Leaking Underground Storage Tanks – Pending						
Getty Petroleum	213 Colony Street	Property Transfer – Form III Remediation Started		1/15/2013				
Getty Service Station #590	934 East Main Street	Leaking Underground Storage Tanks – Completed						
Giovanni Residence	56 Harness Drive	Leaking Underground Storage Tanks – Completed						
Gr Cummings Co.	198 - 210 State Street	Leaking Underground Storage Tanks – Investigation						
Guida's Dairy	1355 North Broad Street	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 160 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

		Post	
		Remedial	
Investigation	Remediation	Monitoring	Remediation
~ .		~ *	

<u>Name</u>	<u>Address</u>	Site Definition	<u>Started</u>	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
Guida-siebert Co. / City Of Meriden	1331-1355 North Broad Steet	Property Transfer – Form III Remediation Complete	1/27/1999			1/28/2008	NO	
Gvo #683 (former Getty Station #6832)	407 West Main Street	Leaking Underground Storage Tanks – Rem. Started						
H. Comp Centers	328 Kensington Rd.	Leaking Underground Storage Tanks – Completed						
H.c.s. Enterprises, Llc	293 West Main Street	Leaking Underground Storage Tanks – Completed						
Hanover Towers	76 Butler Street	Leaking Underground Storage Tanks – Completed						
Hawthorne Reality (former Litterbug Inc.)	784 Old Colony Road	Leaking Underground Storage Tanks – Completed						
Henny Penny (formerly Vinnie's Auto)	2 Main Street	Leaking Underground Storage Tanks – Rem. Started						
Henny-penney Gasoline Service Station (bob's Garage)	446 North Colony Street	Leaking Underground Storage Tanks – Rem. Started						
Horace C. Wilcox Technical High School	298 Oregon Road	Leaking Underground Storage Tanks – Completed						
Insilco	160 Corporate Court	Property Transfer – Form III Investigation started	2/10/2011					
Insilco	550 Research Parkway	Property Transfer – Form III Investigation started	2/10/2011					
Insilco Corp.	500 South Broad Street	Inventory of Hazardous Waste Disposal Sites						
Insilco Corp.	500 South Broad Street	Property Transfer – Form III Investigation started	10/30/2001					
Insilco Corp.	550/590 Research Parkway	Property Transfer – Form III						
International Silver Company, Factory H	104 Butler Street	Voluntary Remediation: CGS 22a 133x Remediation Started	a 12/20/2011	5/3/2012				

Monday, February 10, 2014

Page 161 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

PostRemedialInvestigationRemediationMonitoringRemediation

<u>Name</u>	<u>Address</u>	Site Definition	<u>Started</u>	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
International Silver Company, Factory H	77 Cooper Street	Voluntary Remediation: CGS 22a 133x Remediation Started	12/20/2011	5/3/2012				
Intersection Of W. Main & Centennial	Intersection Of W. Main & Centennial	Leaking Underground Storage Tanks – Pending						
J. B. Coggins Co.	5 Cross Street	Inventory of Hazardous Waste Disposal Sites						
Jbcm Co. (j. B. Coggins Co.)	5-31 Cross Street	Property Transfer – Form III						
Joanel Labs	551 Center St.	Leaking Underground Storage Tanks – Completed						
Joe Giannetti	71 Pratt St	Leaking Underground Storage Tanks – Completed						
John Barry School	Unknown	Leaking Underground Storage Tanks – Completed						
Kenneth Hall	436 Preston Ave	Leaking Underground Storage Tanks – Completed						
Kings Cleaners & Laundry Cente	er 326 Center Street / 142-144 Camp Street	Property Transfer – Form III Investigation started	5/30/1997					
Kogut Florist & Garden Center, Inc.	50 Yale Avenue	Leaking Underground Storage Tanks – Completed						
Kwik Mart	80 Cook Ave.	Leaking Underground Storage Tanks – Rem. Started						
Litterbug, Inc.	784 Old Colony Road	Property Transfer – Form III Investigation started	1/5/2011					
Lockhart Residence	48 Laurel Heights	Leaking Underground Storage Tanks – Pending						
Malerba Service Station	155 Colony Street	Leaking Underground Storage Tanks – Completed						
Marian Rogus (home Owner)	58 Fremont St	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 162 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

Post Remedial

			Investigation	Remediation	<u>Kemeuui</u> Monitorina	D 1: 4:		
<u>Name</u>	<u>Address</u>	Site Definition	Started	<u>Started</u>	Monitoring Started	Remediation Completed	<u>ELUR</u>	ELUR Type
Meriden Auction Rooms	381 East Main Street	Leaking Underground Storage Tanks – Completed						
Meriden Enterprise Center	289 & 290 Pratt Street	Property Transfer – Form III Remediation Started	5/28/2004	5/16/2006				
Meriden Hub	1 & 77 State Street & 30 & 50 East Main St	Voluntary Remediation: CGS 22a. 133x Remediation Started	8/1/2008	6/29/2012				
Meriden Maintenance Facility	239 Miller Avenue	Leaking Underground Storage Tanks – Pending						
Meriden Markhem Airport	213 Evansville Road	Leaking Underground Storage Tanks – Investigation						
Meriden Public Schools	164 Centenial Avenue	Leaking Underground Storage Tanks – Rem. Started						
Meriden Senior Center	22 West Main St.	Leaking Underground Storage Tanks – Investigation						
Meriden Sunoco	357 West Main Street - 363 West Main Street	st Leaking Underground Storage Tanks – Investigation						
Mike Rich 0110316-537-47258 Phone	70 Holiday Hill	Leaking Underground Storage Tanks – Completed						
Miller Brothers Site	476 Pratt Street	Property Transfer – Form III Remediation Started	5/18/2010	7/25/2012				
Miller Co.	99 Center St.	Leaking Underground Storage Tanks – Completed						
Miller Company	99 Center Street	Property Transfer – Form III Remediation Started	1/9/2004	7/20/2012				
Mobil Retail Station #10750 (#06 f9v)	5- 954 East Main Street	Leaking Underground Storage Tanks – Completed						
Mobil Service Station 10705 (01- ewn)	954 East Main Street	Property Transfer – Form III Investigation started	3/17/2011					
Mobil Station (ferrigno Property)	133 Capitol Ave	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 163 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Post</u> <u>Remedial</u>

			Investigation	Remediation	<u>Monitoring</u>	Remediation		
<u>Name</u>	<u>Address</u>	Site Definition	Started	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
Mrm Industries, Inc.	508 North Colony Street	Property Transfer – Form III					YES	
Mrm Industries, Inc.	508 North Colony Street	Property Transfer – Form III						
Mulcahy Complex	294 Colony Road	Leaking Underground Storage Tanks – Rem. Started						
Napier Co. / Victoria	74 Cambridge Street	Property Transfer – Form III Investigation started	6/9/1999					
Napier Co. / Victoria	74 Cambridge Street	Property Transfer – Form III Investigation started	10/11/2000					
Napier Co. / Victoria	74 Cambridge Street	Property Transfer – Form III Remediation Complete	3/3/2003			2/15/2007	YES	No Residential Use, Inaccessible Soil, Environmentally Isolated Soil
Nieghbors To Sikorski Residence	e 132 Converse St.	Leaking Underground Storage Tanks – Pending						
North End Auto Parts	963 North Colony Road	Leaking Underground Storage Tanks – Completed						
Northeast Electrical Testing, Inc.	450 Murdock Avenue	Property Transfer – Form IV Remediation Started	4/16/2003	4/16/2003				
Office Complex	95 East Main St.	Leaking Underground Storage Tanks – Completed						
Orum Silver Company	51 South Vine Street	Property Transfer – Form III Remediation Started	4/27/2009	10/25/2012				
Paint By Wayne	1781 & 1801-1803 Broad Street	Property Transfer – Form III Investigation started	5/23/1996					
Paint By Wayne	1781-1801 North Broad Street	Property Transfer – Form III Investigation started	12/3/1999					
Paul Gullo #067092 (former Getty Service Station)	213 Colony Street	Leaking Underground Storage Tanks – Rem. Started						
Petrol Plus	1015 Broad St.	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 164 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Post</u>
<u>Remedial</u>

<u>Investigation Remediation Monitoring Remediation</u>

<u>Name</u>	<u>Address</u>	Site Definition	<u>Started</u>	<u>Started</u>	<u>Started</u>	Completed	<u>ELUR</u>	ELUR Type
Phillips Property	North Colony Road & Hicks Avenue	CERCLIS						
Phillips Property	Sw Corner North Colony Road And Hicks Road	Inventory of Hazardous Waste Disposal Sites						
Platt High School	220 Coe Avenue	Leaking Underground Storage Tanks – Completed						
Pratt Associates	290 Pratt Street	Leaking Underground Storage Tanks – Completed						
Production Equipment Co.	401 Liberty St.	Leaking Underground Storage Tanks – Completed						
Pyramid Technologies, Inc.	48 Elm Street	Property Transfer – Form III Investigation started	1/29/2009					
Quality Quick Lube	510 Broad St.	Leaking Underground Storage Tanks – Completed						
Quinlan Russell (j.b. Coggins)		Haz Waste Land Disposal Notifiers						
Radio Frequency Systems, Inc.	200 Pond View Drive	Property Transfer – Form III Investigation started	6/8/2012					
Robert Preect	444 North Colony Street	Leaking Underground Storage Tanks – Completed						
Roger Sherman School	Liberty St.	Leaking Underground Storage Tanks – Completed						
Safe T Tank Corporation	25 Powers Drive	Property Transfer – Form III Investigation started	10/14/2005					
Saint Johnsbury Trucking Company	1550 North Colony Road	Leaking Underground Storage Tanks – Investigation						
Salmandra Properties	328 Paddock St.	Leaking Underground Storage Tanks – Completed						
Salvation Army	23 St.casimer St Salvation Army	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 165 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

Post
Remedial
Investigation Remediation Monitoring Remediation

<u>Name</u>	<u>Address</u>	Site Definition	<u>Started</u>	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
Schiller	29 Carpenter Hights	Leaking Underground Storage Tanks – Completed						
Shell Facility #100051	934 Broad Street	Property Transfer – Form III Investigation started	5/15/2007					
Sikorski Residence	135 Atkins St.	Leaking Underground Storage Tanks – Pending						
Silver City Association (former Body Shop)	34 High Street	Property Transfer – Form III Investigation started	5/2/2000					
Silver City Autobody	11 High Street	Property Transfer – Form III Investigation started	9/22/2004					
Silver City Tire	152-160 Colony Street	Property Transfer – Form III Investigation started	10/31/2012					
Silverhill Business Center (former Ymca)	500 South Broad Street	Leaking Underground Storage Tanks – Completed						
Snet	1441 North Colony Road	Property Transfer – Form III Remediation Started	9/23/2002	10/29/2010				
Sorber Property	158 Converse St.	Leaking Underground Storage Tanks – Pending						
Specialty Printing Associates, Llo	c 127 Pomeroy Avenue	Property Transfer – Form III Investigation started	7/8/2004					
Spencer	22 Greenway PI	Leaking Underground Storage Tanks – Completed						
State Police Complex	Meriden Rd.	Leaking Underground Storage Tanks – Completed						
Stop & Shop Supermarket Co.	Parker Ave. & East Main St.	Leaking Underground Storage Tanks – Completed						
Three Guys Marketing Llc	55 Newton Street	Leaking Underground Storage Tanks – Pending						
Ti Group Automotive Systems	45 & 48 Gracey Avenue	Property Transfer – Form III Investigation started	1/12/2009					

Monday, February 10, 2014 Page 166 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

Post
Remedial
Investigation Remediation Monitoring Remediation

<u>Name</u>	<u>Address</u>	Site Definition	Started	<u>Started</u>	<u>Started</u>	<u>Completed</u>	<u>ELUR</u>	ELUR Type
Ti Group Automotive Systems, Llc	508 & 580 North Colony Street	Property Transfer – Form III						
Tom's Service Center	256 Broad St.	Leaking Underground Storage Tanks – Completed						
Tucker Mechanical Division Of J.c. Higgins Corp.	355-367 Research Parkway	Property Transfer – Form III Investigation started	9/27/2012					
United Oil Recovery Inc.	136 - 140 Gracey Avenue	Property Transfer – Form III Investigation started	5/27/2011					
United Oil Recovery Inc.	136-140 Gracey Avenue	Property Transfer – Form III Investigation started	5/27/2011					
Unknown	134 Glenhill Rd	Leaking Underground Storage Tanks – Completed						
Unknown	231 West Main Street	Leaking Underground Storage Tanks – Completed						
Unknown	Lewis & Springdale Aves.	Leaking Underground Storage Tanks – Completed						
Valerio Albarello	41 Parker Ave	Leaking Underground Storage Tanks – Completed						
Valerio Albarello, Inc.	41 Parker Avenue	Property Transfer – Form III Investigation started	2/22/2008					
Valerio Albarello, Inc.	41-45 Parker Avenue	Property Transfer – Form III Investigation started	7/21/1998					
Veterns Memorial Medical Center	r Lewis Ave Across From Meridar Square	Leaking Underground Storage Tanks – Rem. Started						
Vinnie's Sunoco	2 Main Street	Property Transfer – Form III						
Wayne Grant	100 Myren St	Leaking Underground Storage Tanks – Completed						
Westfield Care And Rehabilation Center	65 Westfield Rd.	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 167 of 219

"Hazardous Waste Facilities" as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

			Remedial		
	Investigation	Remediation	Monitoring	Remediation	
<u>l</u>	<u>Started</u>	Started	Started	Completed	<u>ELUF</u>

Post

<u>Name</u>	<u>Address</u>	Site Definition	Investigation Started	Remediation Started	Monitoring Started	Remediation Completed	ELUR	ELUR Type
Westvaco Corporation	119 & 129 Empire Avenue	Property Transfer – Form III Investigation started	1/29/1996					
Westvaco Corporation	Empire Avenue	Inventory of Hazardous Waste Disposal Sites						
Weyerhaeuser Company	119 Empire Avenue	Property Transfer – Form III Investigation started	11/14/2001					
Yellow Cab Co.	877 North Colony Rd.	Leaking Underground Storage Tanks – Completed						
Zebs Auto Upholstery (former Meriden Motors)	1821 North Broad St.	Leaking Underground Storage Tanks – Completed						

Monday, February 10, 2014 Page 168 of 219

Appendix E: List of Significant Environmental Hazards Report to the CTD EEP

Ashford				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 70 Perry Hill Road	8/21/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP discussed with the environmental consultant additional sampling data obtained for nearby threatened wells that shows there was no pollution in the wells. DEP requested that the data be submitted for detailed review.	No specific abatement action necessary.
Avon				
Site/location	Date Notified	Type of Hazard	Response	Action
Avon Municipal Landfill 281 Huckleberry Hill Road	7/5/2007	Pollution was detected in a supply well but is below standards.	DEP directed the town to identify wells within 500 feet and continue to conduct an already approved landfill monitoring program.	Sampled residential wells and installed new monitoring well for landfill. Monitoring program continuing.
Mobil Service Station No. 01-363 411 West Main Street	6/9/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	The DEP directed the property owner to confirm if a neigboring supply well exists and, if so, sample the well for constituents of concern.	Access to the threatened well was not granted; sampling not done. In 2013 DEEP sampled the threatened well and no contaminants of concern were detected. Owner is conducting site investigation and remediation under the property transfer program.
Village Cleaners & Tailors 183 West Main Street	11/22/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well, identify supply wells within 500 feet, and sample any identified wells for pollutants detected at the site.	Five wells identified within 500 feet but they are upgradient and not at risk. Volatile organic compounds not detected in on-site drinking water supply well. Site is undergoing investigation and remediation under Property Transfer Program.
Barkhamsted				
Site/location	Date Notified	Type of Hazard	Response	Action
Hitchock Chair Company (Plant 2) 13 Riverton Road	7/26/2007	Petroleum above the groundwater protection criteria threatens a supply well.	DEP directed the property owner to submit a post-remedial monitoring report to document impact is not migrating off-site.	Removed impacted soil, monitoring 20 wells semi-annually for natural attenuation of petroleum hydrocarbons.
Lightstat Inc. 22 West Hill Road	5/8/2012	Pollution was detected in a drinking water well but is below standards.	DEEP directed the property owner to maintain an existing filter system and to monitor groundwater.	Owner is maintaining a filter system on the impacted well.
Lombard Ford 385 New Hartford Road	10/7/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby supply wells.	Majority of soil already removed; groundwater monitoring indicates no contaminants of concern.

Barkhamsted

List of Significant Environmental Hazards Reported to the DEP

Site/location	Date Notified	Type of Hazard	Response	Action
S & S Holding, LLC 404 New Hartford Road	1/14/2010	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to expand their inventory of water supply wells to a radius of 1000 ft and to continue to sample identified potable supply wells.	Potable supply wells continue to be monitored with no contaminants detected
Berlin				
Site/location	Date Notified	Type of Hazard	Response	Action
Best Cleaners 138 Mill Street	1/23/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP required additional sampling of a nearby identified well and identification of any other drinking water wells within 500 feet of the site.	A receptor survey was conducted and one well was identified. This well has been sampled five times in the past six years and no target analytes have been detected. Investigation has been completed and remediation is on-going at the site.
EIS Brake Parts (former) 129 Worthington Ridge	3/4/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet from the site for pollutants detected at the site.	11 potable wells were identified and 8 of them were sampled. Pollution was either not detected or detected but below standards. Monitoring program was implemented. Site issues will be addressed under Property Transfer Program.
Northeast Utilities - Berlin Campus Settling Ba	asin 10/1/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to submit a plan to identify the extent of polluted soil and to remove the polluted soil.	Warning signs were posted and fence was installed to limit the potential contact with polluted soil. Remediation of the impacted soil is overseen by the DEEP's PCB Unit.
Bethany				
Site/location	Date Notified	Type of Hazard	Response	Action
Chemtura - Bethany Agriculture R & D Facility 74 Amity Road	9/4/2007	Pollution was detected in a supply well (not used for drinking) above standards, and in another supply well below standards.	The property owner provided a survey of wells in the vicinity with the notification. DEP directed the property owner to provide additional technical information, and a work plan to sample a subset of wells identified in the vicinity of the site.	All on-site wells were resampled, including supply wells, and no chemicals of concern were detected above drinking water standards. Given this additional info, DEP concluded that it would not be necessary to sample off-site water supply wells.
Pleasant View Garage 119-127 Amity Road	5/26/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the identified nearby wells for pollutants detected at the site.	Source of pollution removed, and monitoring data shows affected wells are significantly below standards. No additional abatement action necessary.

Bethany					
Site/location	Date Notified	Type of Hazard	Response	Action	
Residence 166 Humiston Drive	12/13/2012	Pollution was detected in a drinking water well above standards.	DEEP has been notified by the current owner that the property is unoccupied. Prior to reoccupation, provisions should be made to retest and provide filtration or an alternative source of water as needed to prevent exposure to identified pollution.	166 Humiston and surrounding properties sampled for volatile organic chemicals. All wells were non-detect for the pollutant that triggered Hazard Notification.	
Bethel					
Site/location	Date Notified	Type of Hazard	Response	Action	
88 Plumtrees 88 Plumtrees Road	6/7/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	On-site and six (6) abutting potable wells analyzed for volatile organic chemicals (VOCs). None of the samples had detectable concentrations of VOCs. Additional sampling pending.	
Blackstone Industries Inc. 16 Stony Hill Road	5/12/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the two on-site supply wells and to sample the nearest, identified wells surrounding the site for pollutants detected at the site.	Source of pollution removed. 7 wells identified and 7 wells sampled; pollution not detected. Onsite groundwater monitoring program implemented.	
Mountain Laurel Plaza 66-68 Stony Hill Road	6/8/2006	Pollution was detected in a drinking water well but is below standards; pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample both on-site supply wells and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two on-site and off-site water supply wells identified. Pollution was not detected in two onsite and one off-site well tested. Monitoring program implemented.	
Parcel 82 Stony Hill Road	2/16/2007	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and the monitoring well at the septic system for pollutants detected at the site.	Property vacant. On-site well abandoned. No additional abatement action necessary.	
Bethlehem					
Site/location	Date Notified	Type of Hazard	Response	Action	
Residential Property 135 & 147 Main Street South	5/5/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the monitoring well and to sample the on-site well for pollutants detected at the site.	All wells sampled, pollution not detected or detected significantly below standards. No additional hazard abatement action necessary.	

Bloomfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Office location of The Hartford 1 Griffin Road South	11/20/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to submit a drinking water well receptor survey with a parcel map identifying drinking water supply wells; and also determine if dieldrin in groundwater is coming from an upgradient source.	Drinking water well receptor survey submitted on 2/2/10 and no threatened wells were identified. No further action necessary.
Residential Property 452 Tunxis Avenue Extension	10/26/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the owner to identify and sample wells within 500 ft and continue to monitor the onsite supply well and monitoring wells quarterly until pollution meets standards.	Impacted soil removed, passive venting system installed and monitoring wells continue to be monitored.
Bolton				
Site/location	Date Notified	Type of Hazard	Response	Action
Bolton High School 72 Brandy Street	5/4/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Four wells sampled, pollution not detected. Continuing monitoring program to be implemented.
Mike's Citgo 1135 Boston Turnpike	6/3/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site well tested and non-detect for the pollutants at the site. Four nearby wells continue to be evaluated by DEEP.
Mobil Station # 10172 (01-F9V) 129 Boston Turnpike	5/26/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	Six wells sampled. Pollution not detected or significantly below standards. Monitoring program implemented. No additional abatement action necessary.
Precision Landscaping 280 West Street	2/21/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Wells identified and sampled, pollution either not detected or detected but below standards.
Bozrah				
Site/location	Date Notified	Type of Hazard	Response	Action
Mimmo's Service Center 421 Salem Turnpike	10/18/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Three wells identified and sampled, pollution either not detected or detected but below standards. DEEP evaluating results to determine next steps.

Branford				
Site/location	Date Notified	Type of Hazard	Response	Action
Branford Landfill Tabor Drive	5/6/2003	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not actually discharge to the nearby surface water. The pollution does not in fact threaten aquatic life.	No specific hazard abatement action necessary. Monitoring to continue pursuant to Landfill requirements.
Shoreline Trailer Court Mobile Home 509-545 East Main Street	10/19/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined that remediation already in progress will address the hazard.	Site has been remediated pursuant to an engineered control that effectively eliminates direct contact with pollutants. No additional hazard abatement action necessary.
Bridgeport				
Site/location	Date Notified	Type of Hazard	Response	Action
Black Rock Ship Yard (former) 10 Brewster Street	11/14/2005	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the owner to arrange for the prospective purchaser to include evaluation of the threat to surface water and aquatic life in planned investigation and remedial activity.	Prospective purchaser backed out, property is still vacant. Groundwater threat to surface water evaluated by DEEP for site specific conditions and determined to not significantly impact surface water and aquatic life.
BP Service Station # 5089 (former) 3956 Main Street	4/3/2003	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP's Leaking Underground Tank Program is working with the property owner to investigate the site. DEP initiated an investigation of soil vapor beneath the building.	Sampling of indoor air quality shows that air pollution is not at levels that pose a significant risk. DEP letter (4/7/06) requested active groundwater remediation.
Braxton Mens Shop 1168 Stratford Avenue	2/2/2004	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Colombus Elementary School 275 George Street	9/7/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	Property owner proposed to cover polluted soil with filter fabric and clean fill to limit exposure risk as a temporary measure. DEP directed the property owner to proceed with the proposed action and provide a report of actions taken at the site.	Covered polluted soil with filter fabric and 6 inches of clean fill as interim measure. City plans to submit plan for final remedy to EPA for review and approval in October 2010.
Conco Medical 380 Horace Street	8/21/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that access to the site and polluted soils is restricted, limiting the potential for contact. DEP requested that all persons with access be made aware of the condition.	Access to polluted soil is restricted; no specific hazard abatement action necessary.
General Electric Company 1285 Boston Avenue	8/20/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the site is secure, limiting the potential for contact.	Access to polluted soil is restricted; no specific hazard abatement action necessary.

Bridgeport

Site/location	Date Notified	Type of Hazard	Response	Action
General Electric Company 1285 Boston Avenue	1/25/2007	Pollution detected in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the site is secure, limiting the potential for contact.	Access to polluted soil is restricted; no specific hazard abatement action is necessary for polluted soil.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the threat to surface water, aquatic life, and sediment quality.	Remediation pending for impacts to surface water body.
General Electric Company 1285 Boston Avenue	7/29/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the site is secure, limiting the potential for contact.	Access to polluted soil is restricted; no specific hazard abatement action is necessary for polluted soil.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the threat to surface water, aquatic life, and sediment quality.	Remediation pending for impacts to surface water body.
Hoffman Fuel Company of Bridgeport 156 East Washington Avenue	1/5/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure and post warning signs to limit unknowing access to the polluted soil until the site is cleaned up.	Access is restricted, site-wide remediation pending under Property Transfer Program.
Metro North station 2289+42	9/19/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soils are on a fenced active railroad line, limiting the potential for contact.	Warning signs will be posted and soil will be properly managed if disturbed by construction.
Post Office Arcade Mall 991-1019 Main Street	6/25/2007	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Remington Arms Company, Inc. (former) 939 Barnum Avenue	1/16/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence or secure the area to limit access to the polluted soil.	Warning signs posted, site secured and fence installed to limit the potential for contact with polluted soil.
Remington Arms Company, Inc. (former) 939 Barnum Avenue	2/5/2004	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to evaluate the nature, extent and degree of groundwater pollution to determine the threat to surface water and aquatic life near the site.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.

Bristol

Site/location	Date Notified	Type of Hazard	Response	Action
Bank of America 26 East Main Street (Forestville)	11/15/2005	Groundwater polluted with fuel oil above standards may threaten a drinking water well.	DEP directed the property owner to conduct a well receptor survey within 500 feet of the site and to sample any wells identified for petroleum compounds.	Well receptor survey was completed and no drinking water supply wells were identified. Additionally, monitoring wells were installed at the site and sampled, petroleum hydrocarbons were not detected. No further action is required.
Peabody Landscaping 53 Mines Road	10/18/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified nearby wells for pollutants detected at the site.	Wells identified and sampled. Laboratory analytical results indicated no site related pollutants detected in the supply wells.
		Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary for indoor air quality.
Pump Station 13 Julia Road	12/1/2004	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data and determined the reported pollution was not confirmed. DEP directed the property owner to sample the potentially affected wells monthly for pollutants detected at the site, and provide bottled water if needed.	Monitoring program implemented.
Yankee Gas Service Company Riverside Avenue	5/9/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact.	Polluted soil subsequently removed from site. No additional abatement action necessary.
Brookfield				
Site/location	Date Notified	Type of Hazard	Response	Action
A. J. Tuck Company 32 Tuck Road	1/3/2007	Pollution was detected in two drinking water wells but is below standards.	DEP directed the property owner to sample the on-site supply well and an off-site supply well (at 34 Tuck Rd) on a quarterly basis and to identify wells up to 500 feet away from the site.	All wells within 500 feet sampled, and pollution was either not detected or was detected but below standards. Monitoring program implemented.
Avon Auto & Equipment 303 Federal Road	6/29/2004	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data for the well and determined that pollution is not in fact present, and water is safe for human consumption.	No additional hazard abatement action necessary.
Brookfield Square 270 Federal Road	11/30/2004	Pollution was detected in a drinking water well but is below standards.	DEP is sampling adjacent wells and directed the property owner to identify wells up to 500 feet away from the site for pollutants detected at the site, and to recommend further actions.	Five of five wells sampled. Pollution was not detected or was detected significantly below standards. No additional abatement action necessary.

Brookfield

Site/location	Date Notified	Type of Hazard	Response	Action
Elmbrook Plaza 632 & 640 Federal Road	5/9/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	7 wells identified and 7 wells sampled. Pollution not detected. No additional hazard abatement action necessary.
Greentree Toyota (former) 465 Federal Road	4/27/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the on-site and nearby identified wells within 500 feet for pollutants detected at the site.	All wells sampled, pollution either not detected or detected but below standards. No additional hazard abatement action necessary. Investigation and remediation on-going at site.
Kimchuk (former) 34 Del Mar Drive	5/20/2005	Pollution was detected in a drinking water well above standards.	DEP required no action, because there is already a treatment filter on the supply well and nearby locations also have alternate supplies of potable water.	Area potable supply wells sampled. All pollution detected was below criteria or being treated. Public water supply expanded to cover the affected area.
Mobil Station #11350 (01-280) 83 Federal Road	5/20/2010	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite well and identified private wells for pollutants detected at the site.	Eight wells identified. Four wells regulated by Dept. of Public Health. Other four wells sampled. Pollution either not detected or detected below standards. Monitoring program for supply wells implemented.
Rapid Power Technologies 18 Old Grays Bridge Road	2/14/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 1000 feet away from the site for pollutants detected at the site.	No wells within 500 feet. Six wells within 1,000 feet were sampled. Pollution was not detected. Two wells sampled quarterly as required by Department of Public Health. Source of pollution removed. No additional hazard abatement action necessary.
Rapid Power Technologies (former) 58 Old Grays Bridge Road	12/29/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a fence and secure the area to limit access to the polluted soil until the site is cleaned up.	Warning sings posted. Temporary fence installed. Site secured. Personnel informed. Further actions pending.
Rapid Power Technologies (former) 58 Old Grays Bridge Road	4/3/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, install a fence to limit access to the polluted soil until the site is cleaned up, and to submit a plan to eliminate the risk to human health.	Warning sings posted. Temporary fence installed. Site secured. Personnel informed. Further actions pending.
Residential Property 5 Hidden Brook Drive	12/28/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed sampling data. Pollution in the drinking water well was not detected. DEP directed the property owner to proceed with removal of polluted soils, re-test the drinking water well, and report soil and groundwater post-remediation results.	Polluted soil removed. Pollution not detected in water supply well on-site. Additional abatement activities completed for site. Results pending.

Brookfield

Site/location	Date Notified	Type of Hazard	Response	Action
Shell Facility #100058 138 Federal Road	12/2/2011	Pollution was detected in drinking water wells, with some above standards and some below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the threatened wells for the pollutants detected at the site.	7 wells identified and 1 (on-site) well sampled. Pollution either not detected or detected below standards. 1 well owner denied access. 1 well is upgradient. Pollution not detected in 4 other wells. Monitoring program implemented for onsite well.
Shell Facility #136291 49 Federal Road	1/10/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	All wells have been sampled with varying levels of pollution detected. The property owner, under consent order with DEP, has implemented a program to monitor impacted wells and maintain filter systems.
Shell Facility #136291 (former) 49 Federal Road	7/7/2009	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide an alternate supply of potable water for polluted on-site water supply well and to continue monitoring this well on a quarterly basis.	On-site well sampled; pollution detected but below action levels. Monitoring program implemented.
Ship Shape Cleaners (Former) 106 Federal Road	1/8/2013	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP reviewed information provided and directed the property owner to continue with planned vapor mitigation and monitoring and groundwater treatment and monitoring.	Source of pollution remediated. Vent system installed to prevent impact on indoor air quality. Monitoring program implemented for groundwater and soil vapor.
Shopping Plaza 106 Federal Road	5/8/2008	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the on-site water supply well and two nearby water supply wells on a quarterly basis for the pollutants detected at the site.	Building demolished in 2011. Source of pollution removed. Water supply wells abandoned and affected sites connected to public water in early 2012. No additional abatement actions necessary.
Shopping Plaza 106 Federal Road	5/30/2006	Pollution was detected in a drinking water well above standards. Polluted groundwater and soil beneath an occupied building could affect indoor air quality.	DEP reviewed information provided and determined the affected well already has a monitored treatment system. DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Building demolished in 2011, eliminating risk to indoor air. Source of pollution removed. Water supply wells abandoned and affected sites connected to public water in early 2012. No additional abatement actions necessary.
ShopRite Plaza 143 Federal Road	8/30/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified wells within 500 feet for pollutants detected at the site.	8 wells within 500 ft. 2 public wells monitored by DPH. Pollution detected in 2 supply wells below action level. Filter systems installed. 4 other private wells tested; pollution not detected. Monitoring program for groundwater and supply wells.
Sunland Marine 419 Federal Road	8/21/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site.	On-site supply well and four monitoring wells sampled. Pollution not detected. No additional abatement action necessary.

Brookfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Texaco Facility #100058 138 Federal Road	1/10/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	7 wells identified and 1 (on-site) well sampled. Pollution either not detected or detected below standards. 1 well owner denied access. 1 well is upgradient. Pollution not detected in 4 other wells. Monitoring program implemented for onsite well.
Wentworth Laboratories 500 Federal Road	9/26/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the onsite supply well and identify wells up to 500 feet away from the site.	Drinking water well re-sampled and inventory of supply wells conducted. Re-sampling of well confirmed low level of Barium, significantly below standards. No additional sampling necessary for hazard evaluation or abatement.
Brooklyn				
Site/location	Date Notified	Type of Hazard	Response	Action
Eggs, Inc. Route 205 & Vina Lane	5/27/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Well potentially at risk is connected to public water; no other wells known to be at risk.
Saveway Petroleum 49 South Main Street	6/14/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample six nearby drinking water wells for volatile organic compounds and petroleum hydrocarbons.	## wells identified and # wells sampled, pollution either not detected or detected but below standards. [Monitoring program implemented.]
Burlington				
Site/location	Date Notified	Type of Hazard	Response	Action
Crescent Real Estate (Manufacturing) 700 George Washington Turnpike	6/22/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample monitoring wells for contaminants of concern.	Monitoring well did not contain contaminants of concern.
Canaan				
Site/location	Date Notified	Type of Hazard	Response	Action
Falls Village Citgo, (PC#007710) Route 7 & Route 63 (Intersection)	3/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well on a quarterly basis until remediation of the site is complete and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Nearby wells tested and no pollution detected. Quarterly monitoring program on-going for onsite supply well, monitoring wells, and surface water. Dept. of Public Health also reviewing data.

Canaan					
Site/location	Date Notified	Type of Hazard	Response	Action	
Hitchcock Brothers, Inc. 78 High Street	2/21/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed potable water supply well sampling data. Pollution is not in fact present in the well and does not pose a risk to supply wells.	Monitoring data shows threatened well not affected. No additional hazard abatement action necessary.	
Canterbury					
Site/location	Date Notified	Type of Hazard	Response	Action	
Willimantic Waste Paper Co. 133 Packer Road	5/27/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Consultant identified potable wells within 500 foot radius. Sampled 5 wells; one additional house appeared to be vacant and was not sampled. No contaminants detected.	
Canton					
Site/location	Date Notified	Type of Hazard	Response	Action	
Chruch of Jesus Christ of Latter-Day Saints 27 Lawton Road	5/22/2007	Explosion hazard exists due to the release of propane from a storage tank	DEP directed the property owner to continue to monitor threatened residential properties for volatilization and explosion risks.	Monitoring wells were sampled and levels within wells no longer exhibit explosion hazard. No additional hazard abatement action necessary.	
Commercial Property 3 Albany Turnpike	10/11/2011	Pollution was detected in a drinking water well but is below standards.	DEEP requested confirmation resampling of the supply well and determination of the pollution source. If groundwater is the source DEEP requested an inventory of all drinking water wells within 500 feet.	Onsite underground tanks removed and onsite drinking water resampled and well was not contaminated	
Mobil Service Station No. 01-QQD 306 Albany Turnpike	6/10/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample residential wells within 500 feet of the site for pollutants detected at the site.	Potable drinking water supply wells were sampled and did not contain any contaminants of concern	
Residence 23 Lovely Street	5/9/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to conduct a receptor survey and continue to sample 21 and 23 Lovely Street for contaminants of concern.	Onsite and nearest downgradient drinking water supplies were sampled and did not contain pollutants associated with the hazard.	
Station No. 17771 (Former) 306 Albany Turnpike	6/12/2012	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to conduct the work identified in the hazard notification.	Bottled water is being provided by responsible party.	

Canton

Site/location	Date Notified	Type of Hazard	Response	Action
Unknown Source Albany Trunpike/12 Dunham Road	4/15/2009	Pollution was detected in a drinking water well above standards. Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to provide bottled water to any future tenant at 198 Albany Turnpike / 12 Dunham Road. DEP indicated it will collect a confirmation sample to verify contaminant is present within the drinking supply well.	Impacted well tested twice; both times contaminants of concern were not detected.
Chaplin				
Site/location	Date Notified	Type of Hazard	Response	Action
Chaplin Mobil 17 Willimantic Road	8/13/2008	Pollution detected in groundwater above standards may threaten nearby drinking water wells.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at site.	6 wells identified and 6 wells sampled, pollution either not detected or detected but below standards. No further monitoring necessary.
Fin Fur & Feather Club 213 Chewink Road	4/5/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for the pollutants detected at the site, and advise DEP of any changes, and provide a plan to abate the hazard.	Treatment system installed at downgradient property. Abatement plans implemented. No further action necessary.
Cheshire				
Site/location	Date Notified	Type of Hazard	Response	Action
Cheshire BP 901 West Main Street	7/29/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 1000 feet for pollutants detected at the site.	Three drinking water supply wells were identified as being within 1,000 feet of the site. All samples were reported as below laboratory detection limits.
Cheshire Landfill Waterbury Road (Route 70)	5/23/2005	Pollution was detected in a drinking water well but is below standards.	DEP required continued sampling of the well for pollutants detected at the site.	Monitoring to continue pursuant to Landfill requirements.
Cheshire Landfill Waterbury Road (Route 70)	12/3/2002	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample wells up to 100 feet from the site for pollutants detected at the site.	Additional sampling conducted, pollution below standards. Monitoring program implemented.
Cheshire Landfill Waterbury Road (Route 70)	11/28/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to continue an established monitoring program, and evaluate trends in the pollutant that was detected.	Monitoring to continue pursuant to Landfill requirements.
Cheshire Veterinary Hospital 1568-1572 South Main Street	9/29/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample potable wells identified up to 500 feet of the site for pollutants detected at the site.	Property owner has conducted an inventory of wells within 500 feet.

Investigation/remediation (if needed) to contine

under Property Transfer Program.

Cheshire				
Site/location	Date Notified	Type of Hazard	Response	Action
Residence 485 Moss Frams Road	5/20/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the Town of Cheshire to continue an established monitoring program, and evaluate trends of the pollutant that was detected.	Potable well and monitoring wells at Cheshire landfill have been routinely monitored by the Town of Cheshire. MTBE was reported as non-detected in the potable well and less than applicable standards in landfill monitoring wells.
Residential Property 2298 Waterbury Road (aka 2289)	2/22/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Wells identified and sampled. No pollutants associated with this notification detected above standards.
Chester				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 62 Spring Street	4/5/2005	Pollution by fuel oil was detected in a shallow drinking water well.	DEP reviewed actions taken and determined they adequately addressed the pollution problem.	A new drinking water well had already been installed in an area not affected by the pollution. No additional hazard abatement action necessary.
Roli Enterprises LLC 20 Denlar Drive	1/29/2004	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	Building currently vacant. No specific hazard abatement action necessary. DEP recommended periodic monitoring of well.
Clinton				
Site/location	Date Notified	Type of Hazard	Response	Action
Richards Farm 71 Killingworth Turnpike	7/16/2012	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to provide bottled water to property with polluted wells. Town contacted owner of nearest residence and will sample drinking water well as soon as possible.	Property owner is providing bottled water to property and has posted signs directing persons using the property not to drink the water from the tap. Pollution is not migrating offsite; no the need to monitor off-site drinking water wells.
Colchester				
Site/location	Date Notified	Type of Hazard	Response	Action
Columbia Cleaners (former) 67 Lebanon Avenue	11/15/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to submit a plan to characterize the impact on indoor air quality and develop a remedy to limit the impact.	Proposal to determine extent of contamination and install sub-slab venting system is pending. Nearby drinking water supply wells identified and tested; no impact found.

Colchester				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 24 Comstock Bridge Road	10/27/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Four potable wells were identified downgradient of the site and were sampled twice and no pollutant was detected. The onsite potable well was installed with a filtration system and was monitored annually, as well as onsite monitoring wells.
Columbia				
Site/location	Date Notified	Type of Hazard	Response	Action
Collins Garage 177 Route 66	6/10/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and sample nearby wells for pollutants detected at the site.	Nearby wells identified and sampled, pollution not detected. Monitoring program implemented and onsite remediation ongoing.
Residential property 66-68 Route 87	11/13/2013	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to check and remove any visible free product from the well, install a second carbon filter canister, and conduct periodic testing of the well for the pollutants present at the site.	On-site well remains impacted with fuel-oil. Neighboring wells tested and are not impacted by release. DEEP continues to work with property owners and their respective attorneys to address pollution abatement and drinking water issues.
Coventry				
Site/location	Date Notified	Type of Hazard	Response	Action
7-Eleven Store # 32520 2711 Boston Turnpike (Route 44)	10/23/2007	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Addiitional groundwater monitoring was conducted and nearby drinking water wells were tested; no problems were identified. No further monitoring is needed provided conditions do not change.
Coventry Landfill Route 31	5/27/2003	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life at the time it was reported.	No specific hazard abatement action necessary. Monitoring to continue pursuant to Landfill requirements.
Coventry Landfill Route 31	6/3/2004	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life at the time it was reported.	No specific hazard abatement action necessary. Monitoring to continue pursuant to Landfill requirements.
Coventry Pizza 1467 South Street	10/14/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	5 wells identified and the three closest downgradient wells sampled, pollution either not detected or detected but below standards. Semi-annual monitoring program implemented for two years. No further monitoring necessary.

Coventry

List of Significant Environmental Hazards Reported to the DEP

Site/location	Date Notified	Type of Hazard	Response	Action
Residence (Former Farm) 10 Grant Hill Road	2/26/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the identified wells within 500 feet to the west, south and east of the site for the pollutants present on the site.	Property owner sampled nearby drinking water wells. Contaminanted soils excavated from source area. Steady state groundwater plume does not appear to pose risk to receptors. No drinking water wells are present within 500' downgradient of plume.
Cromwell				
Site/location	Date Notified	Type of Hazard	Response	Action
Scheu Nursery (former) Geer & Woodside Streets (Intersection)	12/10/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined there was in fact no significant hazard risk for the current land use. DEP also directed the property owner to identify and sample wells within 500 feet for pollutants detected at the site.	Polluted soil was removed from the site during development; no additional hazard abatement action necessary. Drinking water wells were identified and sampled and no pollutants associated with the site were detected; no further monitoring required.
Shell Facility #136296 (former) 131 Berlin Road	8/15/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	A treatment system was installed on the affected well. No pollutants above standards were detected in the remaining drinking water supply wells along nearby Kirby Road.
Sunoco 164 West Street	11/10/2005	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for the pollutants detected at the site.	Site investigation was conducted and impacted soil was removed. On-site potable well was monitored between 2005 and 2008, and in 2013. Results were below laboratory detecton limits. No other potable wells located with 500 feet of the site.
Danbury				
Site/location	Date Notified	Type of Hazard	Response	Action
345 Main Street LLC 345 Main Street	3/5/2008	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action, if necessary.	Vent system installed to prevent impact on indoor air quality. Monitoring program implemented including automatic alarms inside building.
Aberdeen property 11-27 East Franklin Street	4/4/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	As an interim measure, DEP directed the property owner to inform persons with potential for exposure, post warning signs and install a fence to limit access to the polluted soil until the site is cleaned up.	Polluted soil was removed; no additional hazard abatement action is necessary.

Danbury

Site/location	Date Notified	Type of Hazard	Response	Action
Amphenol Corporation 33 East Franklin Street	3/18/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement and in a secure and fenced area, limiting the potential for contact.	Polluted soil removed. No further abatement action necessary.
CL&P Triangle 11A Substation Triangle Street	11/8/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Warning signs posted; site is secure fenced electrical substation limiting the potential for contact with polluted soil.
Colonial Ford Prep Center 93 Sand Pit Road	2/24/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to verify the existance of, and sample, nearby wells for pollutants detected at the site.	Two wells identified and sampled. One year monitoring program implemented. Pollution not detected or detected significantly below standards. No additional hazard abatement action necessary.
Commercial Property 32-34 Newtown Road	5/31/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the two identified downgradient wells for pollutants detected at the site and to provide an alternate supply of potable water/treatment for properties with polluted wells.	Both downgradient wells sampled, pollution either not detected or detected but below standards. Original detection found to be result of sewer line break. After repairs, pollution not detected in new well. No further abatement action required.
Emhart Tecknologies LLC, Heli-Coil Facility 4 Shelter Rock Lane	3/29/2012	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP directed the property owner to submit a plan to develop a remedy to limit the impact of pollution on indoor air quality and to conduct sensitive receptor survey to evaluate if any residences could be affected by the groundwater plume.	Installed vapor extraction system under affected building. Monitoring program implemented for groundwater and soil vapor.
Exxon RAS #3-5664 112 Federal Road	2/14/2003	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data and determined that pollution is below standards, and the water is safe for human consumption.	DEP reviewed information provided and determined that the two affected wells have been abandoned, eliminating the exposure risk, and that groundwater pollution does not significantly threaten aquatic life. No additional abatement action necessary.
Exxon Station (former) 112 Federal Road	2/28/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the off-site threatened well, unless arrangements have been made to connect the location to public water.	Property connected to public water and well properly abandoned. No additional hazard abatement action necessary.
John's Automotive Service Center 85 Mill Plain Road	4/22/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP required additional sampling of on- site water supply well for pollutants detected at the site.	On-site well sampled. Pollution not detected. Site connected to municipal water. On-site well not abandoned and used in monitoring program.

Danbury

Site/location	Date Notified	Type of Hazard	Response	Action
Mobil Service Station #01-GFO 112 Newtown Road	2/9/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the five nearest threatened wells and provide bottled water to occupants if results exceed standards.	Four of five water supply wells identified were sampled. One owner denied access. Gasoline constituents were not detected in any of the supply wells. No additional abatement action necessary.
Mobil Station # 11722 (01-DVC) 54 Padanaram Road	5/21/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the nearby identified wells within 500 feet for pollutants detected at the site.	2 of 3 nearby wells where owners allowed access were sampled. Pollution not detected. Groundwater conditions no longer present hazard condition. No additional abatement action necessary.
Noaro Property 24 Pond Crest Road	9/24/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data and determined that water in the well at risk remained potable and recommended periodic sampling of the well until remediation is complete.	Source of pollution removed. No additional hazard abatement action necessary.
Norbert E. Mitchell Co., Inc. 7 Federal Road	7/6/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to periodically sample the onsite well for pollutants detected at the site, until polluted soil on the site is remediated. (No other drinking water wells were identified within 500 feet of the site.)	One water supply well identified (on-site well) and sampled, pollution not detected. Semi-annual monitoring program implemented.
Residence 21 Hawthorne Cove Road	10/23/2012	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to continue to test the on-site water suppy well quarterly for the pollutants detected at the site. DEEP will further evaluate testing at neighboring wells in conjunction with the local health department.	Source of pollution removed. Water treatment was installed on on-site supply well. Neighboring wells tested, where access granted, and pollution was not detected. Monitoring program implemented for on-site water supply well.
Residence 5 Timber Crest Drive	1/27/2009	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data for the affected well and determined pollution is not in fact present in the well. DEP directed the property owner to continue to sample the well and to advise DEP of any changes.	Well resampled, pollution not detected. Monitoring program implemented, pollution not detected. Impacted soil removed from tank grave. No additional abatement action necessary.
Residential Property 216 Westville Avenue Ext.	1/15/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data showing that the well at risk was not polluted.	Source of pollution removed. No additional hazard abatement action necessary. DEP recommeded periodic sampling of the well.
Residential Property 11 Sturdevant Drive	9/21/2004	Pollution was detected in a drinking water well above standards.	DEP required additional sampling of on- site and nearby wells for pollutants detected at the site.	Source of pollution removed. Additional sampling found no detectable pollution. No additional hazard abatement action necessary.

Danbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Texaco Facility #100061 3 Mountain View Road	10/15/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Twelve wells identified and ten wells sampled. Pollution not detected or significantly below standards. Source of pollution removed. No additional hazard abatement action necessary.
Darien				
Site/location	Date Notified	Type of Hazard	Response	Action
Former Residence 155R Nearwater Lane	12/9/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed the information and determined that the reported condition does not represent a hazard because the results of the subsequent receptor survey indicate that there are no private drinking water supply wells within 500 feet of the property.	No additional abatement action necessary.
Residential Property 31 Hancock Lane	2/10/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample on-site and nearby wells for pollutants detected at the site.	At-risk supply wells sampled and no pollution detected. Groundwater remediation implemented. No additional hazard abatement action necessary.
Deep River				
Site/location	Date Notified	Type of Hazard	Response	Action
Parcel 168 Main Street	11/10/2003	Pollution was detected in a drinking water well but is below standards.	DEP identified a responsible party and required provision of a safe supply of drinking water.	Water treatment system installed by responsible party at property with polluted well. No additional hazard abatement action necessary.
Derby				
Site/location	Date Notified	Type of Hazard	Response	Action
DoT property (former) Main Street	1/24/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to eliminate the risk to human health.	Polluted soil removed; no additional hazard abatement action necessary.
Durham				
Site/location	Date Notified	Type of Hazard	Response	Action
Alliance Energy 24 Main Street	1/18/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the well on-site and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Alliance sampled on-site supply well and wells 500 feet away from the site for the pollution detected at the site. A treatment system was installed on one well documented above standards. Alliance will continue to monitor this system.

Durham				
Site/location	Date Notified	Type of Hazard	Response	Action
Durham Firehouse 41-51 Main Street	9/10/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	The town identified one well within 500 feet of the site and sampled the well. No contamination related to the site was detected.
Grippo's Mobil 349 Main Street	1/26/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two potable wells were installed with filter systems. There are also two other gasoline stations nearby: former Shell Station and former Dairy Mart. Other potable wells were monitored by other two gasoline stations.
Residential Property 220 Main Street	8/29/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Pollution source removed, surrounding residences within 500 feet were sampled for petroleum. No concentrations of petroleum were detected in excess of laboratory detection limits.
Shell Facility #136301 (former) 336 Main Street	7/7/2009	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten drinking water wells.	DEP required additional sampling of onsite and other three nearby identified wells for metals detected at the site.	A well receptor survey within a 500-foot radius of the site was conducted and four potable wells were identified. All four wells have been sampled regularly since 1995 and they are on water treatment system previously installed by DEP.
East Granby				
Site/location	Date Notified	Type of Hazard	Response	Action
Airport 66 150 Rainbow Road	6/24/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to take actions identified in the notification, to remove impacted soil and groundwater from site during underground storage tank (UST) replacement activities	Underground tanks and impacted soil removed and groundwater remediation conducted. Monitoring wells sampled and downgradient wells did not contain contaminants of concern.
East Granby Citgo 2 School Street	4/28/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened wells for the pollutants detected at the site, and advise DEP of any changes. DEP also required the owner to continue to evaluate and characterize soil and groundwater impacts.	Onsite groundwater below action levels.

East Haddam					
Site/location	Date Notified	Type of Hazard	Response	Action	
7-Eleven Store # 32526 4 Falls Road	7/29/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue routine sampling of the onsite supply well and to identify and sample wells up to 500 feet downgradient from the site for pollutants detected at the site.	On-site and downgradient wells were sampled and no volatile organic chemicals were detected. On-going monitoring of on-site drinking water well and groundwater monitoring wells will continue.	
Residence 17 Plains Road [Moodus]	4/3/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	On-site and abuting drinking water wells sampled. Pollution was non-detect. Continued monitoring of drinking water well being performed by property owner.	
East Hampton					
Site/location	Date Notified	Type of Hazard	Response	Action	
Belltown Motors 80 East High Street	8/1/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and nearby identified wells within 500 feet for pollutants detected at the site.	Belltown Motors completed a receptor survey identifying 13 wells. Twelve of the thirteen were sampled. One resident refused. No chemicals associated with the site were detected in the drinking water samples.	
CL&P East Hampton Service Center 22 East High Street	4/10/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the threatened wells for the pollutants detected at the site.	CL&P sampled the eight identified wells in May 2012 and the detected compounds were below standards. These wells were historically sampled by CL&P. CL&P will submit documents to demostrate that plume is stable and risks to these wells are low.	
Commercial Parcel 5 East High Street & 6 North Main Street	8/18/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	The potable wells identified were sampled for petroleum and it was not detected. Contaminated soils were excavated for offsite disposal. No further action is required.	
Ghezzi Motors (former) 13 Watrous Street	8/26/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site supply well was sampled and was non- detected. 13 offsite potable wells were identified and sampled. DEEP monitors 7 of them.	
Parcel 103 Main Street	8/26/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two nearby wells were sampled and target compounds were below standards.	
Summit Thread Powerhouse (former) 13 Watrous Street	1/13/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	An engineered control was approved for the site to be a paved parking lot. Operation and maintenance of the engineered control is required.	

Site/location	Date Notified	Type of Hazard	Response	Action
Water Tower Property Walnut Avenue	7/27/2006	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide an alternate supply of potable water for polluted wells and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	A well receptor survey was conducted in 2006. Sampling indicated exceedances of dieldrin. CTDEEP installed treatment systems at those properties that have exceedances.
West High Street Area West High Street	10/31/2005	Pollution was detected in a drinking water well above standards.	DEP directed DoT to resample all wells that reported elevated concentrations, above standards, of arsenic or lead.	DoT resampled the wells that had detected arsenic and lead, and bottled water was provided at the locations where these pollutants were above standards.
East Hartford				
Site/location	Date Notified	Type of Hazard	Response	Action
Pratt and Whitney 400 Main Street	10/31/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed the information and determined that the conditions were similar to those in a previous notification, and were addressed by actions taken under that notification.	No specific additional abatement action was required; condition being addressed by sitewide RCRA corrective action.
Pratt and Whitney Willgoos Turbine Laborator Pent Road	y 10/31/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to maintain existing fencing that prevents access to polluted soil and to implement remediation following complete site assesment.	Fence was constructed to prevent access to polluted soil and warning signs were posted; remediation will occur following site assesment.
Pratt and Witney 400 Main Street	12/29/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to maintain fencing and restrict access until the impacted soil is remediated.	Site is in a remedial program and impacted soil will be removed following completion of site investigation. Access to impacted soil is restricted by fencing.
Residence 79 Shawnee Road	1/8/2008	Polluted groundwater near an occupied building could affect indoor air quality.	DEP directed the property owner to conduct a soil gas study to determine if polluted groundwater poses a risk to indoor air quality.	Soil vapor was collected and testing did not detect contaminants that would adversly affect indoor air quality.
East Haven				
Site/location	Date Notified	Type of Hazard	Response	Action
Cinque Industrial Park 509 Laurel Street	11/6/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil, notify site occupants, and limit access to the polluted soil.	Property owner submitted plan for investigation.

Site/location	Date Notified	Type of Hazard	Response	Action
York Correctional Institution 201 West Main Street	7/11/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed sampling data and determined a hazard condition does not currently exist based on the data collected from nearby groundwater monitoring wells and the distance from the source area to the supply wells.	No specific hazard abatement action necessary
East Windsor				
Site/location	Date Notified	Type of Hazard	Response	Action
Golden Gavel Auction House 149 North Road	2/3/2005	Pollution was detected in a drinking water well above standards, and other pollution detected in groundwater above standards may threaten this drinking water well.	DEP directed the property owner to provide bottled water as an alternate supply of potable water until resampling confirms the origin of the pollution reported.	Origin of Lead pollution determined to be from piping in residential property not groundwater. No additional hazard abatement action necessary since no actionable pollution condition.
Mobil Service Station #01-E53 (former) 276 Main Street	12/6/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to contiune with current plans for site investigation and remediation, and to sample nearby residential wells for the contaminants of concern.	Receptor survey conducted and drinking water supply wells surrounding subject property were sampled and were below the detection limit for the contaminants of concern.
Mobil Service Station #01-GAQ 157 North Road	9/14/2005	Pollution was detected in a drinking water well but is below standards, and pollution detected in groundwater above standards may threaten drinking water wells.	DEP directed the property owner to sample the polluted well quarterly for pollutants detected at the site, and sample identified downgradient wells.	Where access was granted the supply wells surrounding the subject property were sampled and were below the detection limit for the contaminants of concern. Continued to sample on-site well quarterly.
Easton				
Site/location	Date Notified	Type of Hazard	Response	Action
Residence 220 Banks Road	6/29/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP is working with the property owner to investigation the extent of the pollution and to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Source of pollution removed to the extent possible, monitoring program implemented.
Residence 427 Center Road	11/7/2011	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to resample the onsite well for pollutants detected at the site and continue to use bottled water, and also recommended changing the filter in an installed treatment system.	Monitoring data shows threatened wells not affected and source of pollution was removed. No additional abatement action necessary.

subsequent connection of impacted and threatened homes to public water.

Easton				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 78 Mile Common	10/14/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Source of pollution removed. The well water supply has been determined potable. No othe wells within 500 feet of release area.
Ellington				
Site/location	Date Notified	Type of Hazard	Response	Action
CRRA Ellington Landfill Sadds Mill Road (Route 140)	9/15/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to sample the threatened well and report results to DEP.	No specific hazard abatement action necessary; threatened well already monitored regularly and pollution not detected. Monitorir of well is ongoing under Landfill requirements.
O.J. Thrall, Inc. 78 Abbott Road	11/14/2011	Pollution was detected in a monitoring water well but is below standards.	DEEP directed the property owner to conduct the action described in the significant environmental hazard report. Once the supply well is reactivated it will be resampled. If still impacted a mitigation plan will be implemented.	The supply well is currently not in use.
Residential Property 132 Mountain Street	11/18/2009	Pollution was detected in a drinking water well above standards; pollution was detected in a drinking water well but is below standards; and pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide bottled water to impacted properties, continue quarterly monitoring of drinking water supply wells, expand receptor survey and generate a remedial plan to cleanup remaining impacted soil.	All residential wells sampled and were non- detect for petroleum hydrocarbons. Remediation conducted to remove onsite underground oil tank.
Enfield				
Site/location	Date Notified	Type of Hazard	Response	Action
CT DoC Enfield Small Arms Range North side of Sandhill Road	7/15/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to eliminate the risk to human health.	Impacted soil excavated and disposed off-site No additional hazard abatement action necessary.
0 & K Holdings Co., LLC 14 Broad Brook Road	11/12/2003	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample wells up to 1000 feet from the site for pollutants present at the site.	DEP installs treatment systems at wells if found to be polluted above standards. DEP Consent Order with Town provides for subsequent connection of impacted and threatened homes to public water.
D & K Holdings Co., LLC 114 Broad Brook Road	9/16/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	DEP installs treatment systems at wells if found to be polluted above standards. DEP Consent Order with Town provides for

Enfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Enrico Fermi High School 124 North Maple Street	4/4/2006	Pesticide pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP acknowledged actions already taken adequately limit access to polluted soil, and requested further study to delineate the problem and develop a remedy, and also evaluate potential impact on groundwater.	Field capped with 6 to 12 inches of clean fill to prevent direct exposure to impacted soil, other grassed areas also covered with clean fill.
The Hanson-Whitney Company 116 Broad Brook Road	11/5/2003	Pollution was detected in a drinking water well above standards.	DEP recommended the continued use of bottled water. DEP indicated it is also currently evaluating reported pollution in this area.	Property now vacant with no water use. No additional hazard abatement action necessary. DEP investigation ongoing.
Essex				
Site/location	Date Notified	Type of Hazard	Response	Action
Tuscarora Incorporated (former Verplex) 25 Middlesex Turnpike	3/3/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil had already been removed to a stockpile for off-site disposal. DEP directed the property owner to provide a report to DEP of the actions taken at the site.	Soil excavated from polluted area and stockpiled for disposal.
Fairfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Fairprene (former) 85 Mill Plain Road	8/27/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to delineate the extent of surface soil and groundwater exceeding applicable hazard thresholds and eliminate potential exposure pathways.	Site being remediated under Property Transfer Program.
		Polluted groundwater beneath an occupied building could affect indoor air quality.		
Mercedes Benz of Fairfield 450 Scofield Avenue	9/27/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is under pavement and in a secure and fenced area, limiting the potential for contact.	Access is restricted; no specific abatement action necessary.
Railroad Bridge North Benson Road	1/3/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a restricted-access rail corridor, limiting the potential for contact.	Access is restricted because site is in fenced rail corridor; no specific hazard abatement action necessary.

Fairfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Tide Mill 2425 Post Road	1/29/2009	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary
Universal Thread Grinding Company 30 Chambers Street	8/26/2002	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to submit a plan to determine if indoor air quality is being affected and, if so, recommend a course of action.	Sampling of soil gas shows that pollution levels are below levels that pose a significant risk to indoor air. Additional remedial actions implemented. Groundwater and soil vapor monitoring program implemented.
Farmington				
Site/location	Date Notified	Type of Hazard	Response	Action
College Highway Substation 201 Waterville Road	8/31/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access is restricted; no specific hazard abatement action necessary.
Commercial Property 232 Colt Highway (Route 6)	1/24/2005	Pollution was detected in a drinking water well but is below standards, and other pollution detected in groundwater above standards may also threaten this drinking water well.	DEP determined that no action is required because the well is the only well in the area, is currently unused, and the detected pollution in it is significantly less than the standard.	Well not in use; no specific hazard abatement action necessary. DEP recommended retesting the well when it is again in service.
Dell Manufacturing Company 4 Right Lane	7/5/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to conduct an abatement action which includes removal of PCB-impacted soil.	Highest concentrations were removed and further removal is pending EPA approval of plan.
Farmington Automotive 352 Scott Swamp Road	2/21/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data for two threatened wells and found no pollution in the well water.	No additional hazard abatement action necessary
FM2330 1387 Farmington Avenue	12/20/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to conduct the proposed abatement action. The groundwater will be sampled and the threatened potable well will be monitored annually. If groundwater conditions change additional abatement actions will be conducted.	Threatened well sampled and did not detect any contaminant of concern. Will be sampled annually until groundwater remediated.
Mobil Service Station #01-QQF 435 Main Street	5/18/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to collect samples from the threatened supply well and provide an alternate supply of drinking water if contamination is detected.	Nearby supply well was sampled and no volatile organic chemicals were detected. Onsite monitoring wells will continue to be sampled.

Farmington				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 74 West Avon Road	11/5/2004	Pollution was detected in a drinking water well, with some compounds above standards and other compounds below standards.	DEP directed the property owner to sample the polluted well quarterly and advise DEP of any changes.	A treatment system on the impacted well provides potable water. Supply wells on abutting properties have been tested and no pollution was detected.
		Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined the polluted soil has already been removed, eliminating the exposure risk.	Polluted soil removed; no hazard additional abatement action necessary.
Residential Property 231 Coppermine Road	10/10/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution is significantly below standards, and the water is safe for human consumption.	No specific hazard abatement action necessary.
Franklin				
Site/location	Date Notified	Type of Hazard	Response	Action
7-Eleven 15 Route 32	8/1/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP required additional sampling of onsite and two nearby identified wells for pollutants detected at the site.	On-site well and two nearby wells sampled and were not impacted by groundwater plume. Ongoing monitoring of groundwater being conducted at the site.
7-Eleven 15 Route 32	4/12/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample potable water supply wells up to 500 feet away from the site for pollutants detected at the site.	Two wells identified and sampled, pollution either not detected or detected but below standards.
Kahn Tractor & Equipment 520 Pond Road	11/6/2007	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to identify potable water supply wells up to 500 feet away from the site and to sample downgradient wells pursuant to a plan previously approved by the Department.	All wells sampled. On-site well has pollutants present, but filter system installed and maintained by owner. Off-site wells were non-detect. Long-term monitoring of area wells and maintenance of filter being conducted under approved plan.
Glastonbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Best Cleaners 2759 Main Street	2/6/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the operator to implement their proposed actions, including an inventory and sampling of nearby potable water supply wells, and also evaluate the potential for vapor migration into buildings.	Wells identified by investigation were sampled with no detection of pollution. Site is undergoing investigation and remediation under Property Transfer Program.

Glastonbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Glastonbury Gage (former) 184 Commerce Street	6/11/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence or secure the area to limit contact with the polluted soil.	Polluted soil removed; no additional hazard abatement action necessary. Well retested; source investigation ongoing under Property Transfer Program.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to resample the groundwater to further evaluate the threat to surface water.	
Residential Property 57 High Ridge Road	6/9/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the threatened wells periodically for pollutants detected at the site, and create a long-term monitoring plan.	Remedial system installed; residential water supply well sampled and no volatile organic compounds detected above standards. Also, no volatile organic compounds detected in most downgradiant monitoring wells.
Shell Facility #136314 2088 Hebron Avenue	12/3/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Three wells identified and sampled, pollution not detected or significantly below standards. No further hazard abatement action necessary.
Goshen				
Site/location	Date Notified	Type of Hazard	Response	Action
Public Works Department 38 Torrington Road	11/6/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to resample the onsite supply well for pollutants detected at the site.	On-site well tested; pollution not detected. DEEP advised local health department to continue to monitor annually. No further abatement action necessary.
Residence 76 Old Middle Street	8/18/2011	Pollution was detected in a drinking water well above standards, and in another drinking water well pollution was detected but is below standards.	DEEP directed the property owner to provide treatment for the on-site polluted well, continue to monitor affected residences, and submit a plan for evaluating the pollution source. DEEP to install a treatment system on other polluted well.	Ten wells identified within 500 feet and ten wells tested. Pollution found at two residences above standards and one residence below standards. Filter treatment systems installed at three residences. Monitoring program implemented for 7 residences.
Greenwich				
Site/location	Date Notified	Type of Hazard	Response	Action
Fairview Country Club 1241 King Street	2/7/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the identified wells within 500 feet for pollutants detected at the site.	Identified well was sampled, pollution was not detected. Monitoring program implemented.
Greenwich High School 10 Hillside Road	11/8/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is in a secure, restricted, and fenced-in area, limiting the potential for contact.	No additional abatement action necessary; long term remedy implementation continues.

Greenwich				
Site/location	Date Notified	Type of Hazard	Response	Action
Hasco Electric (former) 84 South Water Street	10/27/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine the extent of groundwater and/or soil gas pollution exceeding the hazard threshold criteria, determine if indoor air is adversely affected, and identify drinking water wells within 500 feet.	Extent of groundwater and soil vapor exceeding hazard threshold criteria appears to be limited to the on-site building which remains vacant; no wells were identified within 500 ft.
High Tower Trading, LLC 1275 King Street	11/4/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue sampling the threatened wells for the pollutants detected at the site and advise DEP of any changes.	Source removed; monitoring program implemented.
Ludor Corporation 371 East Putnam Avenue	8/7/2008	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Merritt Parkway Rest Stop - Greenwich Merritt Parkway	3/24/2010	Pollution detected in groundwater above standards may threaten a drinking water well.		
Residence 10 Lockwood Drive [Old Greenwich]	8/22/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed information provided and determined that the source of pollution had been removed and no wells had been identified within 500 feet of the property, thereby eliminating the potential for exposure.	No additional abatement action necessary.
Riverside Cleaners (former) 1130 East Putnam Avenue	11/16/2007	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and, if so, provide a remedial action plan.	Remediation (excavation and off-site disposal) of source area initiated Oct 2009.
Griswold				
Site/location	Date Notified	Type of Hazard	Response	Action
Griswold C-Store, LLC 659 Voluntown Road	6/17/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the on-site well, and identify and sample wells up to 250 feet from the site, for pollutants detected at the	Three wells identified and sampled, pollution either not detected or below standards.

site.

Groton				
Site/location	Date Notified	Type of Hazard	Response	Action
Colonial Apartments 2350 Gold Star Highway	3/5/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data showing that the well at risk was not polluted.	No additional hazard abatement action necessary. DEP recommended periodic retesting until remediation of the site is complete.
Mystic Oral School Oral School Road [Mystic]	1/10/2014	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a fence or secure the area to limit access to the polluted soil until the site is cleaned up.	Action pending.
Guilford				
Site/location	Date Notified	Type of Hazard	Response	Action
AM International / Oce-Bruning / Arkwright 385 Long Hill Road	9/5/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the polluted monitoring well quarterly for the pollutant detected at the site and advise DEEP of any changes to concentrations.	Action pending.
Mobil Service Station #01-QBA 1164 Boston Post Road	7/1/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Downgradient wells on site have been non- detect for the target compounds. Additional monitoring is ongoing.
Residential Property 103 Daniel Avenue	6/23/2006	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to maintain and monitor an installed treatment system for the polluted well, provide a list of wells inventoried in the area, and expand the sampling program to other nearby wells.	A treatment system has been provided to remove constituents of concern from the affected water supply well.
Haddam				
Site/location	Date Notified	Type of Hazard	Response	Action
CT Yankee Atomic Power Co. 362 Injun Hollow Road	8/11/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to install a fence to limit access to the polluted soil until the site is cleaned up.	Polluted soil removed; no additional hazard abatement action necessary.
Hall Farm Estate Haddam Neck Road	11/1/2006	Pollution above standards was detected in a total of six drinking water wells, two of which are not in use. Pollution below standards was detected in two drinking water wells.	DEP requested the notifier's client and/or property owner to provide an alternate supply of potable water to properties with wells polluted above Drinking Water Standards, and to provide a plan to monitor affected and potentially affected wells.	Wells in vicinity of a suspected release area have been identified and sampled; bottled water is being provided to affected residences.

pollutants were found at levels below drinking

water standards.

Haddam Site/location Date Notified Type of Hazard Response Action Jaspers (former) 12/31/2007 Pollution detected in groundwater DEP directed the former property owner Groundwater sampled in 11 residential wells above standards may threaten a to resample the onsite supply well and within 500 feet of the subject site. No 206 Saybrook Road contaminants associated with the notification drinking water well. identify and sample wells up to 500 feet away from the site for pollutants (SEHN) were identified in groundwater in any of detected at the site. the residential water supply wells. DEP provided a filter system to one residential Maple Avenue Area (Higganum) 9/15/2005 Pollution was detected in drinking DEP directed the notifying party to water wells above standards: provide bottled water to property with property. DoT has provided bottled water to Maple Avenue [Higganum] also, pollution was detected in polluted wells above criteria, and to several businesses. other drinking water wells but is establish a long-term monitoring below standards. program for the impacted wells. Mike's Auto Service LLC 1/17/2007 Pollution was detected in a DEP reviewed data for the affected No additional hazard abatement action drinking water well but at a level well, and determined contamination in necessary. 1573 Saybrook Road substantially below standards. the well is significantly below standards, and the water is safe for human consumption. Tylerville BP Facility #61-11042 (former) 6/23/2009 Pollution detected in groundwater DEP directed the property owner to 19 wells identified and 16 wells sampled, 2 above standards may threaten a sample the onsite supply well, sample commercial properties with pollution above 1598 Saybrook Road drinking water well. wells within 500 ft, that have not yet standards found, advised of condition, and are been sampled, and provide sample now using bottled water as an alternative results and a map of supply well supply. Monitoring and DEP actions ongoing. locations previously identified. Tylerville BP Facility #61-11042 [Former] 5/9/2011 Pollution detected in groundwater DEP recommended actions to be taken Site is now under DEEP enforcement order. above standards may threaten a in a letter addressed to Mr. Michael Responsible party is actively monitoring 1598 Saybrook Road drinking water well. Devino, dated May 18, 2011. Please potable water wells in the area. refer to this letter for the recommended actions. Hamden Site/location Date Notified Type of Hazard Response Action Cables Property 8/21/2007 Pollution detected in groundwater DEP directed the property owner to Two wells were identified within 750 ft.: 87 above standards may threaten a sample the onsite supply well and Kimberly was sampled and non-detect, 61 87 Kimberly Road identify and sample any wells up to 750 drinking water well. Kimberly could not be sampled because the feet away from the site for pollutants property is condemned. Sampled well

detected at the site.

Hamden					
Site/location	Date Notified	Type of Hazard	Response	Action	
Laurel View Country Club 310 West Shepard Avenue	6/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample onsite (if any) and nearby wells for pollutants detected at the site.	Downgradient supply wells along Paradise Ave. sampled, all non-detect. On-site soil sampling non-detect for volatile organic chemicals and petroleum.	
		Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP indicated that notification regarding petroleum hydrocarbons in surface soil is not required under the law.	Petroleum is not a defined significant hazard; no action was required.	
Hartford					
Site/location	Date Notified	Type of Hazard	Response	Action	
151 New Park LLC 151 New Park Avenue	10/6/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to investigate the site under the Property Transfer Program and maintain temporary containment with vegetation and fencing to limit access to polluted soil until exposure risk is eliminated.	Temporary containment in place with vegetation and fencing until site is remediated under the Property Transfer Program.	
Hartford Economic Development Commission 13 Wolcott Street	11/25/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined the polluted soil is under pavement and in a fenced area, limiting the potential for contact.	Access to polluted soil is limited; no specific hazard abatement action necessary.	
Residence 465-467 New Britain Avenue	5/1/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to implement plan to remove and replace contaminated soil.	Soil removal conducted following house restoration.	
Residence 19 Julius Street	6/12/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a work plan with a schedule to remove lead paint impacted soil.	All lead hazards have been abated to meet lead abatement program requirements.	
Residential Property 279-281 Sargeant Street	12/4/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is covered by plastic, limiting the potential for contact, and will be evaluated and removed upon completion of the painting project.	Area covered with temporary plastic tarp until soil removed pursuant to work plan.	
Residential Property 514-516 Hillside Avenue	12/4/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to conduct work to mitigate lead paint contaminated soil proposed in a submitted soil abatement plan.	Area covered with temporary plastic tarp until soil removed pursuant to work plan.	

Hartford				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 308 Edgewood Street	10/28/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is covered by plastic, limiting the potential for contact, and will be evaluated and removed upon completion of the painting project.	Impacted soil covered with plastic until the area is excavated and soil is removed.
South Meadows Station, Mid-Connecticut RRF Reserve Road (Gate 20)	12/23/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is limited; no specific hazard abatement action necessary.
Harwinton				
Site/location	Date Notified	Type of Hazard	Response	Action

Site/location	Date Notified	Type of Hazard	Response	Action
Harwinton Citgo 166 Burlington Road	4/15/2008	Pollution was detected in a drinking water well above standards. Pollution was detected in a different drinking water well but is below standards.	DEP directed the property owner to continue providing bottled water until a filter system is installed on the impacted well, and implement a monitoring program for threatened wells.	Water treatment system installation completed/ tested. Monitoring program continued for threatened wells.
Harwinton Citgo 166 Burlington Road	7/19/2005	Pollution was detected in a drinking water well, with some compounds above standards and other compounds below standards.	DEP directed the property owner to sample the threatened wells periodically for pollutants detected at the site, and connect the affected property to municipal water service.	Investigated all wells and hooked up impacted wells to municipal water.
Reynolds Foundry (former) 131 Clearview Ave	2/17/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the propety owner to implement the actions proposed in part IV of the Signigicant Environmental Hazard Notification, which include identifying and sampling nearby supply wells and further evaluating the source of pollution.	Receptor survey was conducted and the downgradient wells were tested detecting no contaminants of concern

Hehron

TICDIOII	icoroni				
Site/location	Date Notified	Type of Hazard	Response	Action	
Hebron Citgo 70 Main Street	5/17/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Water main installed in 2009 through Consent Order. All impacted wells connected to public water. Other wells are monitored by Drake Petroleum.	

Hebron				
Site/location	Date Notified	Type of Hazard	Response	Action
Hebron XtraMart Route 66 & Route 316	12/23/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Additional sampling conducted. Bottled water provided to properties where pollution was above standards pending water treatment system installations. Monitoring on-going for threatened wells.
Hebron XtraMart (Drake Petroleum) 37 Main Street	7/19/2006	Pollution was detected in a drinking water well but is below standards.	DEP required additional sampling of nearby identified wells within 500 feet for pollutants detected at the site.	Water main installed in 2009 through Consent Order. All impacted wells connected to public water. No further abatement action necessary.
Kent				
Site/location	Date Notified	Type of Hazard	Response	Action
Bulls Bridge Garage 337 Kent Road (US Route 7)	12/12/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to sample the on-site supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well receptor survey found drinking water wells on adjacent properties. On and off-site wells sampled and pollution not detected. Quarterly monitoring program implemented for on-site and nearest off-site well
Kent Substation Route 341	5/12/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is within a fenced electrical substation.
Killingly				
Site/location	Date Notified	Type of Hazard	Response	Action
Commercial Property 405 Lake Road	12/11/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to assess the impact to downgradient receptors in consultation with the DEP.	Several wells identified and 9 wells sampled, pollution either not detected or detected but below standards. DEEP sampled wells through 2012 and determined no further monitoring necessary.
Dayville XtraMart 439 Hartford Turnpike (Route 101)	8/25/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the polluted wells quarterly for the pollutants detected at the site. DEP also requested that the property owner implement a proposed soil vapor survey.	Monitoring plan impemented.
Hopkins Wellfield south of intersection Rt 12 & Rt 101	12/27/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened and polluted wells periodically for the pollutants detected at the site, and advise DEP of any changes.	Crystal Water Company continues to sample this well.

Killingly				
Site/location	Date Notified	Type of Hazard	Response	Action
MPI Label Systems 24 Doring Drive	8/7/2007	Pollution was detected in a drinking water well above standards. Pollution was detected in a different drinking water well but is below standards.	DEP directed the property owner to provide bottled water to the properties with polluted wells.	Carbon filters installed at two homes. On-going monitoring being performed by DEEP.
Ledyard				
Site/location	Date Notified	Type of Hazard	Response	Action
Mobil Home Park 940 Long Cove Road	4/9/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide treatment for polluted wells, and a report of additional actions taken.	New well drilled on property.
		Pollution in top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined the polluted soil has been removed, eliminating the exposure risk.	Polluted soil removed; no additional hazard abatement action necessary.
Lisbon				
Site/location	Date Notified	Type of Hazard	Response	Action
Lisbon Mobil 107 River Road	4/22/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well survey completed. Nearby wells sampled for pollutants present and no contaminants detected. Site undergoing long term monitoring.
Litchfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Commercial Property 725 Bantam Road	1/24/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified nearby wells for pollutants detected at the site.	Nearby wells re-sampled in February 2011 to confirm that the 2007 hazard condition had not impacted any of the nearby wells. All results were non-detect. No additional abatement action necessary.
Madison				
Site/location	Date Notified	Type of Hazard	Response	Action
East River Foundry (former) 82 Nathans Lane	4/5/2007	Pollution detected in groundwater that discharges to surface water may pose a threat to aquatic life.	DEP directed the property owner to evaluate the nature, extent and degree of groundwater pollution to determine the threat to surface water and aquatic life near the site, and also provide sample results for drinking water wells.	Polluted soil on site remediated; action pending on requested groundwater evaluation.

Madison					
Site/location	Date Notified	Type of Hazard	Response	Action	
East River Foundry (former) 82 Nathans Lane	2/15/2005	Pollution detected in groundwater that discharges to surface water may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the pollution migration and the threat to surface water and aquatic life.	Property ownership transferred to Town of Madison, site investigation and remedial action to be taken by town as part of site redevelopment. See notification by town 4/5/2007.	
Manchester					
Site/location	Date Notified	Type of Hazard	Response	Action	
Commercial Property 42 Prospect Street	10/16/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to install a fence and post signs around the impacted area. DEP also required submittal of receptor survey information and additional sampling of groundwater for lead.	Receptor survey was conducted and no potable supply wells were identified. Lead was not detected in the groundwater.	
Commercial Property 5 & 7 Tolland Trunpike	2/21/2006	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water and identify wells within 500 feet.	No wells identified within 500 ft down gradient. A carbon filter system has been installed on the onsite impacted well.	
Dean Machine/Precision Metals Testing (former 102 Colonial Road & 372 Progress Drive	r) 11/15/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP indicated it is already aware of this condition; and that the party submitting the notification was not required to do so under the law.	Threatened well is monitored by the Town.	
Gulf Gasoline Station 128 Tolland Turnpike	12/1/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the supply well periodically until a filter is installed or a public water connection is made.	Receptor survey was conducted identifying 2 potable wells. Wells were sampled for contaminant of concern and both were below drinking water action level.	
Mobil Service Station No. 01-QQ5 240 Middle Turnpike West	6/9/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	The DEP directed the property owner to confirm if a neigboring supply well exists and, if so, sample the well for pollutants detected at the site.	No wells were found to be within 500 feet of the groundwater pollution; no additional abatement action necessary.	
Residence 159 School Street	7/13/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to provide an abatement plan to remove impacted soil.	Soil to be removed following house restoration. Soil removal project is out to bid.	
Town of Manchester Charter Oak Well Field 192 Charter Oak Street	6/6/2008	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the Town to identify and sample other nearby supply wells and develop a work plan to investigate the source area of the pollution.	Receptor survey identifed one private supply well; water sample did not detect contaminants above drinking water standards.	

Mansfield						
Site/location	Date Notified	Type of Hazard	Response	Action		
Dick's Automotive 644 Middle Turnpike	12/14/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify wells up to 500 feet away from the site.	Eastern Highlands Health District sampled drinking water wells in the area and no impacts were noted.		
Husky Mobil (Drake Petroleum Co) 607 Middle Turnpike (Route 44) [Storrs]	12/27/2007	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Sampling of neighboring well performed. Carbon filter installed. DEP issued Order to Drake Petroleum for pollution abatement and monitoring and maintenance of Carbon filter.		
Mobile Service Station #01-G1P 7 Storrs Road	8/30/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide a copy of the already completed sensitive receptor survey, and investigate sidegradient and downgradient surface water features within 500 feet of the release for signs of surface water contamination.	Alex Caisse Spring well located about 300 feet from site. Spring has not been impacted by plume. No other wells or receptors identified. Ongoing monitoring being performed at the site.		
Residential Property 986 Storrs Road	10/17/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Additional sampling conducted, pollution not detected or below standards.		
Marlborough						
Site/location	Date Notified	Type of Hazard	Response	Action		
Old Marlborough Village 74 South Main Street	10/9/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed information provided and determined the pollution in the well was below standards, and the water is safe for human consumption.	Further sampling to be conducted as part of public water supply monitoring as required by Department of Public Health.		
Middlebury						
Site/location	Date Notified	Type of Hazard	Response	Action		
Lake Quassapaug Amusement Park, Inc. 2132 Middlebury Road	5/3/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Source of pollution removed. Two supply wells identified and two wells tested. Pollution not detected. Monitoring program implemented for groundwater and supply wells.		
TranFarm Associates I, LLC 124 Tranquility Road	9/4/2003	Pollution was detected in a drinking water well, with one compound above standards and one compound below standards.	DEP reviewed additional sampling data and determined pollution is significantly below standards, and the water is safe for human consumption.	No additional hazard abatement action necessary. DEP recommended periodic sampling for the pollutants detected at the site.		

Middletown

Site/location	Date Notified	Type of Hazard	Response	Action
Best Cleaners 522 South Main Street	2/28/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to implement their proposed plan which includes sampling of the potable well identified.	One potable well was identified and tested. Site pollutants were not detected in the well water. Site groundwater is monitored on an annual basis.
Bills Auto Parts 1462 Saybrook Road	11/18/2004	Pollution was detected in a drinking water well below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site, and to provide bottled water or treatment for property with polluted wells.	Two underground petroleum storage tanks and associated contaminated soil were removed from the site in 2005. Additional well water sampling to confirm there is no remaining pollution is pending.
Color Mart 41 Broad Street	3/22/2004	Pollution was detected in a drinking water well but is below standards.	DEP reviewed additional sampling data and determined pollution is below standards, and the water is safe for human consumption. DEP recommended periodic sampling of the well until completion of planned connection to public water.	No additional hazard abatement action necessary.
CT DoT Maintenance Facility Paddock Road	1/27/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified wells up to 500 feet from the site for pollutants detected at the site.	A well receptor survey was completed and identified 6 residential wells. These wells were tested for volatile organic chemicals in 2004 and 2010 and none were detected. The leaking line was replaced and impacted soil was removed.
Long Lane School 170 Long Lane	2/17/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP staff are already involved with a detailed cleanup of the site. The site is secure and there are plans to deal with any remaining contamination throughout the site including but not limited to pesticides and coal ash.	No specific abatement action necessary. The hazard conditions are being addressed by ongoing soil excavation.
Long Lane School 170 Long Lane	10/10/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to continue to provide information to the Department as part of a continued site wide investigation and remediation. The property is under DEP oversight for remediation due to a 1999 property transfer.	DEEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.
Quality Insulation, Inc. 1996 Saybrook Road	4/29/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample all identified wells within 500 feet for pollutants detected at the site.	Wells identified and sampled. No additional hazard abatement action necessary.

Middletown				
Site/location	Date Notified	Type of Hazard	Response	Action
Sumner Creek LLC 20 Mill Street	1/5/2007	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to resample the groundwater to further evaluate the threat to surface water and aquatic life.	Nine monitoring wells have been installed at the site. Zinc and copper continue to exceed the standards. The site is addressed under the Property Transfer Program.
Wesleyan University Long Lane Campus 170 Long Lane	5/17/2007	Presence of coal ash throughout the site may pose a risk to human health as a result of direct contact.	DEP directed the property owner to continue to provide information to the Department as part of a continued site wide investigation and remediation. The property is under DEP oversight for remediation due to a 1999 property transfer.	DEEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.
Milford				
Site/location	Date Notified	Type of Hazard	Response	Action
120 Wampus LLC 120 Wampus Lane	11/15/2012	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific abatement action necessary.
Commercial Property 561-587 New Haven Avenue	2/15/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Polluted groundwater beneath an occupied building could affect indoor air quality.	Notification of these conditions was not required. DEP directed property owner to submit letter report of their actions as stated in DEP's December 18, 2006 acknowledgement letter regarding similar environmental hazard condition.	No additional hazard abatement action necessary.
Commercial Property 561-587 New Haven Avenue	12/8/2006	Polluted soil gas beneath an occupied building could affect indoor air quality.	DEP directed the property owner to characterize the extent of impact on groundwater and soil gas, assess the indoor air quality, propose controls to mitigate this impact, and conduct an inventory of water supply wells within 500 feet of the site.	No potable water supply wells identified within 500 feet. Investigations performed to characterize the degree and extent of groundwater pollution resulting from releases at site. Sub-slab soil vapor sampling and indoor air monitoring performed.
Devon Generating Station 734 Naugatuck Avenue	10/19/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post a sign, notify people with the potential for exposure to the surface soil, and maintain security around the site and the secondary containment around the tank to limit access to the surface soil.	Polluted soil removed; no additional abatement action necessary.

Monroe

Site/location	Date Notified	Type of Hazard	Response	Action
Alpha Typesetting (former) 618 Main Street	7/6/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby identified wells for pollutants detected at the site.	9 wells were identified and 3 wells sampled (access was only granted for these 3 wells). Pollution was not detected. Petroleum hydrocarbons were not detected in groundwater collected from the on-site wells during two years of periodic monitoring.
BP Service Station # 1122 (former) 172 Main Street	12/11/2002	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to conduct long term sampling of polluted wells for pollutants detected at the site, or to provide a safe supply of drinking water.	Quarterly sampling of water supply wells was conducted from 2003 through 2006, concentrations were less than drinking water action level. Periodic sampling is ongoing.
Cyclone Car Wash, LLC 178 Main Street	6/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional data and determined pollution from this source is not affecting nearby wells.	No additional hazard abatement action necessary.
		Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined that the reported soil condition is exempted from the requirement for notification under the law.	Polluted soil is not exposed at the surface or located within the top two feet, which is the zone defined in the law as a potential hazard condition.
Main Street Area Main Street	11/29/2010	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water to the tenants. DEP retested the on-site supply well and sampled nearby wells for pollutants detected at the site.	Monitoring data shows threatened wells not affected. No additional abatement action necessary.
Residence 55 Sentry Hills Road	12/28/2007	Pollution detected in groundwater may threaten a drinking water well.	DEP directed the property owner to conduct a drinking water supply well inventory within a 500 ft radius of the property and sample on-site well and any at-risk wells for the pollutants detected at the property.	Source of pollution removed, and monitoring data shows on-site private well is not affected. No additional abatement action necessary.
Residence 9 Hillcrest Road	8/6/2013	Pollution was detected in a drinking water well but is below standards.	DEEP directed the property owner to resample the onsite supply well and identify nearby wells.	Onsite well sampled, pollution not detected. No additional abatement action necessary.
Residential Property 1068 Monroe Turnpike	9/9/2005	Pollution was detected in a drinking water well but is below standards.	DEP reviewed additional sampling data for the affected well and determined that the reported pollution was not confirmed as present, and the water is safe for human consumption.	Source of pollution removed, and monitoring data shows affected well is below standards. No additional abatement action necessary.
Route 25 Auto Collision 256 Main Street	8/7/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Monitoring program implemented

Monroe					
Site/location	Date Notified	Type of Hazard	Response	Action	
Route 25 Auto Collision 256 Main Street	1/7/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well quarterly for the pollutants detected at the site and report the results to DEP and the local Health Director.	Monitoring program implemented.	
Stevenson Hydroelectric Facility 1 Roosevelt Drive	2/14/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to cover the polluted soil, post warning signs, install fencing to restrict access to the polluted soil until the site is remediated, and inform persons with potential for exposure to the polluted soil.	Actions directed performed. Full remediation scheduled for 2012.	
Montville					
Site/location	Date Notified	Type of Hazard	Response	Action	
Ash disposal site 128 Moxley Road	5/29/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to fence the area, assess the potential for the contaminated surface water to impact an upgradient pond and water supply well, and develop a plan to abate impacted surface and ground water.	Nearby drinking water wells were sampled and were non-detect for the pollutants at the site. On-going evaluation of surface water body	
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.		being conducted.	
Bonville Brothers Property (former) 291 Maple Avenue	3/30/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well inventory completed and 3 closest wells sampled for pollutants of concern. No pollutants were detected. DEP requested semi-annual monitoring of the 3 wells for a period of two years. No further monitoring necessary.	
Shantok Motors 2246 Route 32	4/16/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the on-site supply well and to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Wells identified and sampled, pollution not detected. No additional hazard abatement action necessary.	
Town of Montville 14 Bridge Street	4/25/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is under pavement limiting the potential for contact. DEEP requested the property owner ensure the pavement remains in place until the site is remediated.	Soil is located beneath pavement. No current actions necessary other than ensuring that pollution remains isolated by pavement until remediation is performed.	

Morris				
Site/location	Date Notified	Type of Hazard	Response	Action
East Morris XtraMart Thomaston Road (Route 63/109)	3/12/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Source of pollution removed. Monitoring data shows potentially threatened wells have pollution significantly below standards or no pollution detected. No detection of pollutants in monitoring wells. No additional abatement action necessary.
Naugatuck				
Site/location	Date Notified	Type of Hazard	Response	Action
Karo Manufacturing Site (former) 285 Great Hill Road	12/1/2003	Pollution was detected in a drinking water well above standards.	DEP installed water treatment systems at properties with polluted wells and threatened wells were monitored. Properties with polluted wells were subsequently connected to public water supply.	Properties with polluted wells on David Street (8,18,28,38,48,58,68), Ramsey Avenue (79,80), and Gail Drive (103) connected to public water supply. The Borough of Naugatuck implemented monitoring program for 7 closest wells. Pollution not detected.
Sarracco Mechanical Services, Inc. 71 Naugatuck Drive	9/29/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify wells within 1,000 ft of the site and to sample three identified nearby wells for pollutants detected at the site.	Wells sampled; pollution not detected or detected significantly below standards. No additional abatement action necessary.
New Britain				
Site/location	Date Notified	Type of Hazard	Response	Action
Brothers Dry Cleaners & Dyers, Inc. 234 North Street	7/29/2005	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine the extent of the problem and provide a plan of action.	Proposed plan to vent area and take additional samples of soil gas has been implemented.
The Commercial Foundry Companies 326 South Street	6/3/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under a building and in a secure area, limiting the potential for contact.	No specific hazard abatement action necessary.
New Canaan				
Site/location	Date Notified	Type of Hazard	Response	Action
CT DoT Maintenance Facility 47 Gerdes Road	12/20/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement and in a secure and fenced area, limiting the potential for contact.	No specific hazard abatement action necessary.
Residence 807 Smith Ridge Road	10/29/2013	Pollution was detected in a drinking water well above standards.	DEEP reviewed additional sampling data for the affected well and determined that pollution is not in fact present in the well.	No additional abatement action necessary.

New Canaan					
Site/location 1	Date Notified	Type of Hazard	Response	Action	
Residence 1271 Oenoke Ridge	3/7/2013	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	Source of pollution removed, and monitoring data shows threatened wells not affected or significantly below standards.	
New Fairfield					
Site/location 1	Date Notified	Type of Hazard	Response	Action	
Druck Incorporated 3 Dunham Drive	12/20/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	10 wells identified/ 5 wells sampled. Pollution either not detected or detected below standards. 3-year monitoring program: Pollutants not detected in drinking water wells; groundwater did not exceed standards. No futher abatement action necessary.	
Druck Incorporated 3 Dunham Drive	6/3/2005	Pollution detected in groundwater above standards may threaten drinking water wells.	DEP directed the property owner to sample the onsite and nearby identified wells within 500 feet for pollutants detected at the site.	All wells sampled, pollution not detected or significantly below standards. No additional hazard abatement action necessary.	
Druck, Inc. 4 Dunham Drive	8/7/2013	Pollution was detected in a drinking water well but is below standards.	DEEP reviewed sampling data: well pollution below standards, well has treatment system, and water safe for human consumption. DEEP directed owner to sample well annually for pollutants detected at the site and advise DEEP of any changes in occupancy.	4 wells identified and 4 sampled. Pollution below standards or not detected. Water treatment system installated on polluted well. Monitoring program implemented.	
Fairwood Shopping Center / Candlewood Playho State Routes 37 & 39	8/23/2005	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to submit a plan to continue quarterly monitoring of at-risk supply wells and provided bottled water for private residences with pollution over applicable criteria.	Water treatment system installed at one well. Monitoring program implemented for groundwater and four threatened wells.	
Mobil New Fairfield #01-E2E 94 State Route 37	10/12/2005	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the onsite and nearby identified wells for pollutants detected at the site.	Monitoring program implemented for three supply wells and groundwater. Water treatment system already installed at the polluted on-site well.	
New Fairfield Police Department 302 Ball Pond Road	11/29/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue sampling wells already monitored, and sample additional nearby supply wells, for pollutants detected at the site.	Six surrounding wells sampled three times; pollution not detected. Source of pollution removed. Wells re-tested, pollution not detected. No additional abatement action necessary.	

New Fairfield				
Site/location	Date Notified	Type of Hazard	Response	Action
Parcel 39 Route 39	10/14/2009	Pollution was detected in a drinking water well above standards.	DEP to follow up by confirmatory sampling of drinking water well. Resident has been notified to use bottled water until sample results are received.	DEP sampled well. Pollution not detected. No additional abatement action necessary.
New Haven				
Site/location	Date Notified	Type of Hazard	Response	Action
Amtrack Cedar Hill Maintenance of Way Base 255 Welton Street (Rear)	2/17/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to continue proposed actions and to inform persons with potential for exposure, post warning signs and install a fence to limit access to the polluted soil until the site is cleaned up.	Warning signs posted, site secured, and fence installed to limit the potential for contact with polluted soil.
Dwight Street Elementary School (Former) 130 Edgewood Avenue	5/6/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact. Furthermore, the property owner is working with the US EPA and CTDEP to coordinate remediation of the site.	Warning signs posted, site secured and fence installed to limit the potential for contact with polluted soil.
East Shore Substation 600 Connecticut Avenue (aka 1 Waterfront Str	1/6/2012 ee	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure to limit access to the polluted soil.	Disturbed soil has been removed and remaining contaminated soil has been covered by one foot of clean fill, limiting potential exposure.
Parcel 370 James Street	10/27/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to identify the extent of polluted soil and remove the polluted soil.	Impacted soils have been excavated. Property owner filing a deed restriction for low occupancy under the Toxic Substances Control Act to further limit exposure.
Quinnipiac Energy English Station 510 Grand Avenue	3/1/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined the polluted soil is in a secure area, limiting the potential for contact. DEP directed the property owner to post warning signs and inform persons with potential for exposure.	Site is under Cease and Desist Order # CDOWSUST-12-001, which prohibits any access to the site. Additionally, security measures now in place will prevent trespassers from illegally entering the site.
Rockwell Heat Treating 194 River Street	10/31/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area limiting the potential for contact. Per the notification, persons with potential exposure will be alerted, and warning signs will be posted.	Some polluted soil has been removed; the extent of the release area has been determined

New Haven				
Site/location	Date Notified	Type of Hazard	Response	Action
Simkins Industries, Inc. 260 East Street	11/18/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the soil pollution does not pose a significant threat because it is isolated under pavement.	No specific hazard abatement action necessary.
Troup Magnet Academy of Science 259 Edgewood Avenue	6/29/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil and remove it.	Impacted soils were excavated in August/Sept 2006 and rendered inaccessible at the site as described in the Remedial Action Report prepared by consultant in January 2008. No additional hazard abatement action necessary.
Williams Terminals Holdings, LP 85 East Street	11/25/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence or secure the area to limit access to the polluted soil.	Warning signs posted and fence installed to limit the potential for contact with polluted soil.
New London				
Site/location	Date Notified	Type of Hazard	Response	Action
Coca-Cola Bottling Co. of Southeastern New 951 Bank Street	En 3/28/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement, limiting the potential for contact.	Polluted soil removed; no additional abatement action necessary.
New Milford				
Site/location	Date Notified	Type of Hazard	Response	Action
Affordable Auto Motive 32 Executive Center Drive	9/21/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the eleven identified water supply wells within 500 feet of the site for pollutants detected at the site.	11 wells identified and 8 wells sampled (3 refused access). Pollution was not detected. Wells resampled in Feb/Mar 2013 due to another reported hazard. No contamination detected. Further monitoring pending.
B & W, LLC / Wetmores, Inc. 333 Danbury Road	5/20/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well on a quarterly basis and to identify and sample nearby wells for pollutants detected at the site.	Well receptor survey found three wells within 500 feet of the site. Two of three wells were sampled (one is not in use) and pollution was not detected. An on-site monitoring program was implemented. Off-site wells were resampled in 2013.
Bulls Bridge Hydroelectric Station Route 7	4/13/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and to identify and sample wells up to 500 feet downgradient from the site for pollutants detected at the site.	On-site drinking water well and monitoring well resampled. Pollution was not detected. No additional hazard abatement action necessary.

New Milford

Site/location	Date Notified	Type of Hazard	Response	Action
Candlewood Animal Hospital 117 Kent Road (Route 7)	5/17/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and nearby wells for pollutants detected at the site and to conduct an inventory of all drinking water supply wells at residences and businesses within 500 ft of the release.	Source of pollution removed. 6 wells identified and 6 wells sampled quarterly for one year. Pollution not detected. Groundwater monitoring shows pollution detected significantly below standards. No additional abatement action necessary.
Century Enterprise Center (former Century Bras 12 Scoville Street	s 12/9/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the polluted well quarterly for pollutants detected at the site, and advise DEP of any changes.	One well sampled. Pollution detected was significantly below standards. Monitoring program implemented.
Commercial Property 376 Danbury Road	4/20/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite and 3 nearest identified water supply wells for pollutants detected at the site. DEEP also directed the owner to further evaluate groundwater data.	2 of 3 nearby wells where owners allowed access were sampled. Results were non-detect for all constituents tested. Groundwater conditions no longer present hazard condition. No additional abatement action necessary.
Figliola Property 48 Wheaton Road	2/23/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the on-site water supply well and to identify and sample nearby water supply wells for pollutants detected at the site.	Well receptor survey conducted. On-site and two off-site wells sampled 2011-2012. Pollution not detected. Groundwater conditions no longer present hazard condition. No additional abatement action necessary.
Industrial Condominium 566 Danbury Road	12/6/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	All wells on-site and downgradient were sampled; pollution was not detected or was significantly below standards. One year of onsite monitoring shows that on-site well is not impacted. No additional abatement action necessary.
Medical Instill Technologies, Inc. 201 Housatonic Avenue	11/10/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional groundwater sampling data and determined the pollution is in fact below standards and does not pose a risk to supply wells.	No specific abatement action necessary; DEP requested notification if conditions change.
New Milford Plaza 164-180 Danbury Road	2/5/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the twelve identified water supply wells within 500 feet of the site for pollutants detected at the site.	Eight of the twelve wells (four refused access/didn't respond) sampled in Feb/Mar 2013. Results were non-detect for all constituents tested. Wells had been previously sampled in 2009 due to another reported hazard.
O & G Quarry 33 Boardman Road	5/24/2007	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	Five wells identified and four wells sampled, pollution either not detected or detected but below standards. Access denied to remaining well. No additional abatement action necessary.

New Milford				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 53 Sawyer Hill Road	5/14/2004	Pollution was detected in a drinking water well but is below standards.	DEP determined that pollution in the well is below standards, and water is safe for human consumption.	Source of pollution removed. No additional hazard abatement action necessary. DEP recommended periodic monitoring.
Taylor's Cleaners 104 Danbury Road	3/13/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the four threatened wells identified in the significant hazard notification on a quarterly basis for the pollutants detected at the site.	Four wells sampled, pollution not detected or detected significantly below standards. Further action pending.
Newington				
Site/location	Date Notified	Type of Hazard	Response	Action
Cedar Street Station 16 Fenn Road	12/2/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to post warning signs and install a fence or secure the area to limit access to the polluted soil until the site is cleaned up.	The impacted soil was excavated on Janaury 25, 2012 for offsite disposal. No further hazard abatement action necessary.
Willard Avenue Substation Route 173	5/18/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact with the polluted soil.	The top 2 feet of PCB-impacted soil was excavated. This hazard condition has been resolved.
Newtown				
Site/location	Date Notified	Type of Hazard	Response	Action
Residence 70 Mile Hill Road South	12/30/2013	Pollution was detected in a drinking water well but is below standards.	DEEP reviewed sampling data and determined pollution in the well is below standards and the water is safe for human consumption. DEEP requested additional monitoring to determine if the concentrations detected are stable or increasing.	Potable wells in area being monitored due to nearby remediation. Pollution does not appear to be related to the nearby remediation. Resampling of wells in area does not show any pollution detected. Area wells will continue to be monitored annually.
Residential Property 53 Mile Hill Road South	12/5/2005	Pollution was detected in a drinking water well above standards.	DEP directed the residents to use bottled water until a filtration system could be installed. DEP to monitor drinking water at neighboring residences.	Drinking water wells in area identified and sampled. Two found with pollution above standards; filter systems installed. Monitoring program shows pollution in two affected wells significantly below standards since 2008. No additional abatement action
Rocky Glen Mill 75 Glen Road	12/28/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the onsite supply well on a quarterly basis and to identify wells up to 500 feet away from the site.	Receptor survey completed. Monitoring program implemented. Pollution not detected in on-site well. No further abatement action necessary.

Newtown					
Site/location	Date Notified	Type of Hazard	Response	Action	
Sandy Hook Automotive & Marine Corp. 9 Glen Road (Sandy Hook)	3/28/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the on-site supply well and to identify and sample wells within 500 feet of the site for pollutants detected at the site.	Site in foreclosure. Public water extended to the area; some but not all properties within 500 ft are connected. Some unconnected wells tested; no pollutants of concern present exceeding criteria. Sampling of other wells by town officials pending.	
SCB Office Park 153 South Main Street	1/27/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence to limit access to the polluted soil. DEP also directed the property owner to submit a plan to investigate the area and clean up pollution.	Warning signs posted and fence installed to limit the potential for contact with polluted soil. The fence is being maintained annually. The extent of arsenic in soil above hazard criterion has been determined.	
North Branford					
Site/location	Date Notified	Type of Hazard	Response	Action	
Affordable Bus Charters Inc. 1071 Middletown Ave	8/3/2011	Pollution was detected in a drinking water well above standards.	DEEP advised the notifying party that they had no further obligation, since they were not the owner. DEEP is further reviewing its options and will act to assess and abate the condition as necessary.	The property owner completed improvements to the water supply system and re-sampled the supply well. Results from the re-sampling were non-detect for the constituents tested.	
North Canaan					
Site/location	Date Notified	Type of Hazard	Response	Action	
Geer Nursing & Rehabilitation Center 99 South Canaan Road	9/25/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the groundwater and the two identified water supply wells within 500 feet of the site for pollutants detected at the site.	PCB impacted soil removed. Two identified off- site potable supply wells sampled quarterly; no pollution detected.15 rounds of quarterly monitoring indicate no impact to the nearest supply wells. No further abatement action necessary.	
John B. Hull, Inc. 10 Orchard Street	1/27/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for pollutants detected at the site, until clean up of pollution is complete.	One well identified. Well sampled for five quarters and pollution not detected. No further hazard abatement action necessary.	
Residential Property 335 East Canaan Road	1/8/2003	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	No specific hazard abatement action necessary.	

North Haven

North Haven				
Site/location	Date Notified	Type of Hazard	Response	Action
Morganite Crucible 345 Washington Avenue	2/26/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence to limit access to the polluted soil.	Polluted soil removed; no additional hazard abatement action necessary.
Pharmacia & Upjohn Company 41 Stiles Lane	2/28/2005	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to implement a proposed sampling program to evaluate the actual polllution concentration in the surface water.	Property owner has implemented controls to treat groundwater before discharging to surface water body.
North Stonington				
Site/location	Date Notified	Type of Hazard	Response	Action
Prestonwold, Inc. 154 Miller Road	4/17/2003	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide bottled water to the property with the polluted well.	DEP monitored affected wells for volatile organic chemicals; and the concentrations diminished to non-detect over time. Confirmation sampling was conducted in 2009 and the results remained non-detect. No further action required.
Norwalk				
Site/location	Date Notified	Type of Hazard	Response	Action
Norwalk Compressor Company (former) 20 North Water Street	2/27/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under a building, limiting the potential for contact; and remediation to remove the soil is scheduled for 2008.	Site-wide remediation ongoing.
Residential Property 54 Nursery Street	10/13/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to implement their proposed response, which is evaluation of additional sampling data to determine if treatment or additional monitoring is necessary.	On-site well sampled, pollution either not detected or detected but below standards. Source of pollution removed and passive remedial system installed. No additional hazard abatement action necessary.
The Fairfield County Savings Bank 26 Chestnut Hill Road	10/10/2003	Petroleum products in groundwater may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Additional sampling conducted, pollution not detected. Source of pollution removed.
Norwich				
Site/location	Date Notified	Type of Hazard	Response	Action
7-Eleven Store # 32524 152 Taftville Occum Road	6/24/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to implement proposed quarterly sampling of the well for the pollutants detected at the site, and to provide a water treatment system if levels of pollution rise.	Further sampling to be conducted as part of public water supply monitoring as required by Department of Public Health.

Norwich				
Site/location	Date Notified	Type of Hazard	Response	Action
Austins Garage 53 Taftville Occum Road	10/12/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site, and also to assess the potential for organic vapor intrusion at three addresses.	Nine wells were identified within 500 feet downgradient of the site. Volatile organic chemicals were not detected. Further evaluation of site data did not suggest a risk of vapor intrusion to nearby residences.
Norwich Fish & Game 44 Browning Road	10/28/2008	Pollution was detected in a drinking water well, but is below standards.	DEP requested that the City of Norwich evaluate potential impact to downgradient receptors in consultation with the DEP.	Well is sampled twice per year by the City of Norwich as part of its monitoring of groundwater in the vicinity of the Rogers Road landfill. Concentrations in water remain below maximum contaminant levels.
Rogers Road Landfill Rogers Road	10/15/2010	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data for the affected wells and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	Monitoring program implemented.
Thayer Building 16 Franklin Street	9/4/2002	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Plan of action submitted. Building vacant. Plan of action to be implemented as part of redevelopment.
Old Lyme				
Site/location	Date Notified	Type of Hazard	Response	Action
Bestway Citgo Gasoline Service Station 281 Shore Road (Route 156)	9/8/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Sampling conducted, only one well had pollution above standards. Property with polluted well is seasonal and has been connected to public water. Well is still present, but not used for drinking water.
Lyme - Old Lyme High School 69-2 Lyme Street	7/15/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Underground tank removed with no signs of a release. Wells located within 500 feet of tank grave have reportedly been disconnected and are no longer in use as water supply. On-going monitoring of groundwater to be performed.
Old Saybrook				
Site/location	Date Notified	Type of Hazard	Response	Action
CT DoT Maintenance Facility (former) 45 Ferry Road	10/11/2007	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water.	Bottled water provided pending connection to public water supply. DEP requested a technical report that analyzes potential for onsite pollution to affect the bedrock aquifer in vicinity.

Old Saybrook				
Site/location	Date Notified	Type of Hazard	Response	Action
Grossman Chevrolet 300 Middlesex Trunpike	11/17/2005	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the polluted well quarterly to ensure the installed filtration system is effectively removing contaminants of concern from the water supply.	Filter system was already installed on affected well. Source of pollution removed, further action including expanded onsite groundwater monitoring pending.
Grossman Chevrolet 300 Middlesex Turnpike	4/21/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data and determined that groundwater pollution is in fact below standards, and does not threaten a supply well.	Nearest supply well tested with no pollution detected. No additional hazard abatement action necessary.
Old Saybrook Bridge Maintenanace Facility 441 Middlesex Trunpike	8/14/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed additional sampling data and determined pollution in the groundwater is below standards, and the water is safe for human consumption.	
Orange				
Site/location	Date Notified	Type of Hazard	Response	Action
Mobil Service Station #01-355 Wilbur Cross Parkway (Northbound)	6/28/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the responsible party to identify and sample nearby wells for pollutants present on the site.	Gas station being remediated during reconstruction of facility.
Oxford				
Site/location	Date Notified	Type of Hazard	Response	Action
Quaker Farm Schools 30 Great Oak Road	12/20/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the out-of-use onsite supply well and to identify and sample nearby wells for pollutants detected at the site.	Groundwater treatment system in operation. Pollution not detected in two years monitoring nearest three drinking water wells. Sampling of indoor air shows air pollution is not at levels that pose a significant risk.
Plainfield				
Site/location	Date Notified	Type of Hazard	Response	Action
CT Property (Griswold Rubber Co. lease) 1 River Street	2/8/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and implement a proposed removal of the polluted soil.	Warning signs posted and mulch cover installed to limit the potential for contact; removal of soil pending.
Frybrook Substation 18 Community Avenue Extension	8/31/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is in a fenced electrical substation; no specific hazard abatement action necessary.

shows groundwater does not flow to that well.

A sensitive receptor survey was conducted. Two properties have potable water supply

wells. One well is regulated by and routinely monitored for the Dept. of Health. Another well was sampled and no pollution was detected.

No further action is required.

10/18/2013

Getty Station #688 (former)

301 East Street

Plainfield Site/location Date Notified Type of Hazard Response Action Griswold Rubber Company, Inc. 3/15/2007 Pollution in the top two feet of soil DEP directed the property owner to Engineered cap installed under DEEP may pose a risk to human health inform persons with potential for approved plan. Long-term O&M to be 1 River Street performed under approved plan. as a result of direct contact. exposure, post warning signs and secure the area to limit access to the polluted soil until the site is cleaned up. Hendel's, Inc. 9/10/2010 Pollution detected in groundwater DEP directed the property owner to Well survey complete. Nearby wells sampled above standards may threaten a sample nearby wells for pollutants and were non-detect. Several requests for 600 Norwich Road drinking water well. detected at the site. access were denied. Parcel 12/6/2004 Pollution in the top two feet of soil DEP directed the property owner to Polluted soil excavated and removed from site. may pose a risk to human health submit a plan to identify the extent of Also, on-site well and two nearest off site wells. 154-156 Plainfield Pike polluted soil, limit access to the polluted were sampled for pesticides, volatile organic as a result of direct contact. soil, and test a nearby well for the chemicals, and metals including arsenic. None pollutants present on the site. of the wells were found to be polluted. Plainfield XtraMart 11/22/2006 Pollution detected in groundwater DEP directed the property owner to Four nearby drinking water wells tested; above standards may threaten a sample wells on adjacent properties for pollution was not detected. On-site drinking 705 Norwich Road (Route 12) drinking water well. pollutants detected at the site. water well abandoned. Monitoring program implemented. Residence 11/20/2007 Pollution detected in groundwater DEP directed the property owner to Remediation completed: nearby wells sampled. above standards may threaten a sample the onsite supply well and no polution detected. Filter system installed on 484 North Main Street the on-site well. Susbsequent monitoring of ondrinking water well. downgradient supply wells for pollutants detected at the site pursuant site well indicated pollution no longer present. to a remediation plan developed in No further action necessary. consultation with the DEP and concurrent with the notification. **Plainville** Site/location Date Notified Type of Hazard Response Action General Electric Company (North Plant) 5/23/2008 Pollution detected in groundwater DEP directed the property owner to One well was sampled by DEP and pollution above standards may threaten a sample identified drinking water wells was not detected. For precaution DEP Woodford Avenue drinking water well. within 500 feet for pollutants detected at supplied, and later discontinued, bottled water. the site. Hydrogeological study performed at the site

Updated as of: Wednesday, March 26, 2014 All Districts Page 51 of 79

DEEP directed the property owner to

detected at the site.

sample identified wells for the pollutants

Pollution detected in groundwater

above standards may threaten a

drinking water well.

Plainville				
Site/location	Date Notified	Type of Hazard	Response	Action
Pressmation Inc. (former) 5 Northwest Drive	4/17/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed addional sampling data for the threatened wells and determined pollution present was significantly below standards. DEEP requrested a quarterly monitoring program for the impacted well.	Three wells identified and sampled, pollution either not detected or detected but below standards.
Valley Water Systems 161 Woodford Avenue	8/27/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed the groundwater sampling data and requested Valley Water Systems to continue to monitor the supply wells and monitoring wells.	The monitoring of 5 monitoring wells and two supply wells has been completed; petroleum and volatile organic chemicals were not detected. Two supply wells are on company's routine monitoring program.
Plymouth				
Site/location	Date Notified	Type of Hazard	Response	Action
FM 329 699 Main Street	11/8/2013	Pollution was detected in an onsite drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the threatened and polluted wells on the proposed sampling frequency for the pollutants detected at the site, and advise DEEP of any changes.	One onsite potable well and four offsite potable wells were sampled. Pollution was detected in onsite potable well but was below standards. Pollution was not detected in offsite potable wells. Monitoring program has been implemented.
Grimes Aerospace Facility (former) 50 Altair Avenue	7/28/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample 17 nearby wells for pollutants detected at the site.	All wells were sampled. Pollution were not detected in the wells sampled. Monitoring program has been implemented at the site.
Iseli Company 651 Greystone Road	5/3/2012	Chloroform was detected in a drinking water well but is below standards.	DEEP reviewed the sampling data and determined pollution in the well is below standards, and the water is safe for human consumption. The Department requested that the well in question be resampled.	The well was resampled and chloroform was not detected. No further abatement action is necessary pertaining to this notification.
J. T. Mac Dermid Group 400 Harwinton Avenue	12/16/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 1000 feet from the site for pollutants detected at the site.	Risks to the downgradient residents are resolved as all downgradient potable wells are connected to public water. This hazard notification has been resolved.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the threat to surface water and aquatic life.	
Proposed High School Site 564 Main Street	10/17/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP indicated it is already aware of and is evaluating this condition; and that the party submitting the notification was not required to do so under the law.	DEP evaluating site.

Plymouth

Site/location	Date Notified	Type of Hazard	Response	Action
Woodworking Design & Supply 284 Town Hill Road	9/25/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed information provided and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	Bottled water is being provided voluntarily by property owner, who will periodically resample the well. No specific hazard abatement action necessary.
Portland				
Site/location	Date Notified	Type of Hazard	Response	Action
271-277 Marlborough Street 271-277 Marlborough Street	8/6/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed the well receptor survey report and determined that there is no potential exposure since no potable well is identified within 500 feet of the site.	Well receptor survey has been completed and no potable well was identified with 500 feet of the site. Proposed for soil excavation and natural attenuation.
Residential Property 37 Maple Road	6/11/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells adjacent to both sides of the property	Property owner tested wells requested by the department and found no contamination above applicable standards in 2007. DEEP will sample these wells in December 2013 or Januanry 2014.
Preston				
Site/location	Date Notified	Type of Hazard	Response	Action
Norwich State Hospital Route 12	2/9/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure, patrolled area, limiting the potential for contact.	Access is restricted; no specific hazard abatement action necessary.
Prospect				
Site/location	Date Notified	Type of Hazard	Response	Action
Sunoco Gasoline Service Station 68 Waterbury Road	12/6/2012	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Survey in September 2012 identified wells. Samples were reported as none detected for volatile organic chemicals and petroleum. The on-site potable well has MTBE below standards. A monitoring program has been initiated and is ongoing.
Putnam				
Site/location	Date Notified	Type of Hazard	Response	Action
Gomes Total Chrysler 157 Providence Pike	6/23/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Sampling conducted, pollution below standards. No additional monitoring required fo hazard abatement.

compounds detected are less than applicable

criteria.

Putnam				
Site/location	Date Notified	Type of Hazard	Response	Action
Interstate Shell 647 School Street	2/17/2009	Pollution was detected in a drinking water well, but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site well sampled. Trace level volatile organic chemicals present. Ongoing monitoring to be performed. No other drinking water wells within 500 feet downgradient.
Kars of Putnam, LLC 181 Killingly Avenue	2/1/2006	Pollution detected in groundwater above standards may threaten drinking water supply wells.	DEP directed the property owner to sample the onsite supply wells and identify and sample nearby wells for pollutants detected at the site.	Wells identified and sampled, pollution not detected. No additional hazard abatement action necessary.
Putnam Precision Moulding, Inc. 11 Danco Road	11/19/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened wells semi-annually for the pollutants detected at the site, and advise DEP of any changes.	Monitoring program implemented.
Ridgefield				
Site/location	Date Notified	Type of Hazard	Response	Action
Commercial Property Ethan Allen Highway	10/1/2007	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide the results of the receptor survey to the DEP.	According to the property owner, a charcoal filter has been installed on the drinking water supply system and a receptor survey has been initiated.
Exxon Service Station #3-6047 (former) 626 Danbury Road	4/8/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and also identified supply wells up to 750 feet away from the site for pollutants detected at the site.	Source of pollution removed, and monitoring data shows tested wells are non-detect or below standards. No additional abatement action necessary.
Residence 78 Picketts Ridge Road	8/26/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the on-site well and the eight (8) identified wells located adjacent to the property for pollutants detected at the site.	Source of pollution removed and monitoring data shows threatened wells not affected. No additional abatement action necessary.
Ridgefield European Moters, Inc. 746 Danbury Road	3/18/2008	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to maintain an existing treatment system, and also required identification and sampling of supply wells within 500 feet for pollutants detected at the site.	Site being remediated.
Shell Facility #136367 130 Danbury Road	10/12/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite well and to sample all identified drinking water supply wells	Groundwater monitoring samples collected from site and neighboring potable well since SEHN report indicate that concentrations of

within 500 feet of the site for the

reported pollutants detected at the site.

Rocky Hill				
Site/location	Date Notified	Type of Hazard	Response	Action
Dividend Partners LLC 145 Dividend Road	3/16/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and install a fence or secure the area to limit access to the polluted soil, and to submit a plan to evaluate and mitigate the hazard condition.	The hot spot PCB-impacted soil was removed. An Engineered Control will be approved soon to address on site remaining PCB problem.
Royal Clothing Care 825P Cromwell Avenue	8/22/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	One well was monitored quarterly and target compounds were not detected. Access was attempted multiple times but could not be obtained to the other potable well. Active remediation is completed and groundwater is monitored on an annual basis.
Roxbury				
Site/location	Date Notified	Type of Hazard	Response	Action
DL Property Trust 212 Good Hill Road	8/13/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide the sample results for the two onsite supply wells and to identify and sample wells within 500 feet of the site for pollutants detected at the site.	One offsite well identified; offsite and 3 onsite wells tested and pollution not detected in 4 quarters of testing. Contaminated soils were removed and impacted groundwater remediated. No further abatement action necessary.
Salem				
Site/location	Date Notified	Type of Hazard	Response	Action
Maple Shade General Store 428 Hartford Road	4/11/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample potable water supply wells up to 500 feet away from the site for pollutants detected at the site.	Several drinking water wells identified and sampled. Pollution not detected in drinking water wells. Air sparging/soil vapor extraction system installed 2006. Ground water sampling durning 2013 indicates pollution not migrating offsite.
Salisbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Residence 433 Salmon Kill Road	10/25/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site and eight surrounding water supply wells sampled. Pollution not detected. Monitoring program implemented.

Salisbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 396 Sharon Road (Lakeville)	5/25/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Source of pollution removed. One drinking water well identified and sampled; pollution not detected. Owner re-tested well to confirm that there is no impact to the well. Pollution was not detected. No further abatement action necessary.
Seymour				
Site/location	Date Notified	Type of Hazard	Response	Action
Comcast 80 Great Hill Road	12/3/2007	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to re- sample the onsite supply wells and to identify and sample nearby wells for pollutants detected at the site.	18 wells identified/15 wells sampled. Pollution either not detected or detected below standards. Onsite well is DPH regulated and has a treatment system. Monitoring program implemented on-site and for nearest drinking water well.
Diversified Electric 130-150 Silvermine Road	4/28/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the on-site supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well receptor survey found two off-site drinking water wells within 500 feet of the site. Quarterly monitoring program implemented (on & off-site). For all wells sampled, pollution either not detected or detected but below standards.
Sharon				
Site/location	Date Notified	Type of Hazard	Response	Action
Sharon Hospital 50 Hospital Hill Road	6/15/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for the pollutants detected at the site.	Source of pollution removed from soil and groundwater. Pollution not detected in supply well in four rounds of quarterly monitoring. No additional abatement action necessary.
Sharon Xtramart 17 Gay Street	11/14/2011	Migrating vapors may pose an explosion risk.	DEEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	Source of pollution abated. Sampling of indoor air quality shows that air pollution is not at levels that pose significant risk. No additional abatement action necessary.
Shelton				
Site/location	Date Notified	Type of Hazard	Response	Action
Crabtree Autobody (former) 409 Bridgeport Avenue	4/25/2012	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and sample the 4 nearest supply wells for pollutants detected at the site.	Supply well impacted with benzene and toluene below standards. Off-site supply wells within 500 feet of site not impacted. Additional quarterly potable supply wells sampling results pending.

Shelton				
Site/location	Date Notified	Type of Hazard	Response	Action
Industrial Building 710 Bridgeport Avenue	9/7/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a fence or otherwise secure the area to limit access to the polluted soil until the site is cleaned up.	Warning signs posted and fence installed to limit the potential for contact with polluted soil.
Viking Tool, Inc. 445 Access Road	9/1/2011	Pollution was detected in a drinking water well at levels that require further evaluation.	DEEP directed the property owner to sample an onsite supply well, identify supply wells within 500 feet of the site, sample nearby wells for pollutants detected at the site, and post warning signs at locations where onsite well water may be consumed.	4 wells identified and 2 wells sampled (on-site well and one off-site well). Pollution not detected. Access was denied for sampling of 2 wells. No additional abatement action necessary.
Sherman				
Site/location	Date Notified	Type of Hazard	Response	Action
Rizzo's Garage 2 Route 39 North	12/2/2011	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to provide an alternate supply of potable water to the site and to re-test the onsite well and nearby wells for pollutants detected at the site.	Bottled water being provided by owner although resampling of on-site well did not detect any pollution. 7 adjacent properties identified and 3 wells sampled. Results were non-detect for all constituents tested. Other wells to be sampled as available.
Rizzo's Garage 2 Route 39 North	11/28/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite and nearby identified wells within 500 feet for pollutants detected at the site and to provide an alternate supply of water if pollutants detected in drinking water wells above standards.	Bottled water being provided by owner although resampling of on-site well did not detect any pollution. 7 adjacent properties identified and 3 wells sampled. Results were non-detect for all constituents tested. Other wells to be sampled as available.
Simsbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Mobil Service Station No,. 01-QQC 955 Hopmeadow Street	6/9/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to confirm if a neigboring supply well exists and, if so, sample the well for pollutants detected at the site.	The nearby potable wells were sampled and no contaminants of concern were detected.
Shell Facility #136370 12 Albany Turnpike	4/15/2004	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data, which showed pollution was below standards, and recommended additional sampling of well.	Filter was provided to the impacted well. Subsequent samples from the impacted well have indicated that petroleum hydrocarbons are not detected.

Simsbury					
Site/location	Date Notified	Type of Hazard	Response	Action	
Shell Facility #136370 12 Albany Turnpike	12/29/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site. DEP reviewed the additional data, which showed pollution below standards, and required additional sampling of the well.	Additional sampling conducted, pollution detected above standards. Additional hazard notification submitted 04/15/2004. Treatment system installed and subsequent samples indicate pollution not detected.	
Somers					
Site/location	Date Notified	Type of Hazard	Response	Action	
495 Springfield Road 495 Springfield Road	8/8/2008	Fuel Oil detected in groundwater may threaten a drinking water well.	DEP directed the property owner to conduct quarterly monitoring of on-site and adjacent potable water supply wells and to continue monitoring an installed sub-slab depressurization system.	2/09 groundwater monitoring did not detect volatile organic substances or petroleum hydrocabons. Monitoring continuing.	
Conval, Inc. 265 Field Road	7/16/2003	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Sampling conducted at one well, pollution not detected. Reports are provided to DEP and DPH. Looking to complete 1 year monitoring in 2009 with compliance to be to background	
Somers Xtramart 169 Main Street	11/23/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby potable supply wells for pollutants detected at the site.	Potable supply wells were sampled and did not contain petroleum or benzene. The potable supply wells will continue to be sampled for contaminants of concern.	
South Windsor					
Site/location	Date Notified	Type of Hazard	Response	Action	
Ful-Line Auto 1546 John Fitch Boulevard	8/24/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to sample the onsite supply well and identify wells up to 500 feet away from the site.	No drinking water supply wells identified within 500 ft. Onsite drinking water well sampled with no detections of volatile organic compounds.	
Mobil #01-QQA 249 Oakland Road	6/11/2007	Petroleum products in groundwater treaten a drinking water well.		Installed product recovery system and sampled downgradient supply wells with no detection of petroleum products.	
		A surface water body is impacted by free product migrating from the site.			
Spelucin Property 1708 Ellington Road	5/13/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to contiue to monitor onsite groundwater condition and submitt annual reports.	Downgradient drinking water wells sampled multiple times and contained no contaminants of concern	

Southbury					
Site/location	Date Notified	Type of Hazard	Response	Action	
KAN-PAK 425 Main Street North	11/4/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional information provided and determined the pollution does not pose a risk to supply wells.	No specific hazard abatement action necessary.	
Regal Cleaners 220 Main Street South	5/14/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample wells identified within 200 feet of the site for pollutants detected at the site.	Wells sampled, one well was polluted above action level in 2005 and treatment was provided but it has been below the action level for over a year. Groundwater monitoring shows pollution below standards.	
Shell Station #136373 121 Main Street North	12/3/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed property owner to identify and sample nearby wells for pollutants detected at the site.	All water supply wells sampled once. Access denied for on-going supply well monitoring. No significant pollution detected. Source of pollution removed. Monitoring program for groundwater implemented.	
Shepaug Hydroelectric Station 2225 River Road	4/5/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data for the threatened on-site well and determined that pollution is not, in fact, present in the well.	On-site well was sampled, and pollution was not detected. Bottled water is used for drinking water purposes. Long term monitoring is in place until site remediation complete. No additional abatement action necessary.	
Space Swiss 238 Reservoir Road	10/25/2004	Pollution was detected in drinking water wells, and some have pollution above standards.	DEP directed the property owner to identify and sample additional wells up to 1000 feet away from the site for pollutants detected at the site, and to provide bottled water or treatment to property with polluted wells above standards.	Water line extension completed. All contaminated wells closed. No further hazard abatement action necessary.	
Space Swiss 238 Reservoir Road	10/6/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Three wells sampled, two had pollution above standards, bottled water provided pending long-term solution. Water supply line installed and affected residences connected. No further hazard abatement necessary.	
Space Swiss 238 Reservoir Road	11/25/2003	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	All nearby residences now connected to public water. No further hazard abatement action necessary.	
Southington					
Site/location	Date Notified	Type of Hazard	Response	Action	
Marion Mall XtraMart 2201 Route 322 (Meriden-Waterbury Turnpike	9/3/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	All potable wells within 1,000 ft of the site were connected to public water. No further abatement action necessary.	

List of Significant Environmental Hazards Reported to the DEP

Southington				
Site/location	Date Notified	Type of Hazard	Response	Action
Milldale XtraMart 1611 Route 322 (Meriden-Waterbury Turnpike	9/3/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	One drinking water supply well identified within 500 feet of the site. The location was vacant and as a result no sample was collected. Ongoing investigation.
New Star Dry Cleaners / Carriage Trade Clear 415 North Main Street	ner 5/20/2003	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Southington Water Pollution Control Facility 12 Maxwell Noble Drive	5/20/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to expand the barrier fence perimeter, install a temporary cover over highly PCB impacted soil (above 30 ppm), and provide a plan for short term and long term soil removal actions.	The area of elevated PCBs is located within the fenced facility. The majority of the area of elevated PCBs is isolated by a perimeter barrier.
Sprague				
Site/location	Date Notified	Type of Hazard	Response	Action
Pautipaug Country Club 7 Dows Lane	5/3/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site, and to provide a plan to remove the source of the contamination.	On-site and nearby wells sampled and were non-detect for pollution present at the site. Source remediated. No further abatement action necessary. Arsenic determined to be naturally occurring.
Taylor Site 40 Hanover-Versailles Road	10/31/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Action pending.
Stafford				
Site/location	Date Notified	Type of Hazard	Response	Action
Residence 194 East Street	10/2/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to submit a plan to identify the extent of polluted soil, notify site occupants, and remove or limit access to the polluted soil.	Local health department provided documentation indicating that surface soil was covered with plastic cover and mulch layer. Additional abatement pending under supervision of local health department.
TTM Technologies 4 Old Monson Road	11/13/2007	Pollution in the top two feet of soil may pose a risk to human health	DEP directed the property owner to inform persons with potential for	Polluted soil removed; no additional abatement action necessary.

exposure, post warning signs and install a fence or otherwise secure the area to limit access to the polluted soil until the

site is cleaned up.

as a result of direct contact.

Stamford

Site/location I	Date Notified	Type of Hazard	Response	Action
120 Long Ridge LLC, Parcel B-R 120 Long Ridge Road	6/19/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample private supply wells up to 500 feet away from the site for pollutants detected at the site and provide an alternative supply of potable water if necessary.	Eight drinking water wells sampled, pollution not detected. No additional abatement action necessary.
120 Long Ridge LLC, Parcel B-R 120 Long Ridge Road	9/25/2008	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life.	No specific hazard abatement action necessary
Antares Gateway SPE, LP 424 Washington Boulevard	5/2/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and established that the polluted soil is in a secure and fenced area, limiting the potential for contact. DEP requested this security be maintained, and a report be submitted when planned remediation is completed.	No direct exposure pathway to polluted soil exists, and this security will be maintained until site is remediated. Remediation will be completed during re-development activities proposed for the site.
Antares Walter Wheeler Drive 69 Walter Wheeler Drive & 25 Washington Blvd.	7/5/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to delineate the extent of polluted soil and post warning signs, inform persons with potential for exposure, and maintain fence and asphalt cover to limit access to the polluted soil until the site is cleaned up.	Remediation initiated.
City Carting and Recycling 39 and 42 Woodward Avenue	10/17/2012	Pollution detected in groundwater above standards may threaten a drinking water well. Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP reviewed the well receptor survey information and determined that supply wells are not located in the area and directed the property owner to investigate the extent and degree of groundwater pollution to evaluate the threat to surface water.	No wells were found to be within 500 feet of the groundwater pollution; groundwater threat to surface water evaluated for site-specific conditions and determined to not significantly impact surface water body or aquatic life.
Commercial Property 860 Canal Street (aka 390 Ludlow Street)	1/22/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to identify the extent of polluted soil and secure the area to limit access to polluted soil until the site is cleaned up and to sample groundwater to further evaluate the threat to surface water and aquatic life.	Area of polluted soil already paved, warning sign posted. Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Long Ridge Service Station 1095 Long Ridge Road	2/5/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	33 wells identified and 20 wells sampled from all owners granting permission. Pollution from site not detected. No additional hazard abatement action necessary.

Stamford

Site/location	Date Notified	Type of Hazard	Response	Action
Pitney Bowes Facility 23 Barry Place	3/10/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and maintain the pavement limiting access to the polluted soil until the site is cleaned up.	Polluted soils are covered by asphalt pavement and site is secured, limiting potential contact with polluted soil.
Residential Parcel (Source Unknown) Diamondcrest Lane	7/7/2009	Pollution was detected in a drinking water well above standards.	DEP required additional sampling of the private well for total petroleum hydrocarbons (TPH) 3 months after the initial sampling event to confirm that pollution is not in fact present in well.	Two samples were collected 2 to 3 weeks after the initial sample, and pollutants were not detected above the analytical detection limit. Additional samples collected 9 & 12/2009 and 3/2010 indicated that TPH is not present in the supply well.
Residential Property 351 Erskine Road [North Stamford]	12/18/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the two onsite wells and the private supply wells located immediately adjacent to the property for pollutants detected at the site and to submit a plan to monitor groundwater quality on site.	Action pending.
Residential Property 216 East Middle Patent Road	9/6/2002	Pollution by fuel oil was detected in a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site, and to properly abandon the old on-site supply well.	Source of pollution removed. New well installed, and testing of it found no pollution. Additional sampling conducted, no pollution detected. Old well abandoned as required.
Residential Property 75 Partridge Road	8/5/2004	Pollution was detected in a drinking water well above standards, and other pollution detected in groundwater above standards may threaten a drinking water well.	Homeowner uses bottled water and has a water treatment system. DEP directed the property owner to identify and sample the onsite well and any wells located up to 500 feet from the site for pollutants detected at the site.	Source of pollution remediated, five nearby wells tested for pollutants detected on site, concentrations below analytical detection limit.
Residential Property 267 Thunder Hill Drive	12/23/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional information and determined that the pollution release was limited, and that the threatened well was tested, with no pollution detected.	No additional hazard abatement action necessary. DEP recommended periodic sampling of the well.
Residential Property 90 Wellington Drive	3/23/2005	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data for affected wells and determined that pollution in the wells was not confirmed. DEP recommended additional sampling to verify actual water quality in the wells.	Source of pollution removed, DEP will coordinate further sampling to more conclusively determine water quality in the wells.

Stamford	ł
-----------------	---

Site/location	Date Notified	Type of Hazard	Response	Action
Stamford Industrial Park/Yale & Towne Cor Market, Henry, Canal & Pacific Streets	nplex 1/3/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to identify the extent of polluted soil, inform persons with potential for exposure, post warning signs, and maintain the fence and bituminous concrete to limit access to the polluted soil.	Remediation inititated.
Stamford Industrial Park/Yale & Towne Cor Market, Henry, Canal & Pacific Streets	nplex 3/13/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to delineate the extent of polluted soil and inform persons with potential for exposure, post warning signs, and maintain the concrete slab to limit exposure to the polluted soil.	Remediation inititated.
Sterling				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 703 Margaret Henry Road	4/15/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened wells periodically for the pollutants detected at the site, and advise DEP of any changes.	Source of pollution removed, and monitoring data shows threatened wells not affected. No additional abatement action necessary.
Stonington				
Site/location	Date Notified	Type of Hazard	Response	Action
Densmore Oil Company 38 Old Stonington Road	10/30/2009	Pollution was detected in groundwater above standards and may threaten a drinking water well.	DEP directed the company to sample the on-site well for the pollutants present at the site.	Onsite well sampled. All contaminants of concern were non-detect. The site is being remediated via soil removal and in situ chemical oxidation.
Mon Ami French Cleaners (former) 11-13 Cottrell Street	12/5/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to 1) determine if indoor air quality is being affected and, if so, recommend a course of action; 2) perform a water well inventory; and 3) assess impacts to surface water quality.	No nearby drinking water wells identified. Sub- slab ventilation system was installed and operating to mitigate any potential vapors beneath the building. Potential impacts to nearby surface water body still being evaluated.
Stratford				
Site/location	Date Notified	Type of Hazard	Response	Action
Airport Property part of Raymark OU 6 1000 Great Meadow Road	12/13/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and secure the area to limit access to the polluted soil until the site is cleaned up.	Access restricted; remediation pending.

Stratford				
Site/location	Date Notified	Type of Hazard	Response	Action
Numet, Inc. 50 Century Drive			DEEP directed the property owner to resample the groundwater to further evaluate the threat to surface water and aquatic life.	Resampled monitoring wells, concentrations below standards; no potable wells identified within 500 feet of the groundwater pollution; no additional abatement action necessary.
U.S. Chrome Corporation 175 Garfield Avenue	2/5/2004	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to investigate the extent and degree of groundwater pollution, and to evaluate the threat to surface water and aquatic life.	Monitoring program implemented, groundwater concentrations decreasing, closest surface water body located over 0.5 miles away.
Suffield				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 1117 North Grand Street	8/15/2005	Pollution by fuel oil was detected in a drinking water well.	DEP directed property owner to continue to sample potable water supply wells and maintain treatment systems.	Treatment systems have been installed. Long- term monitoring and maintenance is conducted by responsible party under Order SRD-197.
Thomaston				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 655 Fenn Road	1/5/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well for four consecutive quarters and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Pollution not detected for three consecutive quarters. Additional sampling completed for potable and monitoring wells demonstrates the absence of polluted groundwater within 500 feet of the supply well and in the potable well.
Route 8 Gasoline Spill Route 8	9/29/2011	Pollution associated with a gasoline release may threaten a drinking water well, pose a direct exposure risk, threaten surface water quality and pose an explosion risk.	Risk of explosion handled by DEEP Spill Response Division at time of spill. DEEP requested information on soil removal. DEEP directed the property owner to sample the six nearby wells and evaluate the threat to surface water.	Source area remediated. Six closest wells sampled and all results were either non-detect for all constituents tested or the constituents detected were not associated with the tanker release. Sampling plan implemented and ongoing.
Thompson				
Site/location	Date Notified	Type of Hazard	Response	Action
Johnson Corrugated Products 720 Thompson Road	2/23/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Water treatment system installed. House subsequently demolished and well no longer in service. No addititional abatement action necessary.

Thompson					
Site/location	Date Notified	Type of Hazard	Response	Action	
Norampac Thompson Inc. 720 Thompson Road	7/13/2004	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to conduct sampling of additional wells and install a water treatment system if pollution is confirmed.	Water treatment system installed. House subsequently demolished and well is no longe in use. No addititional abatement action necessary.	
Tolland					
Site/location	Date Notified	Type of Hazard	Response	Action	
Mobil Service Station #01-328 56 Merrow Road	1/3/2003	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to conduct periodic well sampling for pollutants detected at the site.	Additional sampling conducted, pollution remains below standards.	
Tolland XtraMart 153 Hartford Turnpike	9/22/2005	Pollution was detected in a drinking water well but is below standards, and other pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed the data provided and concluded water in the supply well is potable. DEP directed the property owner to implement their proposed plan to study groundwater on-site and resample nearby supply wells to confirm groundwater quality.	Wells identified and sampled, pollution either not detected or detected but below standards.	
Torrington					
Site/location	Date Notified	Type of Hazard	Response	Action	
D'Angelo Property 981 Torringford Street	8/4/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed information provided and determined that the property with the threatened well is vacant and the well is disconnected from the house.	action necessary.	
Federal Business Products, Inc. 368 Ella T. Grasso Avenue	. Grasso Avenue above standards may threaten a data and determined the pollution is not drinking water well. resulting in significant impact to soil and		Conducting quarterly sampling of groundwater monitoring wells. Owner is conducting site investigation and remediation under the property transfer program.		
Getty Service Station No. 6817 1294 East Main Street	4/24/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to submit a plan to abate the hazard condition.	Abatement action plan submitted and nearby supply wells sampled were non-detect for the contaminant of concern.	
IMI Cornelius Wilshire Facility (former) 2788 Winsted Road	8/22/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil has been removed, eliminating the exposure risk.	Polluted soil removed; no additional hazard abatement action necessary.	
Northside Drive Area Northside Drive	4/23/2004	Pollution was detected in a drinking water well above standards.	DEP provided bottled water and conducted additional sampling. DEP reviewed additional sampling and determined the well's water is not polluted above standards.	Reported problem is not caused by pollution. No additional hazard abatement action necessary.	

Torrington

Site/location	Date Notified	Type of Hazard	Response	Action
Northside Drive Area 60 Northside Drive	6/9/2004	Pollution was detected in a drinking water well above standards.	DEP provided bottled water and conducted additional sampling. DEP reviewed additional sampling and determined the well's water is not polluted above standards.	Reported problem is not caused by pollution. No additional hazard abatement action necessary.
Northside Drive Area Northside Drive	5/14/2004	Pollution was detected in a drinking water well above standards.	DEP provided bottled water and conducted additional sampling. DEP reviewed additional sampling and determined the well's water is not polluted above standards.	Reported problem is not caused by pollution. No additional hazard abatement action necessary.
Residence 52 Cook Street	6/25/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to conduct the abatement action which includes removing the top few inches of soil.	Soil to be removed following house restoration
Residence 30 Apter Drive	10/20/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify wells within 500 feet and sample the closest downgradient potable water supply well.	No volatile organic compounds detected in identified and sampled downgradient wells; impacted soil removed and passive venting system installed for remediation. No additional hazard abatement action necessary.
Residence 41-43 James Street	7/26/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to conduct the abatement action which includes removing the top few inches of soil.	Soil to be removed following house restoration.
Residential Dwelling 84 Pearl Street	2/23/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to complete the abatement plan proposed in the Significant Environmental Hazard Notification to remove and replace the contaminated soil.	Soil to be removed following house restoration.
Torrington Company Standard Plant (former) 59 Field Street	4/8/2004	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Additional sampling showed pollution does not pose a significant risk to indoor air quality.
Wilson Dodge & Nissan 1530 East Main Street	2/26/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	All identified wells that granted access were sampled for the contaminants of concern. Lead identified in the first sampling round was determined to be due to sampling error. All sampled supply wells were non-detect for the contaminants of concern.

Union					
Site/location	Date Notified	Type of Hazard	Response	Action	
Union School 18 Kinney Hollow Road	5/21/2008	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to maintain an existing filter and identify and sample nearby wells.	Fence installed; subsequently pesticide impacted soil removed and new well drilled away from remediated area. No further abatement action necessary.	
		Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs, install a fence to limit access to polluted soil, and submit a surface soil removal plan.	abatement action necessary.	
Vernon					
Site/location	Date Notified	Type of Hazard	Response	Action	
Mobil #01-QQQ 1292 Hartford Turnpike	2/15/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to monitor offsite monitoring wells and to sample residential drinking water wells if the monitored wells become impacted.	Continuing to sample on-site and off-site monitoring wells. Latest report received in 6 /0 and 2/09.	
Texaco Facility #100037 (former) 444 Hartford Turnpike	2/18/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Additional sampling conducted, no site-related pollutants detected. Other pollutants were detected but are below standards. No further hazard abatement action necessary.	
Voluntown					
Site/location	Date Notified	Type of Hazard	Response	Action	
Hartikka Tree Farm 262 Wylie School Road	6/20/2006	drinking water well but is below sample the onsite supply well and sampled, pollution either no		On-site and nearby wells identified and sampled, pollution either not detected or detected but below standards. No further action necessary.	
Voluntown Shell 251 Main Street	10/9/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	11 wells sampled, pollution either not detected or detected but below standards. Monitoring program implemented.	
Wallingford					
Site/location	Date Notified	Type of Hazard	Response	Action	
Barberino Property (former) Pent Road	6/9/2005	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to resample the groundwater to further evaluate the threat to surface water and aquatic life.	The property owner redeveloped and resampled the well and the levels of copper and zinc were below standards. No further abatement action necessary.	

Wallingford				
Site/location	Date Notified	Type of Hazard	Response	Action
Century Fireplace Furnishings 856 North Main Street Ext.	9/29/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution could pose a significant threat to indoor air quality.	A sensitive receptor study will be completed and a subslab depressurization system will be installed. Contaminated soils were removed and injection was done.
CYTEC Industries South Cherry Street	4/7/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil, notify site occupants, and limit access to the polluted soil.	PCB containing soils from the impacted area were excavated and removed from the site for disposal.
Marquette Medical Systems/Corometrics Fac 61 Barnes Industrial Park North	ility 5/18/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	A Sensitive Receptor Survey was completed in July 2004. Identified wells were sampled; these wells were last sampled in 2012. All samples were reported as non-detect for pesticides.
Masonic Healthcare Center 22 Masonic Avenue	12/19/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and inform persons with potential for exposure.	Access is restricted; no specific hazard abatement action necessary.
Washington				
Site/location	Date Notified	Type of Hazard	Response	Action
Washington Depot (former) 1 Green Hill Road	4/1/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site.	Petroleum impacted soil removed. All five downgradient water supply wells sampled; pollution was not detected. Wells determined not to be hydraulically downgradient. No further abatement action necessary.
Washington Substation Route 47	5/12/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is in a fenced electrical substation.
Washington Supply Company, Inc. Property 2 Calhoun Street	12/23/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Judea Water Co Water Supply Well #2 and 2 existing private drinking water supply wells sampled. All results were "non-detect" for contaminants of concern. No additional hazard abatement action necessary.

Period covering 8/01/2002 through 2/28/2014

Waterbury

Site/location	Date Notified	Type of Hazard	Response	Action
Chase Collegiate School 565 Chase Parkway	10/5/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined that polluted soil is under pavement and extent of polluted soil is delineated. DEP directed property owner to submit plan to notify persons with potential for exposure, to install fence, and to remove polluted soil.	Polluted soil removed; no additional hazard abatement action necessary.
Commercial Property 1713 Thomaston Avenue	4/14/2009	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Everybody's Market (former) 1200 South Main Street	7/8/2011	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property to supply additional information to further evaluate the threat to surface water and aquatic life.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Haydon Switch & Instrument, Inc. 1500 Meriden Road	10/26/2005	Polluted groundwater and soil vapor beneath an occupied building could affect indoor air quality.	DEP directed the property owner to identify private drinking water wells up to 1/4 mile away from the site; and to submit a plan to monitor groundwater, to characterize the impact on indoor air quality, and to develop a remedy to limit the impact.	No wells were found to be within 500 feet of the groundwater pollution. Vent system installed to prevent impact on indoor air quality. Groundwater monitoring ongoing. No additional hazard abatement action necessary.
ITW Waterbury Buckle 952 South Main Street	3/2/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed property owner to inform persons with potential for exposure and to limit access to soil until the site is cleaned up. DEP reviewed groundwater data and determined that pollution does not pose a significant indoor air quality threat.	Access to polluted soil is restricted by asphalt. Groundwater data shows that pollution is not at levels that pose a significant risk to indoor air quality. Monitoring program implemented.
Jonathan E. Reed School 33 Griggs Street	4/10/2012	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to provide additional information pertaining to the hazard condition.	Groundwater threat to surface water evaluated for site specific conditions and determined that identified threat was due to false positive results during groundwater sampling.
Lot 6, Waterbury Industrial Commons 1917 Thomaston Avenue	12/9/2013	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to perform proposed groundwater monitoring and source investigation.	Groundwater threat to surface water evaluated for site specific conditions and does not appear to significantly impact surface water and aquatic life. Further actions to evaluate groundwater conditions and pollution sources are pending.

not significantly impact surface water and

aquatic life. Further actions to evaluate

groundwater conditions are pending.

List of Significant Environmental Hazards Reported to the DEP

Waterbury Site/location Date Notified Type of Hazard Response Action Nelson Heat Treating 3/28/2011 Pollution detected in groundwater DEP directed the property owner to DEEP staff led a source removal and mitigation that discharges to a surface water submit a plan to investigate the extent action at the site. Groundwater from the 2046 North Main Street body may pose a risk to aquatic and degree of groundwater pollution, locations that originally triggered the hazard life and to evaluate the pollution migration condition were resampled and found to be nonand the threat to surface water and detect. No additional abatement action aquatic life. necessary. PGP Industries, Inc. (former) 9/25/2002 Pollution in the top two feet of soil DEP reviewed information provided and Access to polluted soil is limited by pavement: determined that the polluted soil is no specific abatement required. Property is may pose a risk to human health 46 Municipal Road as a result of direct contact. under payement and in a fenced area. unoccupied and secured. Hazard condition is limiting the potential for contact. controlled by Engineered Control Cap approved for the site in May 2011. Residence DEEP directed the property owner to Lead abatement action performed under public 7/20/2012 Pollution in the top two feet of soil may pose a risk to human health inform persons with potential for health program. Management plan 2259 North Main Street as a result of direct contact. exposure, post warning signs, and implemented to monitor lead surfaces and install a temporary fence to limit access control exposures during any maintenance to the polluted soil until the site is projects. cleaned up. UConn Waterbury Campus (former) DEP directed the property owner to Polluted soil removed: no additional abatement 6/8/2007 Pollution in the top two feet of soil inform persons with potential for may pose a risk to human health action necessary. 32 Hillside Avenue as a result of direct contact. exposure by posting warning signs and installing a fence to limit access to polluted soil until the site is cleaned up and to submit a plan to identify the extent of polluted soil. W.D. Stanley Co. (former) 3/15/2013 Pollution was detected in a DEEP directed the property owner to: Water supply wells with treatment systems and provide a schedule for monitoring two 4 nearby supply wells sampled (no access to 2 drinking water well above 3821 Fast Main Street water supply wells with treatment wells and 2 homes connected to public water). standards. systems: test_eight nearby supply No pollution found in drinking water. No on-site wells; evaluate vapor impact to vapor impact found. Off-site vapor impact Polluted groundwater beneath an occupied building could affect buildings: and provide a plan of action being evaluated. indoor air quality. to limit vapor impacts. Yankee Gas Former Waterbury North MGP 9/13/2013 Pollution detected in groundwater DEEP directed property owner to Groundwater threat to surface water evaluated that discharges to a surface water evaluate nature, extent and degree of for site specific conditions and determined to Jackson Street

groundwater pollution to determine the

threat to surface water and aquatic life

near the site by providing site-specific

dilution calculation and groundwater

monitoring information

body may pose a risk to aquatic

life.

Waterbury				
Site/location	Date Notified	Type of Hazard	Response	Action
Yankee Gas Former Waterbury North MGP Jackson Street	3/7/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact. DEP directed the owner to post warning signs to further limit exposure to soil until the site is cleaned up.	Warning signs posted, site secured, and fenced to limit the potential for contact with polluted soil.
Yankee Gas Work Center 47 Eagle Street	3/31/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform site workers, post warning signs, and install a fence or secure the area to limit access to the polluted soil.	All soils exceeding hazard criteria have been remediated. No additional abatement action necessary.
Yankee Gas Work Center 47 Eagle Street	9/2/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact. DEP directed the property owner to post warning signs.	Warning signs posted, area secured, and fence installed to limit the potential for contact with polluted soil.
Waterford				
Site/location	Date Notified	Type of Hazard	Response	Action
Cumberland Farms, Inc. Station #850636 47 Norwich-New London Turnpike (Norwich F	4/25/2011 Roa	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby identified wells for pollutants detected at the site.	Sampled four nearby wells. All wells were non- detect for the pollutants at the site. Two properties refused access and were not sampled.
Hendel's, Inc. 35 Great Neck Road	8/30/2010	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite groundwater well and sample the three closest drinking water wells for the pollutants detected at the site.	3 wells sampled, pollution either not detected or detected but below standards. Monitoring program implemented.
Watertown				
Site/location	Date Notified	Type of Hazard	Response	Action
Eyelematic Manufacturing Corp. Inc. 1 Seemar Road	10/18/2005	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to identify private drinking water wells up to 1/4 mile away from the site; and to submit a plan to characterize the impact	No drinking water wells identified within 1/4 mile. Monitoring wells installed at downgradient property line. Sub-slab depressurization system installed to limit vapor

Period covering 8/01/2002 through 2/28/2014

V	V	a	te	er	to	W	/n
---	---	---	----	----	----	---	----

Site/location	Date Notified	Type of Hazard	Response	Action
Polk Elementary School 435 Buckingham Street	in a company of the c		DEP directed the property owner to post warning signs and maintain security of the area to limit access to the polluted soil until the site is cleaned up. DEP directed the property owner to identify potable wells up to 500 feet away from the site.	Polluted soil removed; no additional abatement action necessary. One well was identified within 500 feet and sampled, with no detection of the pollutants reported at the site.
Residential Property 1650 Litchfield Road	3/28/2006	Pollution was detected in a drinking water well but is below standards.	inking water well but is below contaminated well and determined ex	
Ten Acre Mall 595 Straits Turnpike	6/19/2009	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to submit a plan to delineate the extent of the groundwater plume and to evaluate the potential impact on nearby residences.	Sampling of sub-slab soil vapor shows pollution levels are below those that pose a significant risk to indoor air. Annual monitoring program implemented for on-site and off-site wells to evaluate dissolved phase volatile organic pollution.
Winchester Electronics Facility 400 Park Road	8/10/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 1000 feet from the site for pollutants detected at the site.	Potentially impacted supply wells were sampled. No pollutants were detected. Investigation and remediation (if needed) of site continues under Property Transfer Program.
West Hartford				
Site/location	Date Notified	Type of Hazard	Response	Action
Goodrich Pump & Engine Control Systems 1 Charter Oak Boulevard	11/10/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement, limiting the potential for contact.	Access to polluted soil is limited; no specific hazard abatement action necessary.
Goodrich Pump & Engine Control Systems 1 Charter Oak Boulevard	7/25/2005	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Recent groundwater monitoring data does not show vinyl chloride present at concentrations exceeding the significant environmental hazard threshold.
Jacobs Manufacturing (former) 176 Newington Road	,		DEP directed the responsible party to submit a schedule for the necessary work to address the groundwater contamination issue and determine if there are any downgradient receptors impacted by the release.	Soil vapor under building tested, and found to be below criteria.

West Hartford

Site/location	Date Notified	Type of Hazard	Response	Action
Jacobs Manufacturing site (former) 176 Newington Road	wington Road may pose a risk to human health assess the extent and degree of PCI contamination within the impacted areas and conduct soil removal and disposal were necessary in accordar		assess the extent and degree of PCB contamination within the impacted	Impacted soil removed; no further abatement action necessary.
West Haven				
Site/location	Date Notified	Type of Hazard	Response	Action
Baker Properties 351 Morgan Lane	7/25/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil and remove the polluted soil.	Fence installed to limit the potential for contact with polluted soil.
Proposed Magnet School 506 Boston Post Road	7/2/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is in a secure and fenced area limiting the potential for contact.	The site has been secured and fencing installed to limit the potential for contact with polluted soil.
Seaboard Metal Finishing Company, Inc. 50 Fresh Meadow Road	7/16/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite monitoring wells and identify and sample nearby wells if onsite wells have detections of pollutants above criteria.	Three downgradient wells identified and sampled. Pollution not detected in the wells.
Superior Cleaners 900 Orange Street	5/23/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two residential water supply wells identifed with solvent pollution above action levels. Carbon filters installed at both homes, with quarterly monitoring.
Superior Cleaners 900 Orange Street	eaners 2/6/2006 Pollution was detected at a level above standards in a drinking provide an alternate supply of provide an inventory of all drinking provide an inventory of all drinking water supply wells within 500 fee		DEP directed the property owner to provide an alternate supply of potable water to affected property, and to provide an inventory of all drinking water supply wells within 500 feet, test results for these wells, and status of any untested wells.	Inventory completed and carbon filter installed.
Westbrook				
Site/location	Date Notified	Type of Hazard	Response	Action
Residential Property 2/19/2010 Pollution drinking standard monitori		Pollution was detected in a drinking water well, above standards, in the course of monitoring conducted for a nearby remediation site.	After reviewing information provided in the hazard notification, and historical information, the DEP concurs with the notifier that the nearby remediation site is not the contamination source.	DEP sampled the impacted well (3/31/10) and found the water is potable. DEP sent letters to the property owners informing them of the analytical results. The letter also recommended that the property owners sample their wells on a regular basis.

Westbrook				
Site/location	Date Notified	Type of Hazard	Response	Action
Superior Auto Body (Former) 39 Grove Beach Road North	11/12/2013	Pollution was detected in a drinking water well but was below standards. Subsequent sampling did not detect pollution in the well.	DEEP advised the property owner to sample the onsite supply well periodically for the pollutant previously detected in the well.	No specific abatement action necessary, but periodic monitoring recommended as a best practice.
Westbrook XtraMart 130 Boston Post Road	2/11/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the responsible party to submit an already completed sensitive receptor survey, analytical results for two potable water suppply wells already sampled, and proof that a third potable water supply well did not exist.	All wells sampled, pollution either not detected or detected but below standards.
Weston				
Site/location	Date Notified	Type of Hazard	Response	Action
Residence 34 Ladder Hill Road South	9/28/2011	Pollution (an oil sheen) was observed but not chemically detected in a drinking water well.	DEEP directed the property owner remove free oil from the on-site well, to sample the on-site supply well periodically for the pollutants detected at the site, and to identify supply wells within 500 feet of the property.	Source of pollution removed, and monitoring data shows affected well is significantly below standards, no other supply wells identified within 500 feet of the property. No additional abatement action necessary.
Residence 6 Old Orchard Drive	2/2/2009	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the onsite well for pollutants detected at the site.	Oil impacted materials removed. Former water supply well sampled, pollution identified. Well bailed, re-sampled no pollution detected. No pollution detected in active supply well. No additional abatement action necessary.
Residential Property 20 Old Stage Coach Road	10/24/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	A water treatment system is installed; no specific hazard abatement action necessary.
Residential Property 12/21/2010 200 Steep Hill Road		Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue monitoring potentially at risk wells, and to propose further monitoring focused by increased understanding of the pollution problem.	Monitoring program continuing; remediation of source completed.
Westport				
Site/location	Date Notified	Type of Hazard	Response	Action
Embalmers Supply Company/Dorr-Oliver Lab 25 Ford Road	o (fo 1/7/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement limiting the potential for contact.	No additional abatement action necessary at this time.

Westport					
Site/location	Date Notified	Type of Hazard	Response	Action	
Metro North Station 1727+28	9/19/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is located on a fenced active railroad line, limiting the potential for contact.	Warning signs will be posted and soil will be properly managed when disturbed during construction.	
Wethersfield					
Site/location	Date Notified	Type of Hazard	Response	Action	
Wilkus Farm 138 Willow Street	7/9/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	4 wells identified and 4 wells sampled. Pollution not detected. No additional abatement action necessary.	
William Street Regulator Station 23 Williams Street	1/29/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is in a fenced utility station; no specific hazard abatement action necessary.	
Willington					
Site/location	Date Notified	Type of Hazard	Response	Action	
I-84 TravelCenter 327 Ruby Road	9/4/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data and determined that pollution in the water supply system water, as delivered to the tap, meets applicable standards.	Further sampling to be conducted as part of public water supply monitoring as required by Department of Public Health. On-going groundwater monitoring being performed.	
Mobil Station # 13693 (01-GL1) 470 River Road	5/26/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	All wells sampled, pollution either not detected or detected but below standards. Monitoring program implemented.	
Wilton					
Site/location	Date Notified	Type of Hazard	Response	Action	
Calitri Revocable Trust 46 Danbury Road	2/23/2011	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water to the impacted building.	Building connected to public water and well abandoned.	
Mobil Service Station No. 01-340 932 Danbury Road	4/14/2010	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well. DEP directed the property owner resample the onsite supply well sample 4 nearby wells for polluting detected at the site and provide of the proposed tank removal and the proposed tank removal and the property owner resample the onsite supply well sample 4 nearby wells for polluting detected at the site and provide of the proposed tank removal and the property owner resample the onsite supply well sample 4 nearby wells for polluting detected in groundwater above standards.		Underground tanks removed 7/10. Some supply wells sampled 6/10 for pollutants of concern. Pollution detected onsite but below standards. Pollution not detected in tested offiste wells; but access to some offsite	

Wilton				
Site/location	Date Notified	Type of Hazard	Response	Action
37 Kellogg Drive above standards may threaten a rundrinking water well.		DEEP directed the property owner to resample the on-site supply well and monitoring wells and identify and sample nearby wells for pollutants detected at the site.	Source of pollution removed, monitoring program implemented.	
Residence 30 Quail Ridge Road	12/16/2008	Pollution was detected in a drinking water well above standards.	DEP directed the local Health Department to provide an alternate supply of potable water to the property owner and resample the well. DEP also directed the Health Department to identify and samples wells up to 0.75 miles from the Wilton Landfill.	All wells sampled, pollution triggering the hazard notification was not detected in subsequent testing (three rounds) of the well at 30 Quail Ridge Road. Monitoring program implemented and continues at the closed Wilton Landfill.
Residential Property 23 Rossimur Court	11/22/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data for the threatened well and determined that the presence of pollution was not confirmed.	A water treatment system is installed; no additional hazard abatement action necessary. DEP recommended periodic well testing.
Residential Property 26 Pond Road	3/22/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well for pollutants detected at the property, determine the extent of groundwater impacts detected on the property, and identify supply wells within 500 feet of the property.	Monitoring found no impact to supply wells is assoicated with the release. Polluted soil was treated and removed to the extent practical. No further active abatement or monitoring necessary.
Residential Property 68 Pipers Hill Road	11/22/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the on-site supply well and sample any water supply well within 500 feet of the site for pollutants detected at the site and investigate groundwater quality downgradient of the release location.	Source of pollution removed, and monitoring data shows affected well and groundwater are below standards. No additional hazard abatement action necessary.
Winchester				
Site/location	Date Notified	Type of Hazard	Response	Action
New England Bark Mulch 167 Torrington Road	10/20/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Onsite supply well contained no contaminants above standards. Pollution source was removed and site is undergoing groundwater monitoring. No off-site wells identified as atrisk. No additional hazard abatement action necessary.

Winchester					
Site/location	Date Notified	Type of Hazard	Response	Action	
Winchester XtraMart 1/11 102 Colebrook River Road		Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify the nearest downgradient offsite well and test it for volatile organic compounds and petroleum, and also to provide a map of groundwater flow directions.	Groundwater flow direction determined and no downgradient drinking water wells identified within 500 ft. Scope of work submitted indicating that further investigation of pollution is pending.	
Windsor					
Site/location	Date Notified	Type of Hazard	Response	Action	
Konica Minolta Business Solutions USA, Inc. 550 Marshall Phelps Road	9/5/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to implement a proposed action plan that includes removal of impacted soil and collection of post remedial soil samples.	550 gallon underground tank and 20-30 cubic yards of soil were removed in 12/08.	
Windsor Locks					
Site/location	Date Notified	Type of Hazard	Response	Action	
Camp Hartel 580 North Street	6/7/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to implement the abatement plan included with the hazard notification and to sample identified threatened drinking water wells	The sampled wells did not have detectable concentrations of the target petroleum compounds.	
Wood Group Power, Inc. 523 Halfway House Road	10/14/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	ay pose a risk to human health maintain fencing around site and erect		
Wolcott					
Site/location	Date Notified	Type of Hazard	Response	Action	
Commercial Building 1496 Wolcott Road	1/29/2014	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and the identified nearby wells for pollutants detected at the site.	Action pending.	
Eagle Cleaners 372 Wolcott Rd	1/17/2007	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Property connected to municipal water 4/07. Additional investigation results submitted 5/16/07. Only two wells sidegradient to pollution are still unsampled.	

Wolcott				
Site/location	Date Notified	Type of Hazard	Response	Action
Max's Wolcott Gulf 685 Wolcott Road	1/11/2005	Pollution was detected in a drinking water well but is below standards.	See above response for 1/3/2005 significant environmental hazard notification.	Remediation on-going. Pollution largely contained and has significantly decreased in concentration and extent. Bottled water/treatment provided where supply wells polluted. Currently, all nearby supply wells connected to municipal water supply.
Max's Wolcott Gulf 685 Wolcott Road			Remediation on-going. Pollution largely contained and has significantly decreased in concentration and extent. Bottled water/treatment provided where supply wells polluted. Currently, all nearby supply wells connected to municipal water supply.	
Woodbridge				
Site/location	Date Notified	Type of Hazard	Response	Action
Parcel 60 Woodfield Road	9/23/2009	Pollution was detected in a drinking water well above standards.	DEP acknowledges receipt of this SEHN and will follow up with the property owner regarding actions that have been, and must still be, taken.	Mr. Merith Rozner, real estate agent for current owner of 60 Woodfield Road, called to inform DEP that his client installed a filter system, at the site, upon purchase of the property from Woodbridge Country Club, Inc.
Residential Property 78 Ansonia Road	1/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Underground tank removed, soil and groundwater remediated. Contaminant levels below all applicable criteria.
Town of Woodbridge Dog Pound 135 Bradley Road	1/14/2003	<u>'</u>		Supply well was retested. Pollution was consistantly detected significantly below standards. No additional hazard abatement action necessary.
Town of Woodbridge Public Works 15 Meetinghouse Lane	9/20/2002	Pollution was detected in a drinking water well but is below standards.	DEP determined that pollution in the well is significantly below standards, and the water is safe for human consumption.	Source of pollution remediated; no additional hazard abatement action necessary. Monitoring ongoing.
Woodbridge Country Club 50 Woodfield Road	4/1/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and secure the area to limit access to the polluted soil until the site is cleaned up.	Signage has been posted and area has been secured limiting access to the polluted soil.

Woodbury					
Site/location	Date Notified	Type of Hazard	Response	Action	
Connecticut Tube Products 194 Old Town Farm Road	3/27/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells.	Wells sampled, pollution detected below standards. No additional abatement action necessary.	
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP also requested resampling of the groundwater to further evaluate the threat to surface water and aquatic life.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.	
Dom's Lynn's Corner Deli 1633 Main Street North	6/21/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Six drinking water wells and site's well sampled. Pollution was either not detected or was detected significantly below standards. No further abatement action necessary.	
Residence 1181 Main Street North	1/16/2014	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed sampling data for the threatened wells and determined pollution is not present in the wells. DEEP requested a plan for investigation and potential remediation of soil along with further monitoring of threatened wells, if necessary.	13 wells identified and 12 wells sampled, pollution not detected. Plan for further investigation and potential remediation of soil being developed. If necessary, further monitoring of threatened wells will be required.	
Woodbury Mobil 718 Main Street South	3/19/2004 Pollution detected in groundwater above standards may threaten a drinking water well. Polluted groundwater beneath an occupied building could affect indoor air quality.		DEP reviewed additional actions taken and determined that they adequately address the reported hazard conditions.	At-risk wells sampled with no pollution detected, except in a well already with a treatment system. Vent system operated to prevent impact on indoor air quality until 2006 when groundwater quality improved. No additional abatement action required.	
Woodstock					
Site/location	Date Notified	Type of Hazard	Response	Action	
Woodstock Department Public Works Garage 215 Coatney Hill Road	5/19/2006	Pollution other than a substance for which the commissioner has established a ground water protection criterion was detected	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 1000 feet away from the site for sodium and	Nearby wells identified and sampled. Monitoring program implemented.	

chloride.

in a drinking water well.

Appendix F: City of Meriden File Review Information




PROPERTY CARD

PROPER	TY CARD						
Property Information:	Address: 1 KING PL	Map/Lot: 01	12-0054-0	001-0	019Card	Number: 1	
Owner Information:	MERIDEN CITY OF	Owner Add			MAIN ST , CT 064		
Building Information:	Units: 1 Living Area: 175911 Year Built: 1980 Eff. Age: Rooms: Bedrooms:	Full Halt	Bath: Bath Rati f Bath: f Bath Rati			Heat Type: Warm- Style: Office Ext Wall: Roof Mat: Roof Struct: Fireplaces: Grade: C	+Cool
Special	Description	Condition	YearBuilt	Assess	edValue		
Features:	PAVING ASPHALT	FR	1980	\$112,5	00		
	ELEVATOR - PASSENG	ER AV	1980	\$145,9	00		
	SILO	AV	1980	\$3,500			
Appraisal Information:	Current Building Value: \$5,010,700 Current Yard Items: \$116,000 Current Total: \$6,987,700 Assessment: \$7,238,140 Assessment is 70% of appraised value. PrevYear: 2012 PrevBuildingValue: \$8,363,200 PrevYardItems: \$116,000 PrevLandValue: \$1,861,000 PrevLandValue: \$1,861,000 PrevTotal: \$10,340,200						
Information:	Туре	Land Use	Lot S	ize	Lot Unit	Neighborhood	Zoning*
		Parking Garage	245700.0	00000	SF	INNER CITY AREA	TODH
		Parking Garage	0.00000		SF	INNER CITY AREA	TODH
		Parking Garage	0.00000		SF	INNER CITY AREA	TODH
	Total Acreage:5.64 *Confirm zoning with	Planning Offi	ce. Zoning	map	is the offi	cial document.	
Sales Information:	Book Page 4874 313 BRADLEY 3262 327 JEMINC	Grantor RESEARCH CE	NTER LLC	, 1/7/2		Price Deed Type 19,000 Foreclosure	

	2416 26	7	12/1/1998 \$0		
Assessor's Permit	Permit Date Number		Notes		
History:	1/1/1900	1976	DEMOLITION OF 3 WOOD HOUSES	İ	
	1/1/1900	4071	AIR TEST AND INSPECT EXISTING GAS PIP AND APPLIANCES FOR SAFE OPERATION		

Property Images

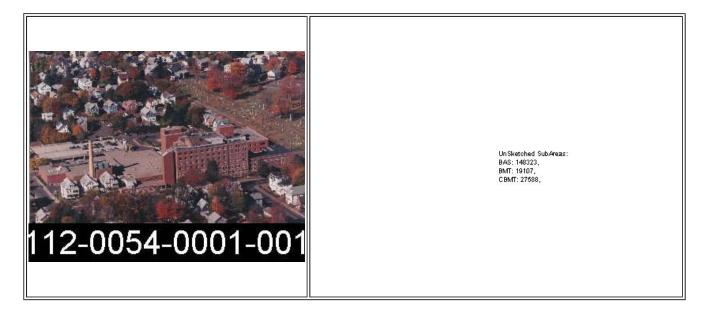



PROPERTY CARD

	I I CARD								
Property Information:	Address: 1 KING PL	Map/Lot: 01	12-0054-0001-0	019Card	Number: 2				
Owner	MERIDEN CITY OF	MERIDEN CITY OF Owner Address: 142 EAST MAIN ST							
Information:			MERIDEN	, CT 064	150				
Building Information:	Units: 1 Living Area: 0 Full Bath: Year Built: 1980 Full Bath Rating: Eff. Age: Half Bath: Rooms: Half Bath Rating: Bedrooms:			Heat Type: No Heat Style: Park Gar Ext Wall: Roof Mat: Roof Struct: Fireplaces: Grade: C					
Special Features:	No special features								
Appraisal Information:	Tax District: 2 Dis	trict Name: I	NNER DISTRIC	CT Distri	ict Mill Rate: 37.09				
	Current Building Value: \$731,000 Current Yard Items: \$0 Current Land Value: \$0 Current Total: \$731,000 Assessment: \$7,238,140 Assessment is 70% of appraised value. PrevYear: 2012 PrevBuildingValue: \$8,363,200 PrevYardItems: \$116,000 PrevLandValue: \$1,861,000 PrevTotal: \$10,340,200								
	Special Land Value: \$0								
Land Information:	Туре	Land Use	Lot Size	Lot Unit	Neighborhood	Zoning*			
	Commercial Building	Parking Garage	245700.00000	SF	INNER CITY AREA	TODH			
	Commercial Building	Parking Garage	0.00000	SF	INNER CITY AREA	TODH			
	Commercial Building	Parking Garage	0.00000	SF	INNER CITY AREA	TODH			
	Total Acreage:5.64 *Confirm zoning with	Planning Offic	ce. Zoning map	is the office	cial document.	-			
Sales Information:	No sales info found								
Assessor's Permit History:	Date Permit Number 1/1/1900 1976	DEMOLITION	OF 3 WOOD HOU	Notes (SES		Туре			
	1/1/1900 4071								

	11 1111	AIR TEST AND INSPECT EXISTING GAS PIP AND APPLIANCES FOR SAFE OPERATION	
-	Property Images		
	×		



PROPERTY CARD

	I I CARD							
Property Information:	Address: 1 KING PL	Map/Lot: 01	12-0054-0001-0	019Card	Number: 3			
Owner Information:	MERIDEN CITY OF Owner Address: 142 EAST MAIN ST							
Information:	MERIDEN, CT 06450							
Building Information:	Units: 1 Living Area: 111405 Year Built: 1965 Eff. Age: Rooms: Bedrooms:	Full Half	Bath: Bath Rating: Bath: Bath Rating:		Heat Type: Forced Style: Office Ext Wall: Roof Mat: Roof Struct: Fireplaces: Grade: C	Air		
Special Features:	No special features							
Appraisal Information:	Tax District: 2 District Name: INNER DISTRICT District Mill Rate: 37.09							
	Current Building Value: \$2,621,500 Current Yard Items: \$0 Current Land Value: \$0 Current Total: \$2,621,500 Assessment: \$7,238,140 Assessment is 70% of appraised value. PrevYear: 2012 PrevBuildingValue: \$8,363,200 PrevYardItems: \$116,000 PrevLandValue: \$1,861,000 PrevTotal: \$10,340,200							
	Special Land Value: \$0							
Land Information:	Туре	Land Use	Lot Size	Lot Unit	Neighborhood	Zoning*		
	Commercial Building	Parking Garage	245700.00000	SF	INNER CITY AREA	TODH		
	Commercial Building	Parking Garage	0.00000	SF	INNER CITY AREA	TODH		
	Commercial Building	Parking Garage	0.00000	SF	INNER CITY AREA	TODH		
	Total Acreage: 5.64 *Confirm zoning with Planning Office. Zoning map is the official document.							
Sales Information:	No sales info found							
Assessor's Permit History:	Date Permit Number	DEMOLITICAL	OF 1 WOOD HOL	Notes		Туре		
	1/1/1900 1976 1/1/1900 4071	DEMOLITION	OF 3 WOOD HOU	SES				

	11 1111	AIR TEST AND INSPECT EXISTING GAS PIP AND APPLIANCES FOR SAFE OPERATION	
-	Property Images		
	×		

Appendix G: CTD EEP Natural Diversity Data Base Map – City of Meriden, CT

Natural Diversity Data Base Areas

MERIDEN, CT

December 2013

State and Federal Listed Species & Significant Natural Communities



NOTE: This map shows general locations of State and Federal Listed Species and Significant Natural Communities. Information on listed species is collected and compiled by the Natural Diversity Data Base (NDDB) from a number of data sources. Exact locations of species have been buffered to produce the general locations. Exact locations of species and communities occur somewhere in the shaded areas, not necessarily in the center. A new mapping format is being employed that more accurately models important riparian and aquatic areas and eliminates the need for the upstream/downstream searches required in previous versions.

This map is intended for use as a preliminary screening tool for conducting a Natural Diversity Data Base Review Request. To use the map, locate the project boundaries and any additional affected areas. If the project is within a shaded area there may be a potential conflict with a listed species. For more information, complete a Request for Natural Diversity Data Base State Listed Species Review form (DEP-APP-007), and submit it to the NDDB along with the required maps and information. More detailed instructions are provided with the request form on our website.


www.ct.gov/deep/nddbrequest

This file has PDF Layers. Look for the Layers tab on the left. Expand the layers and use the "eye" icons to change visibility.

QUESTIONS: Department of Energy and Environmental Protection (DEEP) 79 Elm St., Hartford CT 06106 Phone (860) 424-3011



Connecticut Department of Energy & Environmental Protection Bureau of Natural Resources Wildlife Division

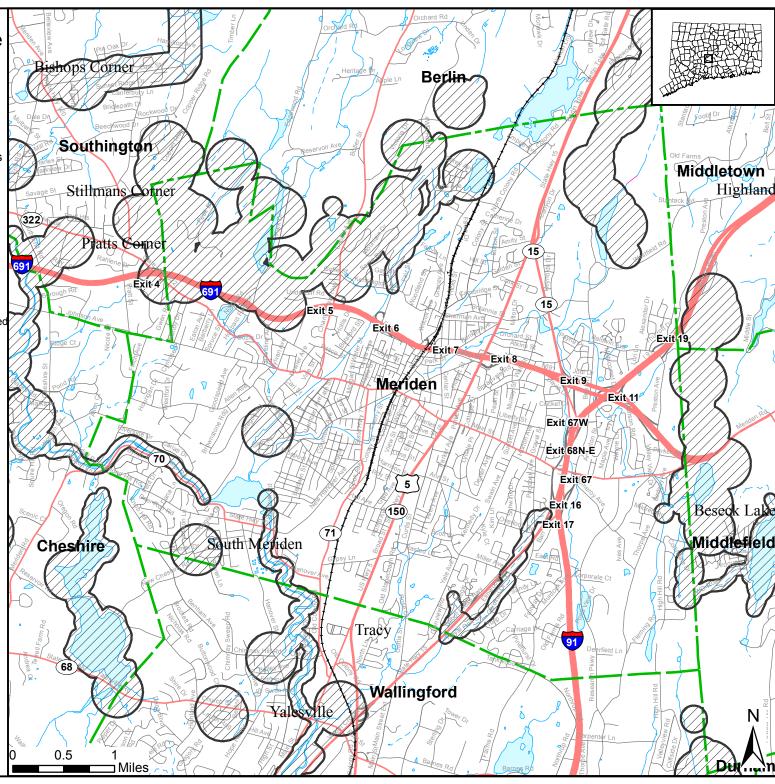

Appendix H: EDR Certified Sanborn® M ap Report

1 King Place

1 King Place Meriden, CT 06451

Inquiry Number: 3915976.3

April 17, 2014

Certified Sanborn® Map Report



Certified Sanborn® Map Report

4/17/14

Site Name: Client Name:

1 King Place
1 King Place
1 King Place
100 Great Meadow Road
Meriden, CT 06451
Wethersfield, CT 06109-0000

EDR Inquiry # 3915976.3 Contact: Shelby Miller



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Vanasse Hangen Brustlin, Inc. were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Site Name: 1 King Place
Address: 1 King Place
City, State, Zip: Meriden, CT 06451

Cross Street:

P.O. # NA

Project: 1 King Place **Certification #** 816F-4C62-B929

Maps Provided:

1971

1953

1950

1901

1896

1896



Sanborn® Library search results Certification # 816F-4C62-B929

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

✓ Library of Congress

University Publications of America

▼ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Vanasse Hangen Brustlin, Inc. (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1971 Source Sheets





Volume 1, Sheet 12

Volume 1, Sheet 53

1953 Source Sheets





Volume 1, Sheet 12

Volume 1, Sheet 53

1950 Source Sheets



Volume 1, Sheet 53

1901 Source Sheets





Volume 1, Sheet 12

Volume 1, Sheet 13


1896 Source Sheets




Volume 1, Sheet 31

1891 Source Sheets


1971 Certified Sanborn Map

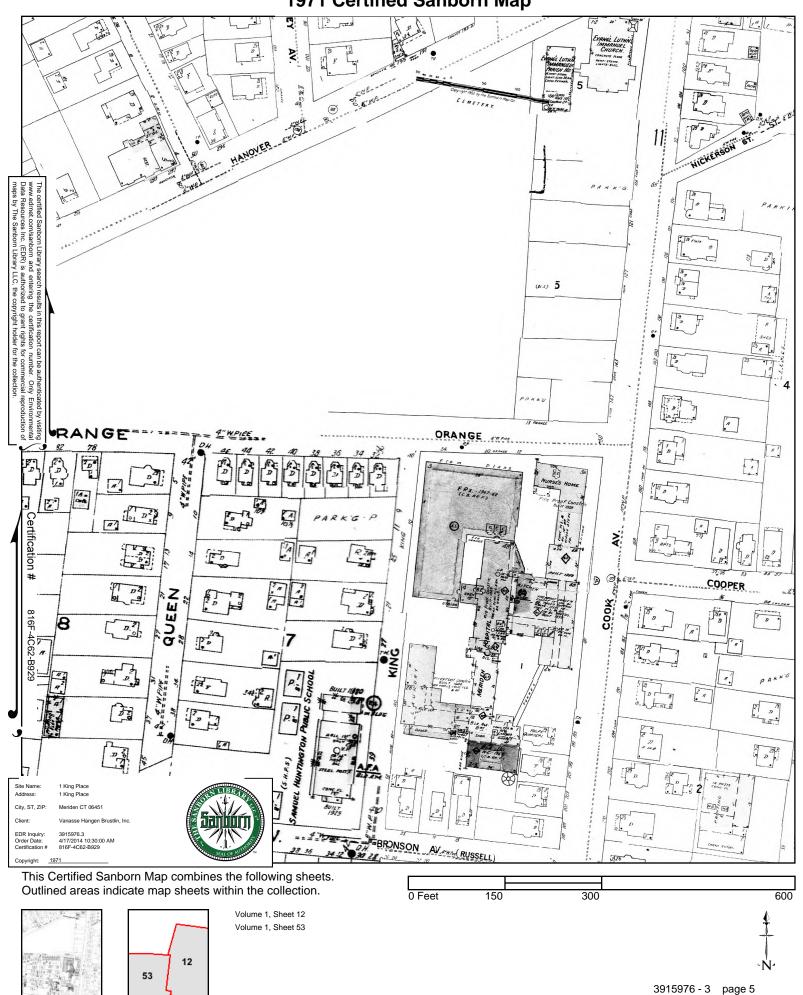

1953 Certified Sanborn Map

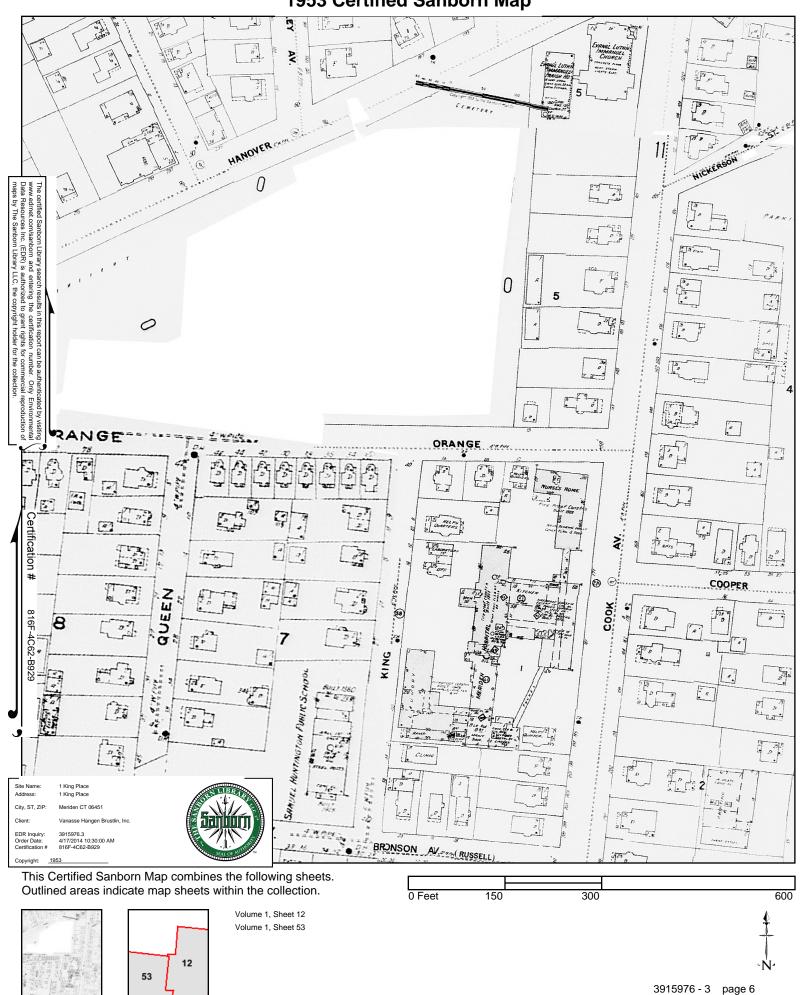

1950 Certified Sanborn Map

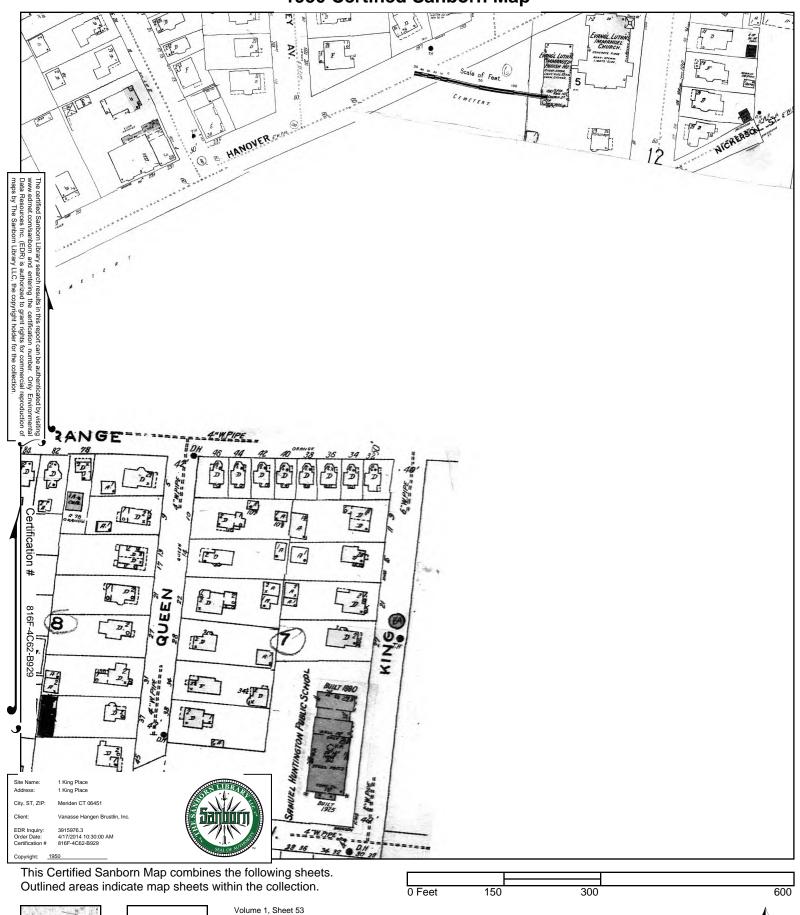


Manager Andrews Andrew

volume 1, Sheet 33




3915976 - 3 page 7

1901 Certified Sanborn Map

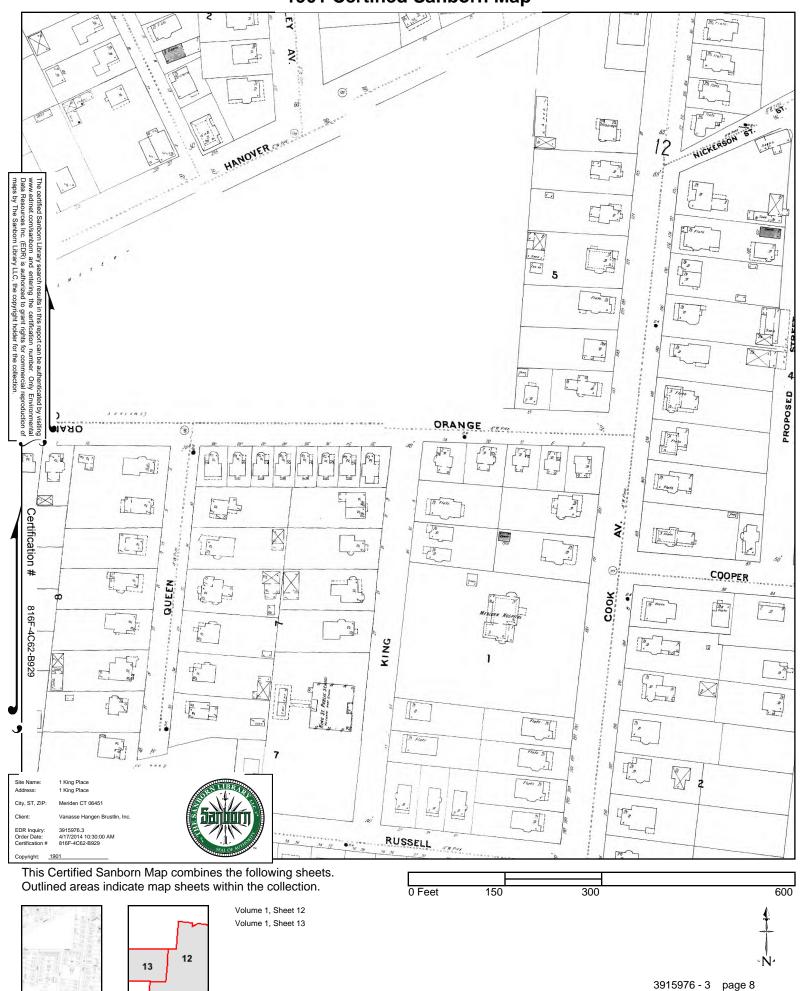

1896 Certified Sanborn Map

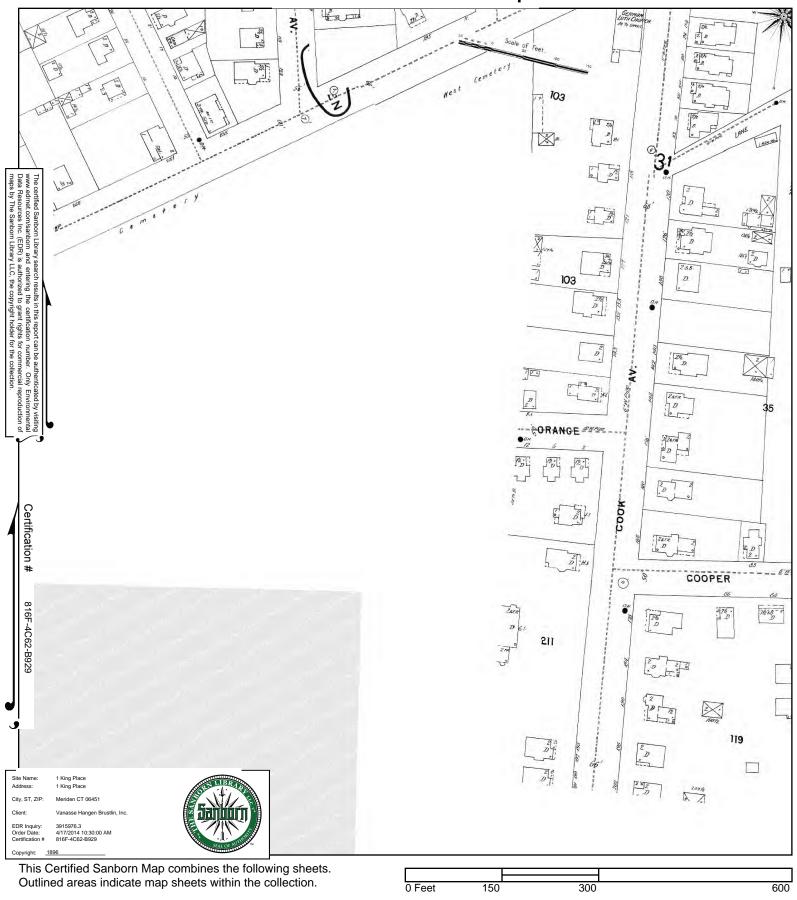





Volume 1, Sheet 31



1891 Certified Sanborn Map

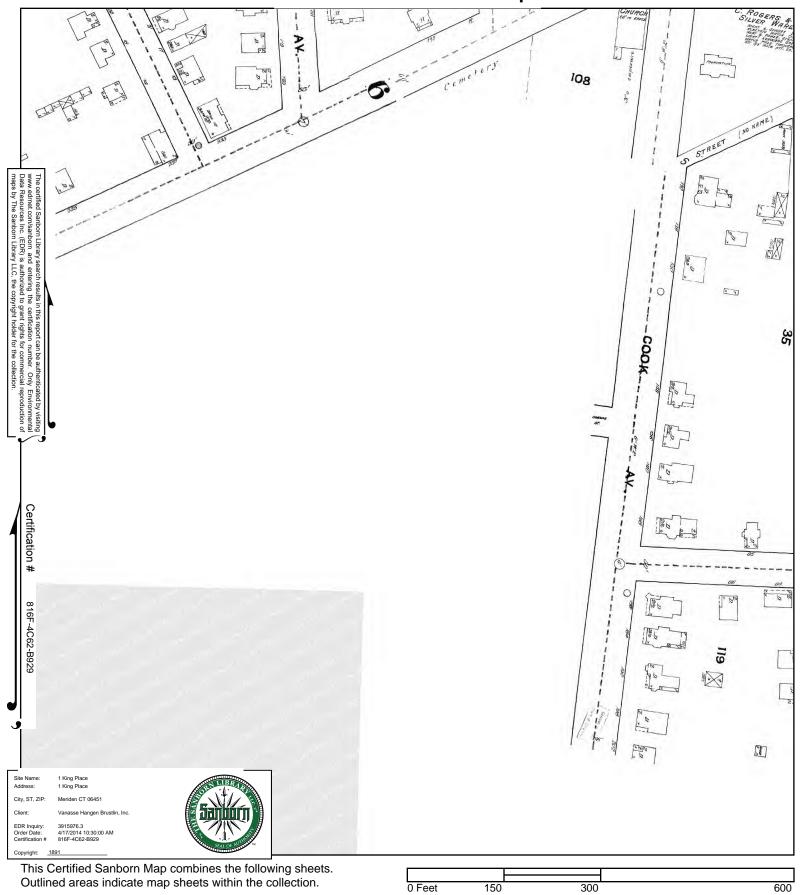

Outlined areas indicate map sneets within the co

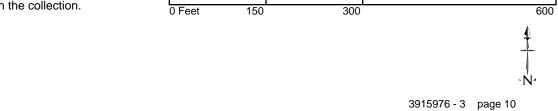

Appendix I: EDR City Directory Image Report

1 King Place 1 King Place Meriden, CT 06451

Inquiry Number: 3915976.5

April 22, 2014

The EDR-City Directory Image Report



TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING. WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	Target Street	Cross Street	<u>Source</u>
2013			Cole Information Services
2008			Cole Information Services
2003	$\overline{\checkmark}$		Cole Information Services
1999	$\overline{\checkmark}$		Cole Information Services
1990			Johnson's City Directory
1977			Price & Lee's City Directory
1970			Price & Lee's City Directory
1963			Price & Lee's City Directory

RECORD SOURCES

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

FINDINGS

TARGET PROPERTY STREET

1 King Place Meriden, CT 06451

<u>Year</u>	CD Image	<u>Source</u>	
KING PL			
2013	-	Cole Information Services	Target and Adjoining not listed in Source
2008	-	Cole Information Services	Target and Adjoining not listed in Source
2003	pg A1	Cole Information Services	
1999	pg A2	Cole Information Services	
1990	-	Johnson's City Directory	Street not listed in Source
1977	-	Price & Lee's City Directory	Street not listed in Source
1970	-	Price & Lee's City Directory	Street not listed in Source
1963	-	Price & Lee's City Directory	Street not listed in Source

3915976-5 Page 2

FINDINGS

CROSS STREETS

No Cross Streets Identified

3915976-5 Page 3



<u>Target Street</u> <u>Cross Street</u> <u>Source</u>

✓ - Cole Information Services

KING PL 2003

1	MERIDEN EXPRESS LINE		

<u>Target Street</u> <u>Cross Street</u> <u>Source</u>

✓ - Cole Information Services

KING PL 1999

1 COUNSELING CENTER VETERANS MEMORIAL MEDICAL CENTER
DONACO PROPERTY MANAGEMENT
HMR WEIGHT MANAGEMENT PROGRAM
JAMES MCGUIRE
MEDSEARCH VETERANS MEMORIAL MEDICAL CENTER
MIDSTATE MEDICAL CENTER LABORATORY
PRESTIGE CLUB MIDSTATE MEDICAL CENTER
PRESTIGE CLUB VETERANS MEMORIAL MEDICAL CENTER
VETERANS MEML MEDICAL CENTER BECOMING MID STAT MEDICAL C
VETERANS MEML MEDICAL CENTER BECOMING MIDSTATE MEDICAL C
VETERANS MEMORIAL MEDICAL CENTER WEST CAMPUS

3915976.5 Page: A2

Appendix J. Site Photographs

Photos:

Photo #: 1




Description: View of the lobby entrance to the hospital from King Place.

Photo #: 2



Description: View of room off main entrance. Sheetrock is damaged and insulation has been pulled from the wall. Standing pool of water in background is several inches deep.

Photo #: 3

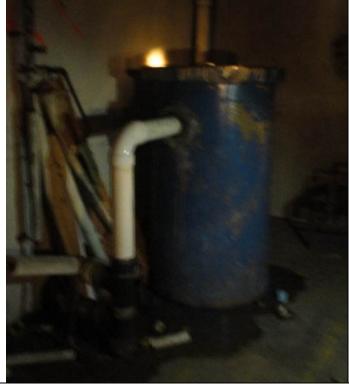

Description: View of holding container in basement of the main building area.

Photo #: 4



Description: Maintenance/storage room in the basement area.

Photo #: 5



Description: Racks of fluorescent light tubes in the maintenance/storage room. These bulbs all appeared to be unused.

Photo #: 6



Description: View of one of several paint cabinets observed in the basement.

Photo #: 7



Description: View of several drums and buckets of chemicals in room located behind paint cabinet in Photo #: 6.

Photo #: 8



Description: View of unspent fire extinguishers in the 'Crib,' which is located in the basement.

Photo #: 9



Description: View of various jugs of chemicals and solvents in the 'Crib.'



Description: View of drum on metal walkway leading into the main sub-basement area.





Description: View of former electrical equipment in the main sub-basement area.





Description: Piping and other components in the main sub-basement area.

Photo #: 13



Description: Air filtration system in the main subbasement area.

Photo #: 14



Description: View of pipe wrapping. Pipe wrapping appeared to be disturbed in many locations. Fibers could be seen as part of the wrapping material.

Photo #: 15



Description: View of compressor located in the main sub-basement area.



Description: View of compressed air tanks in the vicinity of the compressor shown in Photo #: 17.

Photo #: 17



Description: Several buckets of chemicals located on the basement floor.

Photo #: 18



Description: View of solvents on a shelf in the 'Crib.'

Photo #: 19



Description: View of refrigeration oil in the 'Crib.'

Photo #: 20



Description: View of small container of lubricant located on a table in the 'Crib.'

Photo #: 21



Description: View of autopsy room/morgue in the basement.

Photo #: 22



Description: View of elevator equipment for the freight elevator located next to the morgue in the basement.

Photo #: 23



Description: View of several 5-gallon buckets amongst insulation and fire extinguisher material in the basement.

Photo #: 24



Description: View of floor drain in the basement.

Photo #: 25



Description: Signs indicating the presence of asbestos.

Photo #: 26



Description: Flooded sub-basement area. Water was at least eight inches deep.

Photo #: 27



Description: View of ports on the wall indicating the use of various gases in this room. This room was likely used as an operating room. Eight of these rooms were observed in the basement.



Description: X-ray viewers visible in the suspect operating rooms.

Photo #: 29



Description: View of device hanging from ceiling in suspect operating room.





Description: View of x-ray film processing area.



Description: Small storage room containing a number of black trash bags. While the contents of each could not be confirmed, based on a few small openings, the contents are believed to be insulation.

Photo #: 32



Description: A drum located in the boiler room. Suspect staining observed on the floor beneath.

Photo #: 33

Description: One of the boilers located in the boiler room.

Photo #: 34




Description: Row of drums located in the boiler room. Due to poor lighting, VHB was unable to confirm if discoloration in floor was due to the presence of water or a result of staining.

Photo #: 35



Description: Addition storage area in the boiler room.

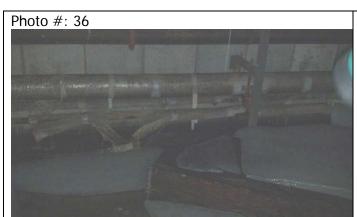

Description: Flooded and iced-over sub-basement located off the boiler room.

Photo #: 37



Description: View of large pile of debris, specifically pipe wrappings, etc.



Description: Drum observed in the boiler room. Discoloration/potential staining observed on the bottom of the drum.



Description: Several empty oil containers in the boiler room.



Description: Large mound of debris located in the loading dock. Debris appears to be office waste (furniture, computers, etc.) and building waste (such as pipe insulation).

Photo #: 41



Description: View of oil slick observed in the loading dock.

Photo #: 42



Description: View of several buckets located next to the oil slick in the loading dock.

Photo #: 43



Description: One of several piles of tires located throughout the building.



Description: View of large room in the basement containing hundreds of light boxes.





Description: View of deteriorating metal bucket in the basement.

Photo #: 46



Description: View of makeshift fire pit located in the atrium, on the first floor of the main hospital area.

Photo #: 47



Description: View of room filled with pipe wrappings, insulation, and other debris.




Description: View of mold in one of the walk-in refrigerator/freezers in the kitchen area.

Photo #: 49



Description: View of mold/mildew on the floor in the kitchen area.

Photo #: 50

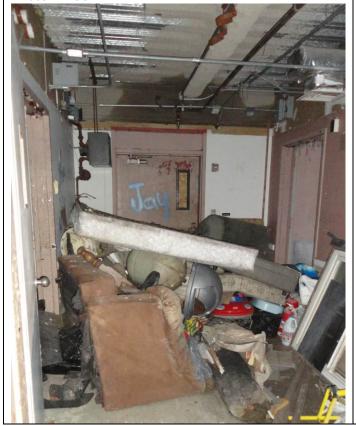

Description: View of room containing solid waste including furniture and household items.



Description: Entrance to the former nurses building.

Photo #: 52

Description: View of former laboratory area on the third floor of the building.



Description: View of former laboratory area on the third floor of the building.



Description: View of staining observed in the cabinetry in the former laboratory spaces.

Photo #: 55



Description: View of building material debris stockpiled on the fourth floor.





Description: View of blocked entrance to the fifth floor of the building.

Photo #: 57



Description: View of paved parking area located to the west of King Place.

Photo #: 58



Description: View of King Place. 'Meriden Sewer' manhole observed in the foreground.

Photo #: 59




Description: View storm water catch basin located in King Place.

Photo #: 60



Description: View of vegetation located on the southern side of the Site building along Bronson Avenue.

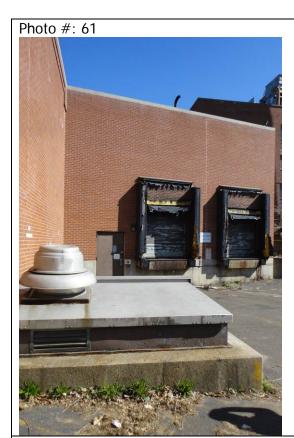

Description: View of loading dock area looking north from Bronson Avenue.





Description: View of boiler room smoke stack from loading dock area.

Photo #: 63



Description: View of grassy area in the southeastern corner of the property.

Photo #: 64



Description: Evidence of underground storage tanks adjacent to the boiler house smoke stack.

Photo #: 65



Description: Catch basin located in the vicinity of the USTs.

Photo #: 66



Description: View of the hospital looking northwest from the corner of Bronson Avenue and Cook Avenue.



Description: View of courtyard between main hospital building and the former nurses building. At least one UST is believed to be located here.





Description: View of transformer located in the basement of the former nurses building.





Description: View of former sump pump located in the same room as the transformer shown in Photo #: 68.



Description: View of elevator equipment located in the basement of the former nurses building.